



**INTERNATIONAL CIVIL AVIATION ORGANIZATION
ASIA AND PACIFIC OFFICE**

**REPORT OF
THE THIRD MEETING OF THE DOWNLINK AIRCRAFT PARAMETERS
(DAPS) WORKING GROUP
(MODE S DAPS WG/3)**

Video Conference
(12 to 14 May 2020)

The views expressed in this Report should be taken as those of
the Meeting and not the Organization.

Approved by the Meeting
And published by the ICAO Asia and Pacific Office, Bangkok

Table of Contents

HISTORY OF THE MEETING	Page
Introduction.....	i-1
Attendance	i-1
Opening of the Meeting	i-1
Officer and Secretariat	i-1
Organization, working arrangement and language	i-1
SUMMARY OF DISCUSSIONS	
Agenda Item 1: Adoption of Agenda.....	1
Agenda Item 2: Review outcome of relevant meetings	1
Agenda Item 3: Sharing of State’s implementation on Mode S.....	1
Agenda Item 4: Mode S monitoring and analysis	3
Agenda Item 5: Review the Action Items from DAPs WG/2 Meeting.....	4
Agenda Item 6: Discussion on Roadmap on Mode S DAPs and related issues in APAC region.....	4
Agenda Item 7: Review Guidance Material of implementation of Mode S DAPs.....	7
Agenda Item 8: Next meetings and any other Business	8
LIST OF APPENDICES	
Appendix A: DAPs Implementation Status in the APAC Region	
Appendix B: Action Items List	
Appendix C: The APAC Regional Roadmap for Mode S Implementation	
Appendix D: Mode S Downlink Aircraft Parameters Implementation and Operations Guidance Document (Edition 2.0)	
Appendix E: Revised TOR of DAPs WG	
LIST OF ATTACHMENTS	
Attachment 1: List of participants	
Attachment 2: List of working and information papers	

1. Introduction

1.1 The Third Meeting of the Mode S Downlink Aircraft Parameters working group (Mode S DAPs WG/3) was held via video conference due to the COVID-19 pandemic from 12 to 14 May 2020, which had been planned to be hosted by AEROTHAI in Bangkok.

2. Attendance

2.1 The meeting was attended by 64 participants from Australia, China, Hong Kong - China, India, Indonesia, Japan, Malaysia, Nepal, Philippines, Republic of Korea, Singapore, Sri Lanka, Thailand, United States, and IFALPA, via video conference. List of participants is at **Attachment 1**.

3. Opening of the Meeting

3.1 The meeting was opened by Mr. Ho Wee Sin, Deputy Director (Technical Standards and Support) of Aeronautical Telecommunications and Engineering Division, Civil Aviation Authority of Singapore, Co-chair of DAPs Working Group. He thanked Aeronautical Radio of Thailand Limited (AEROTHAI) for the hospitality and support to the original planning of the face to face meeting and encouraged the participants to meet the challenge of video conference for success.

3.2 Mrs. Xie Yulan, the Chief Engineer of North China Regional Air Traffic Management Bureau of CAAC, Co-chair of DAPs Working Group, recalled the achievements made by the working group, highlighted the value of Mode S DAPs implementation in the region and expressed her thanks to all participants' contribution.

3.3 On behalf of Mr. Arun Mishra, ICAO Regional Director, Mr. Luo Yi, Regional Officer CNS extended warm welcome to all participants and expressed deep appreciation and gratitude to the efforts of all parties in supporting the setting up of this on-line event without compromising the values to the air navigation implementation in States, he thanked AEROTHAI for the continuous support to ICAO regional activities particularly in the fast changing situation due to the outbreak of COVID-19.

4. Officers and Secretariat

4.1 Mrs. Xie Yulan and Mr. Ho Wee Sin co-chaired the meeting. Mr. Luo Yi, Regional Officer CNS, Asia and Pacific Office acted as the secretary with the support of Ms. Bhabhinan Sirapongkosit, the Programme Assistant of the same office, in operating the WebEx platform during the meeting.

5. Organization, Working Arrangements and Language

5.1 The meeting met as a single body and working language was English only, inclusive of all documentation and this Report. A total of Eight (8) Working Papers and Eleven (11) Information Papers were considered by the meeting. A List of Working Papers and Information Papers is provided at **Attachment 2**.

Agenda Item 1: Adoption of Agenda

- 1.1 The tentative agenda items presented in **WP/1** were adopted as agenda for the meeting.

Agenda Item 2: Review outcomes of relevant meetings

Outcome of Relevant Meetings on Surveillance (WP/2)

2.1 The meeting reviewed the outcome of APANPIRG/30 meeting on surveillance with the highlight on the reviewed outcomes of SURICG/4 by CNS SG/23. The meeting noted that the SURICG/4 meeting had reviewed the APAC regional Surveillance Strategy adopted by APANPIRG/27 meeting in 2016 and proposed some changes based on the outcome of AN Conf./13 and latest developments. The APANPIRG/30 meeting endorsed the proposed changes and adopted the **Conclusion APANPIRG/30/15 Revised Surveillance Strategy for the APAC Region**.

2.2 The SURICG/4 meeting reviewed the outcome of the 1st Web Conference, the Second meeting of the Mode S DAPs Working Group including the proposed amendments to the Terms of Reference of DAPs WG and made some additional amendment to the proposed changes and adopted the revised ToR of Mode S DAPs Working through the **Decision SURICG/4/4**. The meeting also noted the list of action items updated by the DAPs WG.

2.3 The CNS SG/23 meeting noted the information on implementation and planning status of DAPs application, as well as technical issues addressed by States and ICAO SP Panel. The meeting encouraged the DAPs WG to further progress the research on Interrogator Identifier (II) Code coordination and interrogation strategy, and invite avionics manufacturers and avionics users to share their knowledge and experiences at the WG meetings. The meeting reviewed the draft Mode S DAPs Implementation and Operation Guidance Document developed by the DAPs WG, appreciated the efforts made by the working group for the development of the guidance material and adopted the **Mode S DAPs Implementation and Operation Guidance Document** as Edition 1.0 through the **Conclusion CNS SG23/12**. The Mode S DAPs Implementation and Operation Guidance Document is available at: <https://www.icao.int/APAC/Documents/edocs/APX.%20K%20%20-%20Mode%20S%20DAPs%20Implementation%20and%20Operation%20Guidance%20Document%20V1.0.pdf>

2.4 The meeting noted that ATM SG already endorsed a Conclusion to adopt Mode A Code A1000 as the regional Mode S conspicuity code, and it will be reflected in Table ATM II-APAC-2 (SSR Codes Allocation Plan) of RANP which is available at: <https://www.icao.int/APAC/Pages/APAC-eANP.aspx>

2.5 The meeting was informed by the co-chair that Mode A Code 1000 setting will not be broadcasted via ADS-B, as described in DO-260B specification. That means, if pure ADS-B is used, there would be no Mode A = 1000 with version 2 format. The meeting reiterated **Conclusion APANPIRG/30/13** to encourage States/Administration to conduct DCPC SATVOICE trial to verify its performance in improving the ATS in its FIR if needed.

Agenda Item 3: Sharing of State's implementation on Mode S

Mode S DAPs Implementation in China (IP/3)

3.1 Following the Global Air Navigation Plan (GANP) Aviation Safety Block Upgrade (ASBU) framework, and the Asia/Pacific Seamless ATM Plan, China has been promoting steadily Mode S DAPs implementation in recent years.

3.2 Air Traffic Management Bureau of CAAC published the guideline document and keeps it up to date. Mode S DAPs Working Team started to take test to current commissioned mode S radars in the field of Interrogation Code supporting capabilities, radar BDS extracting capabilities, radar data output capabilities, etc. The ATM automation systems are being upgraded step by step to meet the requirements of decoding, processing and displaying Mode S DAPs message.

3.3 Nowadays, most of the ATM automation systems in China are capable of handling Elementary Surveillance (ELS) data of mode S radars, including SSR Code Consistency Check, 24-bit Code Consistency Check, Target Identification Consistency Check. Besides, more and more systems are able to process Enhancement Surveillance (EHS) messages from mode S radars after function improvement. Predicted Level Mismatch (PLM) function is one of useful function, it can help controller getting a better awareness of the intention of the airplanes. In response to a query, China confirmed the Resolution Advisory (RA) function based on Mode S DAPs message has been realized with warning in the HMI of ATM automation system.

Mode S Radar Parameter Set and DAPs Extraction Strategy (IP/6)

3.4 China shared with the meeting about its latest Mode S radar survey information and introduced the Mode S Radar Parameter Set (MSR PS). It is noticed that China is now operating more than 100 SSRs, among which 74 are Mode S capable, and all of its Mode S radars can support Enhanced Surveillance. China introduced the MSR PS to standardize its Mode S radar's operation. The MSR PS is a collection of the Mode S operational parameters including radar coverage, antenna period, antenna beam width, time on target, interrogation period, mode interlace pattern, interrogation repetition frequency and DAPs extraction strategy. By using this parameter set, the Mode S radar operational information can be clearly defined.

A Method of Mode-S Radar Roll-Call Scheduling Management (IP/7)

3.5 China indicated that for Mode S radar, the scientific reception and transmission scheduling and reasonable interrogation strategy are both the foundation to ensure the reliable detection and tracking of the aircraft, and the premise conditions for achieving rapid target acquisition and real-time extraction of DAPs information.

3.6 The meeting was shared with a preliminary Mode S radar Roll-Call scheduling management algorithm on the basis of the method of beam-dwell scheduling for digital array radar, which to achieve efficient aircraft acquisition and real-time DAPs information extraction under the EHS operating conditions in heavy load scenario.

Aircraft Parameters Availability in Mode S DAPs and ADS-B ADD (IP/8)

3.7 China Shared a study on downlink parameters of aircraft in Mode S DAPs and ADS-B Aircraft Derived Data (ADD), giving a usability analysis of the current relevant parameters, the relevant results are shown in this paper.

3.8 The paper pointed out that ADS-B Version 0 did not define certain parameters of ADS-B ADD, such as the selected altitude, barometric settings, MCP/FCU mode, and the selected heading. When all transponders are upgraded to the latest version, the percentage of capability of these parameters will be greatly increased

Utilization of Mode-S DAPs Data for Weather Forecast (IP/11)

3.9 As advanced ATM, like Trajectory Based Operation (TBO), requires high-accurate trajectory prediction. One of major factors of estimated flight time error in TBO is weather uncertainty. DAPs data are expected to be useful for improving numerical weather prediction because temporal and spatial intervals of DAPs data are very short. Japan conducted experiments for improving weather forecast accuracy by utilizing DAPs data extracted from BDS 5,0 and BDS 6,0, and the experimental results indicated that Mode S DAPs data have a potential to improve weather forecasts. Japan will explore the use of Meteorological Report contained in Mode S DAPs message when available.

Agenda Item 4: Mode S monitoring and analysis**1090MHZ Spectrum and 24-Bit Aircraft Address Issues with UAS (IP/2)**

4.1 The secretariat presents a brief summary on regional activities on 1090 MHz spectrum and 24-bit aircraft address issues associated with unmanned aircraft. The meeting noted the topic was firstly presented to the region by Chairperson of the ICAO Surveillance Panel (SP) on APAC Aeronautical Surveillance Workshop in November 2018, further discussed in SEA/BOB ADS-B WG/14 through Working Paper 07 Address and Spectrum Issues for Small UAS and developed Draft Conclusion 14/02 – Small UAS Cooperative Surveillance Equipage which was adopted by CNS SG/23 meeting through Conclusion CNS SG/23/11.

4.2 The meeting noted that on 8 November 2019, ICAO issued a State Letter on the Subject: 1090 MHz spectrum issues and proper management of 24-bit aircraft addresses associated with unmanned aircraft operating exclusively at very low level, Ref.: SP 44/2 - 19/77. ICAO member States are urged to note the ongoing ICAO initiatives to ensure the continued safe and reliable operation of aeronautical surveillance systems, and encouraging State to make use of the guidance material enclosed in the letter.

4.3 The meeting was informed that remote ID regulations are in the process of being implemented in USA without using ICAO 24-bit aircraft address and 1090 MHz spectrum. Analysis has shown that the widespread use of 1090 ES-capable Mode S transponder by use of small UAS may not be feasible.

Experience in SSR Mode S Mix Mode Operation (IP/9)

4.4 Republic of Korea presented its operational experience about false target or unexpected phenomenon in using Mode-S mix mode interrogation. Mode-S transponder would not respond when it recognized P4 short pulse, but some Mode-S transponders responded to both of the interrogation signal with or without P4 short pulse. The radar software can solve the two targets phenomenon, or transmits all targets to ATC software to select one for display. And there is a case in which the interrogation pattern has been changed to resolve the delayed detection due to slow roll-call switching in capturing the taking off aircraft below 3000 feet. In another case, the Mode-S radar detected the taking off aircraft and lost the inbound flights due to II code overlap, temporarily operating the radar in mode A/C only will help in detecting targets while losing Mode S information.

4.5 During the meeting discussion, it was reiterated that States should follow the established regional process on the coordination of II code implementation through ICAO Regional Office before the operation of its Mode S SSR, as unknown duplicate use of the same II code for the radars with overlapped coverage may impose risk for air navigation safety.

Empty ACAS RA Message Handling at ATM Automation System (IP/10)

4.6 Main differences between Mode-S radar and SSR radar are the features related to the vertical intention message handling and ACAS Resolution advisory message handling. ATM controller can receive active ACAS RA message through “Data Item I048/260, ACAS Resolution Advisory Report” from the airplane. ASTERIX message “I048/260, ACAS Resolution Advisory Report” indicates that airplane is in ACAS RA condition. But in some cases, all zero I048/260 reports are received through Mode-s radar. Brief information is presented about all zero I048/260 handling at ATM automation system.

4.7 Japan informed the meeting about its similar observations. As avionics relevant issue is a key contributor to Mode S DAPs application, the meeting encouraged States/Administrations to share their observations and experience in various meeting concerned.

Agenda Item 5: Review the Action Items from DAPs WG/2 Meeting**Review of Action Items (WP/7)**

5.1 The list of action items for DAPs WG was developed by the DAPs WG/2 meeting in March 2019. It was incorporated into the meeting report of DAPs WG/2 as Appendix C and was also provided to SURICG/4 meeting for review as Appendix C of the Working Paper 06 by co-chairs of DAPs WG.

5.2 The meeting reviewed the list of action items, including the DAPs Implementation Status in the APAC Region table, against the significant achievements made since DAPs WG/2. During the discussion, the meeting agreed to further align the regional activities and time frame with the APAC Seamless ANS Plan 3.0 and highlight the adherence with the A40, ANC/13 outcomes and the GANP (2019). The further updated DAPs Implementation Status in the APAC Region table is provided as **Appendix A** and the Action Item List is provided as **Appendix B** to this report.

Agenda Item 6: Discussion on Roadmap on Mode S DAPs and related issues in APAC region**Guidance Material for Assignment of Interrogator Codes (IC) for MLAT and ADS-B (WP/5)**

6.1 It was discussed that, since MLAT and ADS-B with interrogators do not need to lock out transponders, logically II code = 0 could be used.

6.2 Section 3.1.2.5.2.1.2.3 of Annex 10 Vol 4 states that II Code = 0 shall only be used for supplementary acquisition in conjunction with acquisition based on lockout override.

6.3 Section 3.1.2.5.2.1.4.3 of Annex 10 Vol 4, states that an interrogator that has not been assigned with a unique discrete interrogator code and is authorized to transmit shall use the II Code = 0 to perform the selective interrogations. In this case, selectively addressed interrogations used in connection with acquisition using lockout override shall have interrogation field contents restricted, inter alia, UF = 4, 5, 20 or 21 and PC = 0 (i.e. no changes in transponder state).

6.4 Section 3.2.5 of Appendix M of Doc 9924 states that Mode S mobile interrogators should use II Code = 0 in order to avoid conflicts with fixed Mode S interrogators with a note stating that some States do not allow the use of II Code = 0 for mobile interrogators.

6.5 Section 4 of Appendix M of Doc 9924, it stated that MLAT system is basically a passive system but it may use interrogations to achieve a certain level of performance. The document however does not mention the code to be used.

6.6 While the ICAO provisions do provide some guidance on the use of II Codes = 0, it does not provide the reader with clear guidance whether interrogators installed with MLAT and ADS-B may use II Code = 0.

6.7 The ICAO Surveillance Panel (SP) Aeronautical Surveillance Working Group (ASWG) has been informed in Sep 2019 on the lack of guidance material relating to this issue. During the ASWG meeting, it was generally agreed that II=0 may be used for interrogators in both MLAT and ADS-B. It is expected that new text will be proposed by ASWG sometime this year.

6.8 Malaysia informed the meeting about their installation of ADS-B with interrogator in the area with overlapped radar coverage. For their experience, in order to obtain Mode A code from ADS-B, interrogators are needed most in an area for ADS-B at non-radar coverage or for ADS-B with active interrogator implemented to replace radars. China shared about its on-going research on the II code use for MLAT and ADS-B with interrogator, the updates are expected to report to Mode S DAPs WG/4 meeting.

II/SI Operations (IP/5)

6.9 In order for radars to use SI codes, the aircraft have to be SI capable. Although ICAO mandated that all aircraft transponders have to be SI capable by 1 January 2003, but not all are SI capable.

6.10 Non SI capable transponders will only be able to recognize the last 4 bits, hence will mistakenly lock out to other radars with different SI codes, but with the same last 4 bits. To work around the situation, parts of Europe employed a special mode of operation known as the II/SI Operation. Under this operations, the radar will only lock-out aircraft with SI capable transponder but will not lock out non-SI capable transponder.

6.11 The meeting thanked Singapore on the information sharing and agreed to consolidate the core value points contained in this information paper into the Guidance Material in due time.

Mode S Roadmap (WP/6)

6.12 Based on the summary and recommendation on the roadmap proposed by Singapore, the following items were discussed.

6.13 *Mode S Mandates:*

Considering that a number of applications will require Mode S, most aircraft already have Elementary Mode S and that its easy for new aircraft to be equipped with Enhanced Mode S, it is proposed that States be encouraged to mandate ELS Mode S by 1 Jan 2022 and forward fit of EHS Mode S in the same year 1 Jan 2022.

6.14 *Use of SI Codes*

Parts of Asia Pacific may require the use of SI code due to high concentration of Mode S radars. Other parts may not. It is possible for certain regions in Asia Pacific to commence the use of SI codes first while the rest continue to uses the II code first. To overcome the issue with non SI-capable aircraft, the II/SI Code Operation may also be considered.

6.15 *Radar Clustering*

Very few States are practicing radar clustering. States with the competency and operational requirement may apply such technique.

6.16 *Use of Conspicuity Code*

Most Asia Pacific States still uses Mode A codes for flight plan coupling. In anticipation that Mode S codes would be used in future, it was agreed that the Mode A code of 1000 be reserved as the conspicuity code for Asia Pacific so as to match the European region. It is likely to take many years before all States can support this capability across APAC and EUR. The ATM systems must support the conspicuity code feature. In preparation on the use of the conspicuity code, States developing new automation systems are encouraged to include the conspicuity code capability into the system.

6.17 *Weather Reporting Capability*

Based on information provided by aircraft manufacturers, there is currently no service bulletins that will help upgrade aircraft with such weather reporting capability. There is also currently no plan to develop such upgrades. It is envisaged that weather reporting capability will be available in the next generation transponder. Instead of mandating weather reporting capability, it may be more practical to Mandate Enhanced Mode S and derive weather information using algorithms.

6.18 *Datalink Map*

Europe is experiencing very high usage of the 1090MHz frequency. In order to prevent States from over interrogating, Europe has a datalink map which restricts the registers that States can extract from. Europe even have rules stating that Mode S radars should not actively interrogate for Mode A and Flight ID unless there is a change. At this moment, the frequency congestion situation within Asia Pacific is not as severe as that in Europe. Hence it is not foreseen that such datalink map is required soon within APAC region.

6.19 China thanked Singapore for the excellent summary on Mode S Roadmap for the region, and informed the meeting that China is presently considering to propose the mandate of Mode S equipage based on further study, and China will share its experience about the test on the use of SI code, implementation of Mode A 1000 code and radar clustering test with manufacturers in the Mode S DAPs WG/4 meeting.

6.20 USA informed the meeting that the RTCA/EUROCAE working group responsible for creating the next version of the Transponder and ADS-B requirements documents has created provisions to include new ADS-B Out messages that will be used to broadcast specific weather parameters requested by the meteorological working group. Although these messages will be optional in this version of the requirements, the group envisions utilizing these messages to support future ADS-B IN and weather applications

6.21 Singapore reminded the meeting that States have to be mindful of the impact on the operators due to the avionics equipage mandate and may face challenges by IATA. It will be useful to obtain statistic on the readiness of existing fleet. IP/8 by China is a good example of statistic collection to show that most aircraft were already Enhanced Mode S capable.

6.22 The meeting noted the information in the working paper WP/6 and appreciated the excellent work of the co-chair, and was of the view that a reference of this kind is necessary to guide the States in the region to develop its national strategy and planning in the implementation of Mode S technology. The meeting further formulated the following draft Conclusion for consideration by SURICG/5 meeting.

Draft Conclusion DAPS WG3/1 - The APAC Regional Roadmap for Mode S Implementation	
What: That, the APAC Regional Roadmap for Mode S Implementation provided in Appendix C to the Report be adopted.	Expected impact: <input type="checkbox"/> Political / Global <input type="checkbox"/> Inter-regional <input checked="" type="checkbox"/> Economic <input type="checkbox"/> Environmental <input checked="" type="checkbox"/> Ops/Technical
Why: The proposed Roadmap defined the scope and rational steps for the implementation of Mode S in APAC region.	Follow-up: <input type="checkbox"/> Required from States
When: 10-Apr-19	Status: Referred back to WG/TF
Who: <input checked="" type="checkbox"/> Other: SURICG	<input type="checkbox"/> Sub groups <input type="checkbox"/> APAC States <input type="checkbox"/> ICAO APAC RO <input type="checkbox"/> ICAO HQ

Agenda Item 7: Review Guidance Material of Implementation of Mode S DAPs**Amendments to the Guidance Material for Mandates (WP/4)**

7.1 Singapore informed the meeting that in Europe, the texts for equipment standards for newer transponders (version 2) are different from the older transponders (version 0 and version 1). The

guidance material contains only texts for older transponders as examples. It is proposed that the text for equipment standards for newer transponders be included.

a) For version 2 transponders, the following standard may be stated for elementary surveillance: Elementary surveillance (ELS) requirements stated in European Aviation Safety Agency (EASA) CS-ACNS-Subpart D, Section 2 (i.e. CS ACNS.D.ELS).

b) For version 2 transponders, the following standard may be stated for enhanced surveillance: Enhanced surveillance (EHS) requirements stated in European Aviation Safety Agency (EASA) CS-ACNS-Subpart D, Section 3 (i.e. CS ACNS.D.EHS).

7.2 It may be noted that, for aircraft that has been certified for Elementary or Enhanced Mode S, the following text will appear in the Aircraft Flight Manual:

a) Elementary Surveillance - Version 2 Transponder: The installed transponder system is able to respond to interrogations in Mode A, C and S and is fully compliant with the requirements of CS ACNS.D.ELS (Mode S Elementary Surveillance).

b) Enhanced Surveillance - Version 2 Transponder: The installed transponder system is able to respond to interrogations in Mode A, C and S and is fully compliant with the requirements of CS ACNS.D.EHS (Mode S Enhanced Surveillance).

7.3 The meeting agreed that it will be beneficial for the additional information to be included in the guidance material.

Updates to the Mode S DAPs Implementation and Operation Guidance Document (WP/8)

7.4 The edition 1.0 of the Mode S DAPs IGD has been adopted in 2019 to provide guidance for States in the implementation and operational application. As part of the process, China made further proposal of amendments to the IGD based on its experience, and shared the PfA to members of the Mode S DAPs WG. Singapore and New Zealand gave their responses and provided some other additional amendments. The main proposed amendments to the edition 1.0 included: add introduction of Mode S DAPs data source, supplement benefits to ATC operation brought by Mode S DAPs, revise procedure of DAPs extraction, refine the regulations and procedures related to the use of ICAO 24-bit Aircraft Address/Aircraft Identification and add one specific example of Mode S DAPs application.

7.5 The table below indicated the relevant sections with the amendments, and detailed information was provided in the Appendix A of the working paper.

Section	Contents
1.2.1	Mode S and DAPs
3	Reference
4.1	Mode S ELS
4.2	Mode S EHS
7.3.4	Interrogate Comm-B Data
7.4.1	Elementary Surveillance
9.2	Use of ACAS RA
Appendix 4	A Brief Introduction of Mode S DAPs Data Source

7.6 After review and discussion the proposed amendments to the **MODE S DAPs Implementation and Operation Guidance Document** version 1.0 (DAPs IGD 1.0) contained in WP/04 and WP/08 respectively, the meeting further reviewed the consolidated revised version during

the same session under agenda item 7, the meeting agreed that the present consolidated revised version of the DAPs IGD was ready to be submitted to SURICG/5 for approval as the regional guidance document Edition 2.0, which is provided in **Appendix D** to this Report. The working team is proposed to be maintained to work through emails and web/teleconference for future improvement of the document. States/Administrations were invited to contribute to the DAPs IGD through using and or joining the working team.

7.7 Accordingly, the meeting formulated the following draft Conclusion for consideration by SURICG/5 meeting.

Draft Conclusion DAPS WG3/2 - Mode S DAPs IGD 2.0	
What: That, the <i>Mode S DAPs Implementation and Operation Guidance Document</i> Edition 2.0 provided in Appendix D to the Report be adopted.	Expected impact: <input type="checkbox"/> Political / Global <input type="checkbox"/> Inter-regional <input type="checkbox"/> Economic <input type="checkbox"/> Environmental <input checked="" type="checkbox"/> Ops/Technical
Why: Editorial correction and revision to reflect regional updates in implementation.	Follow-up: <input type="checkbox"/> Required from States
When: 16-Jul-20	Status: Referred back to WG/TF
Who: <input checked="" type="checkbox"/> Sub groups <input type="checkbox"/> APAC States <input type="checkbox"/> ICAO APAC RO <input type="checkbox"/> ICAO HQ <input type="checkbox"/> Other:	

7.8 The draft of guidance document edition 2.0 is to be posted on ICAO APAC webpage and open to States/Administration for one-week individual detailed review after the meeting. If there are some proposals for substantial change within this week, the DAPs WG/3 meeting agreed to organize another web meeting with the support of ICAO APAC Regional Office for necessary improvement. The draft of guidance document edition 2.0 edition agreed by Mode S DAPs WG/3 will be posted as Appendix D of the approved meeting report and forwarded to SURICG/5 for further action.

Agenda Item 8: Next meetings and any other Business

Review of Terms of Reference (WP/3)

8.1 The Terms of Reference for the Mode S DAPs Working Group was last reviewed and updated by SURICG/4 through **Decision SURICG 4/4**. China and Singapore prepared a working paper on the Terms of Reference (ToR) of the Mode S DAPS WG and a complete summary of the **Work done thus far**, for further review by the meeting.

8.2 The meeting proposed minor editorial changes to the TOR, and included Australia, Indonesia, Nepal and Sri Lanka as new members. USA will continue to join the DAPs WG activities as observer. The revised Terms of Reference is provided as **Appendix E** to this report.

Allocation of 24-Bit Aircraft Address (IP/4)

8.2 Blocks of 24-bit aircraft addresses are assigned to States by ICAO. Each block is defined by a fixed pattern of the first 4, 6, 9, 12 or 14 bits of the 24-bit address. Thus, blocks of different sizes (1,048,576, 262,144, 32,768, 4,096 and 1,024 consecutive addresses) are made available.

8.3 In the last decade, some States with 1,024 addresses have developed their air hub and does not have enough addresses.

8.4 The SP-ASWG has tasked its Technical Sub-group (TSG) to investigate/identify options for additional allocation of 24-bit aircraft addresses to States who currently have a small number of addresses (such as 1024) and for allocating codes to surface vehicles.

8.5 Participants from Australia, China, Nepal, Sri Lanka and USA shared respective information on 24-bit code and UAS issue, States/Administrations are encouraged to share experience on SURICG platform, and China agreed to present a paper during SURICG/5 on the management and use of 24-bit code.

Date and Venue for the Next Meeting

8.5 The meeting recognized the advantages and disadvantages of video conference in consecutive days, and identified the need to organize another face to face meeting to further progress tasks listed in the Terms of Reference. It is expected to meet at a place where DAPs has been used for trial or operation purpose. The Secretariat will coordinate for hosting the next meeting in March 2021 with members States of the group, and inform participants in due course for the exact dates and venue.

Note of appreciation

8.6 With the revised guidance document and the roadmap, APAC region is being effectively facilitated on the implementation of Mode S technology. CAAC ATMB has been the task lead for the Mode S DAPs Implementation and Operation Guidance Document, and CAAS contributed the most on summarizing regional Mode S DAPs roadmap. The meeting expressed its appreciation and gratitude to CAAC ATMB, CAAS and AEROTHAI for the commitment and continuous support on ICAO regional activities.

DAPS IMPLEMENTATION STATUS IN THE APAC REGION

No.	State/ Administration	Mode-S Surveillance Facilities and ATM System Readiness	Operational Status	Remark
1	CHINA	<p>68 Mode-S capable radars.</p> <p>Now ATM automation systems could process the DAPs including the position altitude and Mode 3/A Code.</p> <p>By 31 December 2021, ATM system ready to process almost all the DAPs.</p>	<p>Radars and DAPs application in ATM system for the first stage are operational</p>	
2	INDIA	<p>26 Mode-S capable Radars have already been installed.</p> <p>All ATM systems except Chennai are capable to process DAPs.</p>	<p>Out of 26 Mode-S capable Radars, 25 radars are presently operational.</p> <p>All DAPs capable ATM systems are operational.</p>	<p>Commissioning of remaining 01 Mode-S capable radars is under process.</p>
3	INDONESIA	<p>26 Mode-S capable Radars</p> <p>ATM system in some locations are capable to DAPs; and ATM systems in some other locations are in evaluation for DAPs.</p>	<p>Radars are in operational.</p> <p>ATM systems in some locations are in operational; and the rest are in evaluation process.</p>	
4	JAPAN	<p>2 Mode-S capable radars</p> <p>ATM system is in evaluation process for DAPs.</p>	<p>Radars are operational and DAPs application in ATM is in evaluation.</p>	

Mode S DAPs WG/3
Appendix A to the Report

No.	State/ Administration	Mode-S Surveillance Facilities and ATM System Readiness	Operational Status	Remark
5	MALAYSIA	<p>Surveillance Facilities: Peninsular Malaysia Operational as of March 2019: 3 SSR with Mode-S Stations and 2 ADS-B Ground Stations are in operational.</p> <p><u>Near Future (Less than 5 years):</u> Additional of 2 Stations SSR with Mode-S will be operational in end of year 2019.</p> <p>Sabah & Sarawak Operational as of March 2019. 2 SSR with Mode-S Stations in operation.</p> <p><u>Near Future (Less than 5 years):</u> Additional of 3 SSR with Mode-S Stations and 4 ADS-B Ground Stations will be operational in end of year 2020.</p> <p>ATM System Readiness: DAPs Capable*. Fully ready in 2022</p>	<p>Surveillance Facilities: Peninsular Malaysia ADS-B mandate is scheduled in end of year 2019.</p> <p>Sabah & Sarawak ADS-B mandate is scheduled in end of year 2020</p> <p>Full Mode-S Mandotory Shall be completed by 2021.</p>	<p>Note: As of March 2019, CAA Malaysia is embarking Optimization Programme of CNS/ATM as part of CAA Malaysia Transformation.</p> <p>Under this programme, CAA Malaysia is to achieve 100% of Mode-S Coverage by year 2021 in Peninsular Malaysia, Sabah & Sarawak.</p> <p>*Currently, DAPs information is evaluated for safety case studies and data analytic.</p> <p>CAA Malaysia is in supports of the DAPs implementation in APAC Region. In view of this, the earliest for full implementation of DAPs in Malaysia will be in 2025 to make way for infrastructures, procedures and technical competency readiness; coordination and bilateral agreement with all stakeholders that will be affected and benefited from this implementation are in agreement.</p>
6	PHILIPPINES	<p>12 Mode-S capable radars</p> <p>ATM system Capable of DAPs.</p>	<p>All radar systems are Operational ATM systems are likewise operational with DAPs capability disabled</p>	<p>Temporarily turned off/disabled due to some issues as advised by the vendor (Thales).</p>

Mode S DAPs WG/3
Appendix A to the Report

No.	State/ Administration	Mode-S Surveillance Facilities and ATM System Readiness	Operational Status	Remark
7	SINGAPORE	3 Mode-S capable radars ATM system ready to process DAPs.	Radars and DAPs application in ATM system are operational	
8	SRI LANKA	2 Mode-S Radars Being Implemented ATM system for Approach Control Centre at BIA with DAPs Processing, Being Implemented ATM system for Area Control Centre with DAPs Processing, planned implementation	Targeted to be available by 2022 Targeted to be available by 2022 Targeted to be available by 2023	WAM System with the DAPs capability to be implemented in parallel to the implementation of DAPs Compatibility in ATM systems by 2022
9	THAILAND	12 Mode-S EHS RADARs The new ATM system, TMCS project, is capable to process DAPs. The TMCS made used of DAPs as an information for ATC for determining.	The TMCS project is planned to fully operate by the end of 2020.	
10	VIET NAM	- 2 Mode-S capable radars - 2 ATM system ready to process DAPs. - 13 ADS-B stations	- Radars and ATM are capable of handling Mode S DAPs but not yet officially operation. - ADS-B is on operation	Vietnam is deploying following projects in 2019 -2021: - New 5 SSR Mode Station (EHS), - 10 ADS-B stations; - 01 MLAT system, - New Ho Chi Minh ATCC and new Da Nang ATCC (with new modern ATM system).

Mode S DAPs WG/3
Appendix B to the Report

LIST OF ACTION ITEMS

No.	Subject	Forum Raised	Status / Target Date	Remarks / follow-up	Action Party
1.	II code coordination process and method	DAPs WG/2	on going	WP provided to DAPs WG/3, and further study is necessary.	China, Malaysia and Singapore
2.	Update DAPs Implementation Status table for APAC region	DAPs WG/2	On-going basis	To update the information in the table as necessary.	Member States
3.	PRF, interrogation pattern coordination	DAPs WG/2	DAPs WG/3/ On going	To prepare working paper under this subject.	Member States
4.	Study of Data Source of DAPs	DAPs WG/2	On going	1. Based on IP05 of DAPs WG/2, to provide a basic and accurate briefing on the avionics systems relevant to DAPs application. 2. Updated to IGD in DAPs WG/3	China
5.	Harmonization with air space users	SURICG/2	On-going basis	Invite avionics manufacturers and airlines to share experience.	Co-chairs and hosting States
6.	Roadmap	DAPs WG/2	Proposed in WG/3	A summary on roadmap is proposed by co-chair and agreed by DAPs WG/3.	Co-chairs, ICAO
7.	Align with APAC Seamless ANS Plan 3.0, GANP 2019 and A40, ANC/13 outcome	DAPs WG/3	DAPs WG/4	As the IGD2.0 and roadmap have been developed, it's necessary to further align the direction and timeline of regional implementation with global guideline by updating the action list, IGD and roadmap.	Co-chairs, ICAO

LIST OF ACTION ITEMS

No.	Subject	Forum Raised	Status / Target Date	Remarks / follow-up	Action Party
8.	Empty RA message handling at ATM system	DAPs WG/3	DAPs WG/4	Summarize the experience into appendix 2 "LIST OF IDENTIFIED ISSUES "of IGD.	Republic of Korea, China
9.	Use DAPs data for Weather Forecast	DAPs WG/3	DAPS WG/4	Add new section "9.3 Use DAPs data for Weather Forecast" into IGD	Japan, China

ROADMAP FOR MODE S DAPS

1.1 The Mode S DAPS Working Group has considered the following issues or technologies:

- a) Mode S mandate;
- b) Use of SI Codes;
- c) Radar Clustering;
- d) Use of conspicuity codes;
- e) Weather reporting capability; and
- f) Datalink Map.

1.2 Based on current practises around the world and taking into account the situation in Asia Pacific, the following roadmap is proposed for the Asia Pacific.

S/N	Issue	Recommendation	Reasons
1	Mode S Mandate	Forward fit of Enhanced Mode S by 1 Jan 2022. Retrofit of Elementary Mode S by 1 Jan 2022. Minimally for aircraft with a mass >5700kg or a speed >250kt,	Europe currently mandate that all IFR aircraft to minimally be Elementary Mode S equipped by 7 June 2020. For aircraft with a mass >5700kg or a speed >250kt, aircraft shall be equipped with Enhanced Mode S and ADS-B (version 2) effectively on 7 June 2020. 1.5 years of lead time for Asia Pacific is considered reasonable.
2	Use of SI Codes	Asia Pacific may consider the use of SI codes in sub-regions where there is high concentration of Mode S radars. II/SI Code operations may also be considered.	IC codes come in the form of SI codes and II codes. Newer SI codes have more unique codes compared to older II codes (63 vs 16). But not all aircraft are ready to use SI codes. Considering that some regions (e.g. China) already have high radar density, it is recommended that such region can start to use SI code first. The hybrid II/SI code will help to address the concern that some aircraft are not SI ready.
3	Radar clustering	There is no urgency to perform clustering in the APAC region within the near future. But States with the competency and operational requirement may apply such technique.	Clustering technique allow two overlapping radars to use the same IC code, but its technically complex. Thus far, only Germany and the Netherlands adopted this technique.

Mode S DAPs WG/3
Appendix C to the Report

S/N	Issue	Recommendation	Reasons
4	Use of conspicuity codes	States are encouraged to incorporate conspicuity code capability into ATM system.	Europe has insufficient Mode A codes. Instead of Mode A code, Europe uses 24-bit aircraft address for flight plan coupling. Such aircraft will enter Mode A = 1000 in the cockpit.
5	Weather reporting capability	Not practical to mandate weather reporting capability in Mode S. States requiring such capability should consider other means to generate weather information (such as using algorithm to derive weather information).	While weather data is one of the Mode S DAPs, only very few (<1%) aircraft has this capability. The industry does not have software patches to enable this weather feature, hence there is no point having a mandate for weather capability. Instead, some States researched algorithms to derive weather information.
6	Datalink Map	No immediate need for datalink map. But continue to monitor what the rest of the world is doing.	<p>In Europe, there is a datalink map that restrict the data that each radar can interrogate for. It is to reduce the frequency congestion.</p> <p>Frequency congestion is not an urgent issue in Asia Pacific and hence there is no urgency to implement such datalink map.</p> <p>It is also noted that such datalink map is difficult to enforce.</p>

Appendix D to the Report



**INTERNATIONAL CIVIL AVIATION ORGANIZATION
ASIA AND PACIFIC OFFICE**

**MODE S DOWNLINK AIRCRAFT PARAMETERS IMPLEMENTATION
AND OPERATIONS GUIDANCE DOCUMENT**

Edition 2.0 - May 2020

Intentionally left blank

TABLE OF CONTENTS

1. INTRODUCTION.....	5
1.1 PURPOSE	5
1.2 BACKGROUND	5
<i>1.2.1 Mode S and DAPs</i>	<i>5</i>
<i>1.2.2 Benefit of Mode S and Use of DAPs</i>	<i>6</i>
1.3 ARRANGEMENT OF DAPS IGD	6
1.4 DOCUMENT HISTORY AND MANAGEMENT	6
1.5 COPIES	7
1.6 CHANGES TO DAPS IGD.....	7
1.7 EDITING CONVENTIONS	7
1.8 DAPS IGD REQUEST FOR CHANGE FORM.....	8
1.9 AMENDMENT RECORD	9
2. ACRONYMS LIST	10
3. REFERENCE DOCUMENTS	12
4. DESCRIPTION OF MODE S DAPS DATA	14
4.1 MODE S ELS	14
4.2 MODE S EHS.....	15
4.3 DAPS DATA EXCHANGE PROTOCOL BETWEEN SURVEILLANCE AND ATM AUTOMATION SYSTEM	16
5. IMPLEMENTATION PRINCIPLES AND PHASES	17
5.1 IMPLEMENTATION PRINCIPLES.....	17
<i>5.1.1 Stakeholders Coordination.....</i>	<i>17</i>
<i>5.1.2 System Compatibility</i>	<i>17</i>
<i>5.1.3 DAPs Data Integrity</i>	<i>18</i>
<i>5.1.4 System Integration</i>	<i>18</i>
5.2 IMPLEMENTATION CHECKLIST	19
<i>5.2.1 Activity Sequence.....</i>	<i>19</i>
<i>5.2.2 Concept Phase</i>	<i>19</i>
<i>5.2.3 Design Phase</i>	<i>20</i>
<i>5.2.4 Implementation Phase.....</i>	<i>21</i>
6. SYSTEM INTEGRITY AND MONITORING	22
6.1 INTRODUCTION.....	22
6.2 PERSONNEL LICENSING AND TRAINING.....	22
6.3 ATS SYSTEM VALIDATION	22
<i>6.3.1 Safety Assessment Guidelines</i>	<i>22</i>
<i>6.3.2 System Safety Assessment</i>	<i>22</i>
<i>6.3.3 Integration Test.....</i>	<i>23</i>
<i>6.3.4 ATS Operation Manuals</i>	<i>23</i>
6.4 SYSTEM MONITORING	23
<i>6.4.1 Consideration for System Monitoring.....</i>	<i>23</i>

6.4.2	<i>Mode S DAPs Problem Reports</i>	24
6.4.3	<i>Example of Mode S DAPs Problem</i>	25
6.5	APPLICATION ANALYSIS	25
6.5.1	<i>Data Recording</i>	26
6.5.2	<i>Local Data Collection</i>	26
6.5.3	<i>Avionics Problem Identification and Correction</i>	26
6.6	IDENTIFIED ISSUES	26
7.	REGULATIONS AND PROCEDURES	27
7.1	MANDATING MODE S DAPS	27
7.2	AVIONICS	28
7.2.1	<i>Mode S Transponder Capabilities</i>	28
7.2.2	<i>Transition Guidelines</i>	29
7.2.3	<i>Interrogation of Transponders on Ground</i>	29
7.3	MODE S INTERROGATOR	30
7.3.1	<i>Working Principles</i>	30
7.3.2	<i>Interrogator Codes</i>	30
7.3.3	<i>Interrogation Methods</i>	31
7.3.4	<i>Interrogate Comm-B Data</i>	31
7.4	ATM AUTOMATION SYSTEM	3533
7.4.1	<i>Elementary Surveillance</i>	3533
7.4.2	<i>Enhanced Surveillance</i>	3634
7.5	FLIGHT PLANNING	3635
7.5.1	<i>ICAO Flight Plan Item 7 - Aircraft Identification</i>	3735
7.5.2	<i>Equipment (Surveillance Equipment /SSR Equipment)</i>	3735
7.5.3	<i>Inconsistency between Mode S Flight Planning and Surveillance Capability</i>	3836
7.5.4	<i>Setting Flight ID in Cockpits</i>	3937
7.6	CONTINGENCY PLAN	3937
8.	TRAINING AND COMPETENCE	4038
8.1	INTRODUCTION	4038
8.2	TRAINING OF AN AIR TRAFFIC CONTROLLER (ATC) IN DAPS	4038
8.3	TRAINING OF AN ATSEP IN DAPS	4038
8.4	COMPETENCY ASSESSMENT OF AN ATSEP IN DAPS	4139
9.	SPECIFIC EXAMPLES ON MODE S DAPS APPLICATION	4240
9.1	USE OF SELECTED ALTITUDE	4240
9.2	USE OF ACAS RA	4240
APPENDIX 1: MODE S DAPS ANALYSIS		4442
APPENDIX 2: LIST OF IDENTIFIED ISSUES		4846
APPENDIX 3: LIST OF PARTICIPANTS		5250
APPENDIX 4: A BRIEF INTRODUCTION OF MODE S DAPS DATA SOURCE		5452

1. INTRODUCTION

1.1 Purpose

This Mode S Downlink Aircraft Parameters Implementation and Operations Guidance Document (DAPs IGD) provides guidance for the planning, implementation and operational application of Mode S DAPs technology in the Asia and Pacific Regions.

The procedures and requirements for Mode S DAPs operations are detailed in the relevant States' AIP. This IGD is intended to provide key information on Mode S DAPs performance, integration, principles, procedures and collaboration mechanisms.

The content is based upon the work to date of the Mode S DAPs Working Group and various ANC Panels for the operational use of Mode S DAPs.

1.2 Background

1.2.1 Mode S and DAPs

Mode S (Select) is an extension of conventional SSR which permits selective addressing of individual aircraft equipped with MODE S transponders. Additional data known as Downlink Aircraft Parameters (DAPs) may also be extracted from the aircraft, including aircraft identification which should correspond to the ACID entered in the flight plan.

Mode S operates on the same radio frequencies (1030 and 1090 MHz) as conventional SSR systems allowing for interrogation of older Mode A/C transponders and well as more modern Mode S transponders.

Each Mode S equipped aircraft is assigned a unique ICAO 24-bit aircraft address. Using the selective interrogation capability of the Mode S SSR, Mode S Sensors are able to first acquire and then ~~to~~ selectively interrogate a specific aircraft via its unique ICAO 24-bit aircraft address. This significantly improves the radar's detection and tracking performance, and therefore improving the ability of ATC to monitor and ~~direct control~~ the aircraft, as well as the others around it.

The innovation of Mode S resides in the use of selective addressing of aircraft which offers technical advantages over conventional SSR, such as reducing ~~FRUIT~~ "fruit" and "~~garble~~garbling", providing higher integrity radar tracks.

Mode S technology has the following characteristics:

- a) selective interrogation,
- b) individual aircraft address and
- c) datalink capability.

The Mode S Application includes Mode S radar system, datalink Systems, MLAT Systems, etc.

~~Various avionics systems onboard an aircraft receive data from sensors to provide the The downlink aircraft parameters DAPS output come from varies of avionics systems onboard the modern aircraft, these. The data mainly comes from several sets of sensors, such as air data sensors (including pitot probe, static port, temperature sensor, angle of attack sensor), inertial sensors (including position gyroscopes, rate gyroscopes and accelerometers) and magnetic sensor(s). And p~~Part of the parameters produced by

other avionics systems (such as MCP/FCU, FMS, TCAS, etc.) are also defined as downlink aircraft parameters. These parameters are then sent to the transponder through standard data buses, and stored inside the relevant transponder's 56-bit Binary Data Storages (BDS). ~~The ground-based~~Ground-based surveillance systems (such as MSSR or MLAT) can ~~could~~ downlink the desired parameters ~~by using the~~ specific Mode S protocols.

For ~~D~~detailed information about DAPs data source, please refer to Appendix 4.

Mode S DAPs is an application of the Mode S Datalink System. The downlink standard length transaction interface shall deliver DAPs to the transponder which then makes data available to the ground surveillance systems. Each DAP shall be packed into the Comm-B format ('MB' field) and can be extracted using either the ground-initiated Comm-B (GICB) protocol, or using MSP downlink channel 3 via the dataflash application.

1.2.2 Benefit of Mode S and Use of DAPs

The Mode S Application reduces the weakness of Mode A/C, because of the selective interrogation reducing synchronous garble and asynchronous interference. The parity check technique improves reliability and integrity of surveillance data. The availability of almost 17 million unique aircraft addresses, in conjunction with the automatic reporting of flight identity, alleviates Mode 3/A code shortages and enables unambiguous aircraft identification, if the correct aircraft address and/or Aircraft Identification are entered in both the flight plan and aircraft systems. The datalink technique assists the acquisition of downlink aircraft parameters, and the additional track label information improves the air situational awareness. The controller and pilot are presented with improved situation awareness, which reduce the R/T workload.

1.3 Arrangement of DAPs IGD

The Mode S DAPs Implementation and Operations Guidance Document consists of the following parts:

Section 1	Introduction
Section 2	Acronym Lists
Section 3	Reference Documents
Section 4	Description of Mode S DAPs Data
Section 5	Implementation Principles and Phase
Section 6	System Integrity and Monitoring
Section 7	Regulations and Procedures
Section 8	Training and Competence
Section 9	Specific Examples on Mode S DAPs Applications

1.4 Document History and Management

The framework of this document was introduced in the first Working Group Meeting of Mode S Downlink Aircraft Parameters in March 2018. The Meeting agreed to further develop based on the proposed framework to a complete document for approval as regional guidance document. A working team, consisting of volunteers from China, Hong Kong-China, Japan, Malaysia, Singapore, Thailand and New Zealand was established by the Meeting to contribute to the content of the document. In July 2018, the completed draft of this document was ready for circulation among States for review and comment.

The aim of this document to supplement SARPs, PANS and relevant provisions contained in ICAO documentation and it will be regularly updated to reflect evolving provisions.

1.5 Copies

Paper copies of this DAPs IGD are not distributed. Controlled and endorsed copies can be found at the following web site: <http://www.icao.int/APAC/Pages/edocs.aspx> and may be freely downloaded from the web site, or by emailing APANPIRG through the ICAO Asia and Pacific Regional Office who will send a copy by return email.

1.6 Changes to DAPs IGD

Whenever a user identifies a need for a change to this document, a Request for Change (RFC) Form (see Section 1.8 below) should be completed and submitted to the ICAO Asia and Pacific Regional Office. The Regional Office will collate RFCs for consideration by the Surveillance Implementation Coordination Group.

When an amendment has been agreed by a meeting of the Surveillance Implementation Coordination Group then a new version of the DAPs IGD will be prepared, with the changes marked by an “|” in the margin, and an endnote indicating the relevant RFC, so a reader can see the origin of the change. If the change is in a table cell, the outside edges of the table will be highlighted; e.g.:

--	--	--

Final approval for publication of an amendment to the DAPs IGD will be the responsibility of APANPIRG.

1.7 Editing Conventions

(Intentionally blank)

1.8 DAPs IGD Request for Change Form

RFC Nr:	
----------------	--

Please use this form when requesting a change to any part of this DAPs IGD. This form may be photocopied as required, emailed, faxed or e-mailed to ICAO Asia and Pacific Regional Office +66 (2) 537-8199 or APAC@icao.int

1. SUBJECT:				
2. REASON FOR CHANGE:				
3. DESCRIPTION OF PROPOSAL: [expand / attach additional pages if necessary]				
4. REFERENCE(S):				
5. PERSON INITIATING:			DATE:	
ORGANISATION:				
TEL/FAX/E-MAIL:				
6. CONSULTATION RESPONSE DUE BY DATE:				
	Organization	Name	Agree/Disagree	Date
7. ACTION REQUIRED :			DATE REC'D :	
8. DAPs IGD EDITOR			DATE :	
9. FEEDBACK PASSED				

1.9 Amendment Record

Amendment Number	Date	Amended by	Comments
0.1	20 March 2018	China Hong Kong, China	Initial draft for consideration by Mode S DAPs WG/1
0.2	1 August 2018	China Hong Kong, China Japan Singapore Malaysia	First completed draft based on the agreed document framework in Mode S DAPs WG/1 for review and comment by States
0.3	23 August 2018	China	Based on Version 0.2 draft, China hold a meeting to discuss problems respecting the first completed draft. This is a revised document according to content of this meeting.
0.3.1	26 September 2018	China Hong Kong, China Singapore New Zealand	Based on Version 0.3 draft, States make a full comment on the content of IGD. This is a revised document according to those comments.
0.3.2	6 November 2018	China New Zealand Hong Kong, China Singapore Malaysia	Based on Version 0.3.1 draft, States discussed all comments of IGD in the Mode S DAPs WG 1st Web Conference. This is revised by the meeting decisions.
0.4	27 December 2018	China New Zealand Singapore Australia	Based on Version 0.3.2, States review and comment on the IGD. This is a revised document according to those comments.
1.0	14 March 2019	China Japan Singapore Malaysia	Consideration by Mode S DAPs WG/2
<u>1.1</u>	<u>17 February 2020</u>	<u>China</u> <u>New Zealand</u> <u>Singapore</u>	<u>Modify based on Version 1.0, States review and comment on the IGD.</u>
<u>2.0</u>			<u>Consideration by Mode S DAPs WG/3</u>

2. ACRONYMS LIST

AA	Aircraft Address
AC	Altitude Code
ACID	Aircraft Identification
ADS-B	Automatic Dependent Surveillance-Broadcast
AIP	Aeronautical Information Publication
ANC	Air Navigation Conference
ANSP	Air Navigation Service Provider
APAC	Asia Pacific
ATC	Air Traffic Control
ATM	Air Traffic Management
ATN	Aeronautical Telecommunications Network
ATS	Air Traffic Service
ATSEP	Air Traffic Safety Electronic Personnel
BDS	Comm-B Data Selector
CA	Capability
CDTI	Cockpit Display Traffic Information
CFL	Cleared Flight Level
CLAM	Cleared Level Adherence Monitoring
CNS	Communications, Navigation and Surveillance
DAPs	Downlink Aircraft Parameters
DF	Downlink Format
EASA	European Aviation Safety Agency
EHS	Mode S Enhanced Surveillance
ELM	Extended Length Message
ELS	Mode S Elementary Surveillance
ES	Extended Squitter
EUROCAE	European Organization for Civil Aviation Equipment
EUROCONTORL	European Organisation for the Safety of Air Navigation
FIR	Flight Information Region
FLTID	Flight Identification (transmitted by aircraft)
FMS	Flight Management System
FS	Flight Status
FRUIT	False Relies Unsynchronized In Time
GICB	Ground-Initiated Comm-B
HMI	Human Machine Interface
IC	Interrogator Code
ICAO	International Civil Aviation Organization
ID	Identity
IFR	Instrument Flight Rules
II	Interrogator Identifier
IRF	Interrogation Repetition Frequency
MHz	Megahertz
MIP	Mode Interlace Patterns
MIT	Massachusetts Institute of Technology
MLAT	Multilateration
MSAW	Minimum Safe Altitude Warning
MSP	Mode S Specific Protocol
SARPs	(ICAO) Standards and Recommended Practices
SFL	Selected Flight Level
SI	Surveillance Identifier
SSR	Secondary Surveillance Radar

STCA	Short-Term Conflict Alert
UTC	Universal Time Coordinated
WAM	Wide Area Multilateration
WG	Working Group

3. REFERENCE DOCUMENTS

Id	Name of the document	Edition	Date	Origin	Domain
1	Aeronautical Telecommunications, Annex 10 - Vol. III - Communication Systems	Edition 2	2007	ICAO	
2	Aeronautical Telecommunications, Annex 10 - Vol. IV - Surveillance Radar and Collision Avoidance Systems	Edition 5	2014	ICAO	
3	Doc 9871, Technical Provisions for Mode S Services and Extended Squitter.	Edition 2	2012	ICAO	
4	Doc 9688 Manual on Mode S specific service.	Edition 2	2004	ICAO	
5	ED-73E, Minimum Operational Performance Standards for Secondary Surveillance Radar Mode S Transponders.	Edition 1	May 2011	EUROCAE	
6	ADS-B Implementation and Operations Guidance Document	Edition 11	April 2018	ICAO APAC	
7	Concept of Operations Mode S in Europe (Mode S CONOPS)	Edition 2	November 2013	Eurocontrol	
8	Mode S Elementary Surveillance (ELS) Operations Manual	Edition 1	January 2011	Eurocontrol	
9	Asia/Pacific Seamless ATM Plan		May 2015	ICAO APAC	
10	Doc 9924 Aeronautical Surveillance Manual	Second Edition	2017	ICAO	
11	Preliminary System Safety Analysis for the Mode S Elementary Surveillance	Edition 1.8	April 2004	Eurocontrol	EATMP
12	Elementary Surveillance (ELS) and Enhanced Surveillance (EHS) validation via Mode S Secondary Radar		April 2008	MIT Lincoln Laboratory	ATC Project
13	Aircraft Derived Data Validation Algorithms		August 2012	MIT Lincoln Laboratory	ATC Project
14	Doc.4444 Procedures For Air Navigation Services Air Traffic Management	Sixteenth Edition	November 2016	ICAO	
15	Clarification Mode S Transponder in an Airport/A-SMGCS Environment	Edition 1.1	3 May 2005	Eurocontrol	

16	Minimum Operational Performance Standards for Air Traffic Control Radar Beacon System /Mode Select (ATCRBS / Mode S) Airborne Equipment	Edition E	17 March 2011	RTCA	
17	MARK 4 AIR TRAFFIC CONTROL TRANSPONDER (ATCRBS/MODE S)	Edition 4	15 November 2011	ARINC	

4. DESCRIPTION OF MODE S DAPs DATA

Inside the aircraft transponder, DAPs are stored in different BDS Registers for responding to DAPs interrogation requests by a Mode S ground system. Aircraft parameters are periodically delivered from aircraft sensors, flight management system, etc., to these registers via the downlink standard length transaction interface. BDS Registers, which have not been updated within the specified maximum update interval, are cleared or indicated as invalid and such aircraft parameters would be unavailable for ground interrogations. When a Mode S SSR sends an interrogation requesting the downlink of registers, DAPs are packed into Comm-B format (known as “MB” field) and are extracted using either the GICB protocol or Mode S specific protocols (MSPs) channel 3.

BDS Registers are identified by two-digit hex number. For example, BDS Register for selected vertical intention, which is identified by hex number 40₁₆, is commonly written as BDS code 4, 0 in publications. Depending on the stage of Mode S implementation, i.e. Mode S ELS and Mode S EHS, the scope of Mode S DAPs data involved would be different as illustrated in the following subsections.

Detailed data format and maximum update interval of each BDS register are given in “ICAO Doc 9871 - Technical Provisions for Mode S Services and Extended Squitter”.

4.1 Mode S ELS

In Mode S ELS implementation, aircraft and ground Mode S system should be compliant of providing the following functionalities over traditional Mode A/C systems:

- a) Selective interrogation;
- b) Use of ICAO Aircraft Address;
- c) Automatic reporting of ACID;
- d) Report of transponder capability;
- e) Altitude reporting with resolution of 25ft (subject to aircraft capability);
- f) Provision of flight status to indicate airborne or on-the-ground (subject to aircraft capability);
- g) Report of SI Code capability; and
- h) ACAS active resolution advisory report (when equipped with TCAS)

DAPs associated with Mode S ELS are stored in BDS code 1,0, BDS code 1,7, BDS code 2,0 and BDS code 3,0 registers of aircraft’s transponder.

Table 4-1 DAPs in Mode S ELS

Register	Name	Usage
BDS code 1,0	Datalink Capability Report	To report the data link capability of the Mode S transponder/data link installation.
BDS code 1,7	Common Usage GICB Capability Report	To indicate common usage GICB services currently supported.
BDS code 2,0	Aircraft Identification	To report aircraft identification to the ground.
BDS code 3,0	ACAS Resolution Advisory Report	To report ACAS active resolution advisory

With the above functionalities properly configured, Mode S ELS could bring the following benefits to ATC operations:

- a) Provide unambiguous aircraft identification ~~through the use of~~ using the unique aircraft address and aircraft identification;
- b) Help solving Mode 3/A code shortage in congested airspace, ~~through the use of~~ using the Mode S conspicuity code (A1000) instead of discrete Mode 3/A codes;
- c) Improve surveillance data integrity by;
 - 1) reducing synchronous garble*,
 - 2) lessening over-interrogations, and
 - 3) simplifying aircraft identification in case of false targets;
- d) Improve the accuracy of multi-surveillance tracking and safety nets with more accurate target detection from Mode S radars and high resolution in altitude reporting; and
- e) Able to process more aircraft tracks than conventional Mode A/C radars; ~~and-~~
- e)f) Able to ~~display~~ provide ACAS active resolution advisory ~~of the~~ from suitably equipped aircraft [AA1].

*Note, while Mode S will help to reduce data garble it will not totally resolve the issue. Issues around multi-path and different transponder types in close proximity (e.g. Mode A/C near a Mode S transponder) mean that the return received by the radar may not be correct. In the case of a Mode A/C transponder close to a Mode S transponder, instances have been recorded where the Mode S address has been transposed into the reply from the Mode A transponder.

4.2 Mode S EHS

Mode S EHS implementation includes all the features of Mode S ELS with the addition of DAPs stored in BDS code 4,0, BDS code 5,0 and BDS code 6,0 registers of aircraft's transponder. The following table summarizes the details of DAPs of these three registers:

Table 4-2 DAPs in Mode S EHS

Register	Name/Downlink Aircraft Parameters		Usage
BDS code 4,0	Selected Vertical Intention	MCP/FCU Selected Altitude	To provide information about the aircraft's current vertical intentions
		FMS Selected Altitude	
		Barometric Pressure Setting	
		MCP/FCU Mode	
		Target Altitude Source	
BDS code 5,0	Track and Turn Report	Roll Angle	To provide track and turn data to the ground systems.
		True Track Angle	
		Ground Speed	
		Track Angle Rate	
		True Air Speed	
BDS code 6,0	Heading and Speed Report	Magnetic Heading	To provide heading and speed data to ground systems.
		Indicated Air Speed	
		Mach Number	
		Barometric Altitude Rate	
		Inertial Vertical Velocity	

In addition to those improvements contributed by Mode S ELS in Section 4.1, Mode S EHS implementation provides the following benefits to ATC operation:

- a) Further improve multi-surveillance tracking accuracy and performance through the use of DAPs on track, turn, speed and heading of the aircraft in the track calculation;
- b) Further improve the accuracy of safety nets, e.g. Short-Term Conflict Alert (STCA), through the provision of more accurate aircraft tracks;
- c) Allow the implementation of new safety nets in ATM automation system for cross-checking selected aircraft vertical intention (i.e. Selected Altitude) with ATC controllers' instruction as well as verifying the barometric pressure setting applied in the aircraft with QNH setting in ATM automation system; and
- d) Improve situational awareness of ATC controllers by enabling the direct access of aircraft parameters in ATM automation system, e.g. Indicated Air Speed, Selected Altitude, Barometric Pressure Setting, etc.;
- e) Progressive reduction of R/T workload per aircraft.

4.3 DAPs Data Exchange Protocol Between Surveillance and ATM Automation System

The decoding of DAPs data from downlink messages is handled by ground surveillance equipment such as radars, ADS-B, MLAT and WAM ground stations. The Surveillance Data Processor (SDP) within the ATM automation system can combine multiple downlink messages into single target report for display to controllers. All Purpose Structured EUROCONTROL Surveillance Information Exchange (ASTERIX) formats are commonly used as the protocol for target report transmission from surveillance systems to the ATM automation system.

ASTERIX formats are categorized based on the types of surveillance data involved. ASTERIX Category 20, ASTERIX Category 21 and ASTERIX Category 48 are responsible for the DAPs data transmission from MLAT systems, ADS-B systems and radars respectively. For each ASTERIX category, the protocol format is further divided into different editions with variations on the supported DAPs data. ANSP's should carry out appropriate studies on the available protocol editions during the design stage to ensure the chosen format can cater for the scope of DAPs proposed to be implemented and that the Surveillance and ATM automation systems can correctly process the protocol selected.

For details, previous and current versions of ASTERIX Category 20, Category 21 and Category 48 specification documents can be downloaded from the following link of EUROCONTROL web sites:

<https://www.eurocontrol.int/publications/cat020-multilateration-mlt-messages-part-14>

<https://www.eurocontrol.int/publications/cat021-automatic-dependent-surveillance-broadcast-ads-b-messages-part-12>

<https://www.eurocontrol.int/publications/cat048-monoradar-target-reports-part-4-next-version-cat-001>

5. IMPLEMENTATION PRINCIPLES AND PHASES

Implementation guidance is developed to progress the DAPs implementation from concept to operational use in ICAO APAC region. In this chapter, section one addresses the implementation principles, which describes the issues of international coordination, system compatibility, data integrity and system integration, while section two addresses the implementation phase, to assist States with the management of DAPs implementation activities.

5.1 Implementation Principles

5.1.1 Stakeholders Coordination

DAPs provide useful information from aircraft which can benefit ANSP and airspace users. Improvements in efficiency and safety can be achieved, however the resultant changes in operational procedures to provide the improvements, will affect ANSPs, Regulators, Airlines, and other related airspace users. Before implementation by any States, a coordination team should be formed to study, coordinate, support and consult the implementation plans and related activities. The coordination team should include field experts on avionics, data link, surveillance infrastructures and end users.

Changes in the ATM operational procedures as the result of the use of DAPs requires coordination among ATS providers, Regulators, Airlines, and where applicable, coordination among neighboring States to maximize the benefits. All States are encouraged to share their operational experiences, and to report anomalies through Mode S DAPs WG and the Surveillance Implementation Coordination Group.

Not all Surveillance and ATM automation systems are capable of processing and using DAPs, therefore investment in all related fields needs to be considered by all States. The coordination team should be consulted for the future investment plans and related activities considering the technical and operational aspects. Consideration needs to be given to achieve a balance between investment and benefits.

5.1.2 System Compatibility

a) Technical:

DAPs can be obtained by different surveillance technologies such as Mode S Radar, ADS-B, MLAT and WAM, however not all the transponders can support DAPs. Different surveillance technologies in ICAO APAC States mean that system compatibility should be considered.

Potential interference between different surveillance technologies should be fully considered before implementation, otherwise the efficiency and safety of the system cannot be ensured. Harmonization between different technologies should be considered and optimized to reduce the RF congestion on 1030MHz and 1090MHz.

Since not all aircraft are equipped with Mode S transponders, and not all the Mode S transponder have the ability to support DAPs, compatibility and efficiency should always be considered before implementation.

When DAPs are implemented, the data rate will increase compared to the conventional radar data, and the related BDS information extraction strategies should be considered. To reduce load on the 1090MHz spectrum, only those registers intended for operational use should be interrogated/extracted.

b) Operational:

Different processing systems can support DAPs in different levels, hence the quality and information of target may be different after the processed DAPs has been added. For example, some radar tracking

algorithms will consider DAPs as an input to the tracking, so the quality and information of the target will be a little bit different, therefore there should be compatibility considerations between different systems before use of the target data.

There are different air traffic management and operation strategies used by neighboring States. ~~SoSo~~, the operational procedures should always consider the operational compatibilities. For example, Mode A/C transponders and Mode S transponders may be working in the same area.

5.1.3 DAPs Data Integrity

DAPs data integrity should always be the first consideration when putting DAPs data into use. Since the data integrity from the source are not delivered by any related BDS register now, States are encouraged to find a reliable methodology to ensure the data integrity prior to the use of the data. Additionally, ongoing means of determining data integrity should be implemented, along with an ability to exclude invalid DAPs data from ATM automation systems.

States which already have experience on data integrity are encouraged to share this information with other States. The coordination team could support and harmonize this activity, and provide a standard method to evaluate the data integrity, and share the method to all the States.

5.1.4 System Integration

By introducing DAPs, the target characteristic from the source to the end user may be different compared to pre-DAPs implementation. In different phases of the processing flow of target data, DAPs can be used by different systems to improve tracking performance. Some key points in the data flow are as follows:

a) Airborne Avionics Systems

As DAPs data comes from different kinds of sensors and avionics systems on the aircraft, the reliability of the data should be ensured before the data is used operationally. Research has shown that some BDS data is missing or not updated correctly. The reasons for this needs to be established as it can mean that use of some DAPs data is not suitable for implementation. Examples of issues include:

- 1) Older Flight Management Systems which do not provide all the DAPs data, and
- 2) Incorrect installation (e.g. onboard equipment wired to wrong registers)

b) Ground Sensor Systems

Ground sensors may use the DAPs to improve their target tracking performance, having an impact on the tracking function; the target data produced by this kind of sensors will show different characteristics to the pre-DAPs implemented tracking function, such as the turning rate, the kinematic movement and so on. Data users need to be aware of this performance improvement.

c) Ground Automation Systems

Ground automation systems can use DAPs information for a wide variety of uses, such as for tracking, safety net processing, situational awareness, en-route meteorological information sharing and so on. Ensuring DAPs information is processed and used in an appropriate way should be considered during implementation.

d) Other Surveillance Systems

Any DAPs data should be capable of being integrated with other surveillance systems data, and any potential difference and impact should be considered before use. Some of the information can be cross checked by different surveillance technologies.

- e) Other Related Systems

5.2 Implementation CHECKLIST

The purpose of this implementation checklist is to document the range of activities that needs to be completed to bring a DAPs application from an initial concept to operational use. Some activities of this checklist may be specific to individual stakeholders.

5.2.1 Activity Sequence

The activities are listed in an approximate sequential order. However, each activity does not have to be completed prior to starting the next activity. In many cases, a parallel and iterative process should be used to feed data and experience from one activity to another. It should be noted that not all activities will be required for all applications.

5.2.2 Concept Phase

- a) Construct operational concept:
 - 1) Purpose;
 - 2) Operational environment;
 - 3) ATM functions; and
 - 4) Infrastructure;

- b) Identify benefits:
 - 1) Safety enhancements;
 - 2) Efficiency;
 - 3) Capacity;
 - 4) Environmental;
 - 5) Cost reductions;
 - 6) Accessibility; and
 - 7) Other metrics (e.g. predictability, flexibility, usefulness);

- c) Identify constraints:
 - 1) Air-Ground interoperability;
 - 2) Compatibility with non-equipped aircraft;
 - 3) Need for exclusive airspace;
 - 4) Required ground infrastructure;
 - 5) RF spectrum;
 - 6) Integration with existing technology;
 - 7) Technology availability; and
 - 8) Actuality of existing infrastructure;

- d) Prepare business case:
 - 1) Cost benefit analysis; and
 - 2) Demand and justification.

5.2.3 Design Phase

- a) Identify operational requirements:
 - 1) Security; and
 - 2) Systems interoperability;
- b) Identify human factors issues:
 - 1) Human-machine interfaces;
 - 2) Training development and validation;
 - 3) Workload demands;
 - 4) Role of automation vs. role of human;
 - 5) Crew coordination/pilot decision-making interactions; and
 - 6) ATM collaborative decision-making.
- c) Identify technical requirements:
 - 1) Standards development;
 - 2) Prevailing avionics standards;
 - 3) Data required;
 - 4) Functional processing;
 - 5) Functional performance;
 - 6) Required certification levels; and
 - 7) Identify the infrastructure that needs upgrade.
- d) Equipment development, test, and evaluation:
 - 1) Prototype systems built to existing or draft standards/specifications;
 - 2) Upgrade and test scheme for the existing infrastructure;
 - 3) Developmental bench and flight tests;
 - 4) Acceptance test parameters; Acceptance test should be performed to ensure all the key indicators are met; and
 - 5) Select and procure technology.
- e) Develop procedures:
 - 1) Pilot and controller actions and responsibilities;
 - 2) Standardize the interaction and phraseologies;
 - 3) Controller's responsibility to maintain a monitoring function, if appropriate;
 - 4) System certification procedure should be made.
 - 5) Standard Operating Procedure should be made if the human machine interface of the system is changed.

- 6) Contingency procedures; For example duplicate Mode S address is detected;
 - 7) Emergency procedures, for example ACAS message is received;
 - 8) General procedures for unforeseen issues should be made; and
 - 9) Develop AIP and Information documentation.
- f) Prepare design phase safety case:
- 1) Safety rationale;
 - 2) Safety budget and allocation; and
 - 3) Functional hazard assessment.

5.2.4 Implementation Phase

- a) Prepare implementation phase safety case;
- b) Conduct operational test and evaluation:
- 1) Flight deck and ATC validation simulations; and
 - 2) Flight tests and operational trials;

- c) Obtain systems certification:
- 1) Aircraft equipment; and
 - 2) Ground systems;

- d) Obtain regulatory approvals:
- 1) Air traffic certification of use;

- e) Impact Assessment

An impact assessment should be conducted to gauge the effect in terms of security, efficiency, operating regulations, human factors, infrastructure, environment, and so on.

- f) Implementation transition:

- 1) Promulgate procedures;

The regulatory authority shall promulgate general regulations to the participants. Each participant shall formulate corresponding detailed regulations.

- 2) Deliver training;

Training should be conducted to ensure the personnel are familiar with standard, regulation, and technology of the Mode S DAPs implementation and operation. Licensing process could be executed if needed.

- 3) Continue data collection and analysis;
- 4) Resolve any unforeseen issues; and
- 5) Continue feedback into standards development processes;

- g) Performance monitoring to ensure that the agreed performance is maintained.

6. SYSTEM INTEGRITY AND MONITORING

6.1 Introduction

CNS and ATM environment is an integrated system including physical systems (hardware, software, and communication networks), human elements (pilots, controllers and engineers), and the operational procedures for its applications. The integration of Mode S DAPs with other surveillance technologies enables more information from an aircraft to be used to provide a safer service.

Because of the integrated nature of such system and the degree of interaction among its components, comprehensive system monitoring is recommended. The procedures described in this section aim to ensure system integrity by validation, identification, reporting and tracking of possible problems revealed during system monitoring with appropriate follow-up actions.

6.2 Personnel Licensing and Training

Prior to operating any element of the Mode S DAPs system, operational and technical personnel shall undertake appropriate training as determined by the ANSP or State Regulatory Authority, including compliance with the Convention on International Civil Aviation where applicable. With these the personnel will be familiar with regulation, standard and requirement of the Mode S DAPs implementation and operation.

6.3 ATS System Validation

6.3.1 Safety Assessment Guidelines

To meet system integrity requirements, ANSPs or States should conduct a validation process that confirms the integrity of their equipment and procedures. Such processes shall include:

- a) A system safety assessment for new implementations is the basis for definitions of system performance requirements. Where existing systems are being modified to utilize additional services, the assessment demonstrates that the ATS Provider's system will meet safety objectives.
- b) Integration test results confirming interoperability for operational use of airborne and ground systems; and
- c) Confirmation that the ATS operation procedure are compatible with those of adjacent providers where the system is used across a common boundary.

6.3.2 System Safety Assessment

The objective of the system safety assessment is to ensure that implementation and operation of Mode S DAPs is safe. The safety assessment should be conducted for implementation as well as any future enhancements and should include:

- a) Identifying failure or error conditions;
- b) Assigning levels of criticality;
- c) Determining risks/probabilities for occurrence;
- d) Identifying mitigating measures;

- e) Categorizing the degree of acceptability of risks; and
- f) Operational hazard ID process.

Following the safety assessment, States should institute measures to offset any identified failure or error conditions that are not already categorized as acceptable. This should be done to reduce the probability of their occurrence to an acceptable level. This could be accomplished through automation of procedures.

6.3.3 Integration Test

States should conduct trials with suitably equipped aircraft to ensure the DAPs data meets the operational and technical requirements to provide ATS. The introduction of the Mode S DAPs will give more information about the aircraft, and should not affect the performance of the existing system. States should be satisfied by test results and analysis carried out by the ANSP.

6.3.4 ATS Operation Manuals

States may coordinate with adjacent States to confirm that their ATS operation manuals contain standard operating procedures to ensure harmonization of procedures that impact across common boundaries.

6.4 System Monitoring

During the implementation and operation of the Mode S DAPs technology, routine collection of data is necessary in order to ensure that the system continues to meet or exceed its performance, safety and interoperability requirements, and that operational service delivery and procedures are working as intended.

6.4.1 Consideration for System Monitoring

Mode S transponders may have been installed a long time ago to support mandatory ACAS functionality. The Mode A/C function has been permanently used by ATC, but the Mode S functions may not have been used. Any failure impacting Mode A/C would have been detected by ATC during normal operation and corrective action would have been undertaken. Before implementing Mode S for surveillance, system checks are usually made to ensure the correct operation of the Mode S transponders (e.g. continue to correctly process Mode A/C and Mode S replies), but possibly no system checks were made to ensure that the DAPs data was correct, so a number of undetected failures may have existed over the years of operation.

A number of Mode S transponder from different OEMs have been observed to be non-compliant with Annex 10 Volume IV requirements (e.g. no SI code capability, no reply to aircraft register extraction, incorrectly configured aircraft address, incorrect content of BDS registers), even though the transponder is certified to level 2. Although actions have been taken in some areas (mainly where Mode S has been implemented) to address these problems, some aircraft with MODE S which are not working correctly still operate (mostly in areas where Mode S has not yet been implemented).

During the initial deployment of European Mode S, it was discovered that avionics upgrade performed on some aircraft had resulted in erroneous transponder operations so that, in some cases, the aircraft could not even be detected by the ground radar. It is therefore recommended that before commencing Mode S surveillance operations in a given airspace, system monitoring be put in place for the purpose of timely detection and rectification of hidden transponder problems. This will enable the ANSP and aircraft operators to remedy identified issues prior to using Mode S operationally.

The communication lines for transferring surveillance information in a Mode S radar require much higher data throughput as there is more information per aircraft. For example, compared to a Mode A/C radar, Mode S DAPs require up to three times more data throughput.

Mode S DAPs bring safety benefits even when only a portion of the traffic is properly equipped. Some aircraft can be configured to provide additional data ~~items~~, but their use should be considered with caution since some airborne installations may not have been certified, hence data may be erroneous. System monitoring to validate the transmitted information is considered desirable for DAPs operation.

6.4.2 Mode S DAPs Problem Reports

During the application of the Mode S DAPs, some problem may be found during the observation of one or more specific events. Faulty Mode S DAPs data should be recorded and analyzed. Problems may be found during the routine analysis of application data. Any problem should be documented and reported to the DAPs WG.

After a problem has been found, the finder can attempt to resolve it with the appropriate party ~~and~~ ~~also~~ report the solution to the DAPs WG. The problem and solution will be distributed to the DAPs WG members. If the problem has not been resolved, the problem should be reported to the DAPs WG, and members will be encouraged to resolve the problem. In many cases, a Mode S DAPs problem will be systematic across a particular aircraft or avionics configuration. Engagement with, and correction by the manufacturer may be required.

The mode S DAPs problem should be reported with the form as shown in Table 6-1.

Table 6-1 Mode S DAPs Problem Report Form

PRS#			
Start Time/Date UTC		End Time/Date UTC	
Registration		Aircraft ID	
Flight ID		ICAO Aircraft Address	
Aircraft Type			
Flight Sector/ Location			
ATS Unit			
Description / additional information			
Originator		Originator Reference number	
Organization			

PRS#: A unique identification number assigned by the PRS Administrator to this problem report. Organizations writing problem reports are encouraged to maintain their own internal list of these problems for tracking purposes. Once the problems have been reported to the PRS and incorporated in the database, a number will be assigned by the PRS and used for tracking by the SURICG.

Start Time/Date UTC: UTC time/date when the event occurred.

End Time/Date UTC: UTC time/date when the event ended.

Registration: Registration number (tail number) of the aircraft involved.

Aircraft ~~ID~~-ID: Coded equivalent of call sign as entered in FPL Item 7.

Flight ID: The Flight ID/Flight Number downlinked from the aircraft.

ICAO Aircraft Address:	Unique aircraft address expressed in Hexadecimal form.
Aircraft Type:	The aircraft model involved.
Flight Sector/Location:	The departure airport and destination airport for the sector being flown by the aircraft involved in the event. These should be the ICAO Identifiers of those airports. Or if more descriptive, give the location of the aircraft during the event.
ATS Unit:	ICAO identifier of the ATC center or tower controlling the aircraft at the time of the event.
Originator:	Point of contact at the originating organization for this report (usually the author).
Organization:	The name of the organization (airline, ATS provider or communications service provider) that created the report.
Description:	<p>This should provide as complete a description of the situation leading up to the problem as is possible. Where the organization reporting the problem is not able to provide all the information (e.g. the controller may not know everything that happens on the aircraft), it would be helpful if they would coordinate with the other parties to obtain the necessary information. The description should include:</p> <ul style="list-style-type: none">a) A complete description of the problem that is being reportedb) The route contained in the FMS and flight planc) Any flight deck indicationsd) Any indications provided to the controller when the problem occurrede) Any additional information that the originator of the problem report considers might be helpful but is not included on the list above <p>If necessary, to contain all the information, additional pages may be added. If the originator considers it might be helpful, diagrams and other additional information (such as printouts of message logs) may be appended to the report.</p>

6.4.3 Example of Mode S DAPs Problem

Through monitoring, it has been reported that erroneous DAPs data have been observed due to failure or improper setting/installation of Mode S equipment. A Working Paper of the ICAO Surveillance Panel Working Group (WP ASP12-20) has indicated that a lot of incorrect, outdated and even erroneous data and parameters are present for DAPs data. The errors and/or miss-matches can be frequent, including:

- a) The ACID is not always correct (erroneous)
- b) The Selected Altitude is not correct or is not updated (For example Selected Altitude data should be provided the MCP/FCU not by the FMS as the FMS data is usually incorrect).
- c) Mode S DAPs data does not correspond to the content of the requested register.

6.5 Application Analysis

During the Operation of Mode S DAPs, the application analysis is necessary ~~in order to~~ ensure that the system continues to meet or exceed its performance, safety and interoperability requirements. To analyze the Mode S DAPs applications, routine data should be recorded.

6.5.1 Data Recording

It is recommended that ATS providers and communication service providers retain the records defined below for at least 30 days to allow for accident/incident investigation processes. These records should be made available on request to the relevant State safety authority. Where data is sought from an adjacent State, the usual State to State channels should be used.

Where possible these recordings shall be in a form that permits a replay of the situation and identification of the messages that were received by the ATS system. Data exchange across borders may not be possible due to different Radar or ATM message formats or to State regulatory issues.

Not only the data from ground equipment, but also the data from aircraft equipment should be recorded. By analyzing the recorded data, the exact reason of the failures can be found.

6.5.2 Local Data Collection

ATS providers and communications service providers should identify and record Mode S DAPs system component failures that have the potential to negatively impact the safety of controlled flights or compromise service continuity.

6.5.3 Avionics Problem Identification and Correction

ATS providers should develop systems or procedures to:

- a) detect Mode S DAPs avionics anomalies and faults
- b) advise the regulators and where appropriate the aircraft operators on the detected Mode S DAPs avionics anomalies and faults
- c) devise mechanisms and procedures to address identified faults

Regulators should ensure that appropriate corrective actions are taken to address identified faults.

An example of Mode S DAPs analysis is taken in Appendix 1.

6.6 Identified Issues

Several identified issues had already been recognized during the implementation of the Mode S DAPs data application in ATM automation system. Some of them even disrupted the operation of ATC services. Thus, it is necessary to ensure the reliability of DAPs for utilization for ATC operation. This section will present some issues for helping to figure them out.

Based on the experience gained from States, the common Mode S DAPs problems are summarized under different categories in Appendix 2. It is noted that many cases of wrong DAPs found in Mode S implementation were because of the aircraft avionics capability. There are also some issues that resulted of human factors. Experiences showed that it was important to keep close coordination with airlines to promote the DAPs application. Airlines should be informed of the issues in time and to check their aircraft Mode S transponders in a timely manner. At the same time, airlines need improve their working procedures including ensuring they file flight plans correctly.

7. REGULATIONS AND PROCEDURES

Mode S DAPs involves the transmission of specific data from aircraft. These data messages can be interrogated by the ground equipment called Mode S interrogator. ~~ATM~~ use the data to show the more precise and integrated situation of the surveillance aircraft. The following procedures relate to the use of Mode S DAPs data in ATS ground surveillance applications.

The implementation of the Mode S DAPs system will support the provision of ~~high performance~~high-performance surveillance, enhancing flight safety, improving the controller efficiency and reducing the workload of both the controller and pilot.

7.1 Mandating Mode S DAPs

- a) Depending on the type of operations that States are going to conduct, States will have to consider whether there is a need to publish mandates. Some operations will require all aircraft within an airspace to be suitably equipped while others can still work well on a ‘best equipped best served’ basis.
- b) Use of Multilateration on airport surface is an example of an operation where it is recommended for all aircraft to be equipped with Mode S transponders. Another example is the conspicuity code environment, where Flight Identification may be used as the prime means to couple flight plans, allowing ANSPs to overcome the shortage of Mode A codes. Equipage mandates would be necessary for such operations.
- c) With appropriate software, ATM automation systems ~~are able to can~~ use Mode S DAPs to provide additional information to controllers, enabling a reduction in controller workload and the enhancement of Safety Net systems. Equipage mandates are not necessary, but consideration to the nature of the services required and/or a cost-benefit study, may warrant such mandates.
- d) As at May 2018, examples of States which use Mode S DAPs without publishing mandates are Australia¹, New Zealand and Singapore. Examples of States with published mandates for Mode S DAPs are France, Germany and the United Kingdom.
- e) In publishing mandate/regulations, States should:
 - 1) Define the standards applicable to the State.
 - i. E.g. *Joint Aviation Authorities (JAA) Temporary Guidance Leaflets (TGL) 13 Revision 1* for Elementary Surveillance in version 0 and version 1 transponders; or
 - ii. E.g. *European Aviation Safety Agency (EASA) Acceptable Means of Compliance (AMC) 20-13* for Enhanced Surveillance in version 0 and version 1 transponders; or
 - iii. E.g. *Elementary Surveillance (ELS) requirements stated in European Aviation Safety Agency (EASA) CS-ACNS-Subpart D, Section 2 (i.e. CS ACNS.D.ELS)* for Elementary Surveillance in version 2 transponder; or
 - iv. E.g. *Enhanced Surveillance (EHS) requirements stated in European Aviation Safety Agency (EASA) CS-ACNS-Subpart D, Section 3 (i.e. CS ACNS.D.EHS)* for Enhanced Surveillance in Version 2 transponder
 - iii.v. E.g. *Mode S level 2* if the requirement is simply for Airport Surface Multilateration.

¹ Australia has a mandate for Mode S transponders at selected airports utilising Multilateration for surface surveillance, but no widespread mandates for airborne DAPs usage

- 2) Define the airspace affected by the regulations
 - i. E.g. *Within the [FIR Authority] Flight Information Region above Flight Level XXX*
- 3) Define the category of aircraft that the regulation applies to
 - i. E.g. *Aircraft with a maximum certified take-off mass exceeding 5,700 kg or having a maximum cruising true airspeed capability greater than 250 kt; or*
 - ii. E.g. *All IFR aircraft*
- 4) Define the timing of the regulations allowing sufficient time for operators to equip.
 - i. E.g. *With effect from 1 Jan 2020.*

7.2 Avionics

7.2.1 Mode S Transponder Capabilities

- a) The various levels of capabilities for Mode S Transponders are described in subsequent paragraphs. State should select the capability as required by its operations.
- b) According to ICAO Annex 10, Vol. 4, Mode S transponders shall conform to one of five levels of capability as follows:
 - 1) Level 1 is the basic transponder. Level 1 permits surveillance based on Mode A/C as well as on Mode S. With a Mode S aircraft address, it comprises the minimum features for compatible operation with Mode S interrogators. It has no datalink capability and will not be used by international air traffic.
 - 2) Level 2 has the same capabilities as Level 1 and permits standard length datalink communication from ground to air and air to ground. It includes automatic aircraft identification reporting. This is the minimum level permitted for international flights. Data parity with overlay control (ICAO Annex 10, Vol. 4, 3.1.2.6.11.2.5) for equipment certified on or after 1 January 2020.
 - 3) Level 3 has the capabilities as level 2 and also those prescribed for ground-to-air ELM communications.
 - 4) Level 4 has the capabilities as level 3 and also those prescribed for air-to-ground ELM communications.
 - 5) Level 5 has the capabilities as level 4 and also those prescribed for enhanced Comm-B and ELM communications.
- c) Other than the various levels, transponders also can have the following features:
 - 1) Extended squitter - transponders that shall have the capabilities of level 2, 3, 4 or 5 ~~and~~ ~~also~~ ~~and~~ those prescribed for extended squitter operation.
 - 2) SI Capability - Transponders with the ability to process SI codes shall have the capabilities of level 2, 3, 4 or 5 ~~and~~ ~~also~~ ~~and~~ those prescribed for SI code operation.
 - 3) Data flash Application – transponders that implement the data flash mode.
 - 4) Hijack Mode Capability – transponders that support the Hijack Mode and have the capabilities of level 2, 3, 4 or 5.
 - 5) ACAS Compatibility – transponders compatible with ACAS.
 - 6) Antenna Diversity – in aircraft with transponder using two antennas, receivers and transmitting channels.

- 7) According to ED-73E, Elementary Surveillance – elementary surveillance transponders will require at least level 2 transponder and have the following capabilities:
 - i. Flight status reporting;
 - ii. Barometric pressure altitude reporting
 - iii. Transponder capability (CA)
 - iv. II and SI code capable
 - v. Declaration of capability (BDS code 1,0)
 - vi. Common usage GICB capability report (BDS code 1,7)
 - vii. Mode S specific services capability (BDS code 1,8 to BDS code 1,C)
 - viii. Flight identification (BDS code 2,0)
 - ix. ACAS Active Resolution Advisory (BDS code 3,0) if equipped with ACAS II
 - x. Aircraft register (BDS code 2,1) – optional

- 8) According to ED-73E, Enhanced Surveillance – enhanced surveillance transponders have the capabilities of elementary surveillance transponders, plus the capability to provide the following DAPs:
 - i. Magnetic Heading (BDS code 6,0)
 - ii. Indicated Airspeed and/or Mach No. (BDS code 6,0)
 - iii. Vertical Rate (climb/descend) (BDS code 6,0)
 - iv. True Airspeed (provided if Track Angle Rate is not available) (BDS code 6,0)
 - v. MCP/FCU Selected Altitude (BDS code 4,0)
 - vi. Ground Speed (BDS code 5,0)
 - vii. Roll Angle (BDS code 5,0)
 - viii. Track Angle Rate (if available) (BDS code 5,0)
 - ix. True Track Angle (BDS code 5,0)
 - x. Barometric Pressure Setting (BDS code 4,0)

7.2.2 Transition Guidelines

- a) Equipage of aircraft will be achieved over a period of time. Not all aircraft will be equipped with the necessary capability. A transition plan is required to accommodate varying degrees of aircraft equipment compliance.
- b) As part of the formulation for a transition plan, States should assess the impact of having aircraft that are not suitably equipped within the affected airspace, to enable the implementation of suitable mitigating measures. States should also collect statistics on the readiness of the aircraft within the affected airspace.
- c) For different operations, the mitigation measures in the transition plan could be different. For example, if the operation is just to use the Mode S DAPs to provide useful information to the controllers, the impact of having unequipped aircraft is minor. Mitigating measures could be as simple as making the controllers aware that not all aircraft are able to provide the information. On the other hand, where mode S is mandated for airport surface Multilateration, mitigating measures for having unequipped aircraft may include having special procedures for non-equipped aircraft or the deployment of a surface movement radar.

7.2.3 Interrogation of Transponders on Ground

Table 7-1 summarizes the requirements to inhibit or not inhibit replies from aircraft on the ground.

Table 7-1 The Requirements of Interrogation of Transponders on Ground

Type of interrogations	Transponder reply
Mode A/C	Should be inhibited
Mode A/C/S All Call	Shall always be inhibited
Mode S only All Call (UF =11)	Shall always be inhibited
Mode S (Roll call UF=0,4,5,16,20,21,24)	Shall not be inhibited
Acquisition Squitter (Short Squitter)	Shall be inhibited if surface type of extended squitter is transmitted
Extended Squitter (Long Squitter)	Shall not be inhibited

[Information obtained from Eurocontrol's Clarification Mode S Transponder in an Airport/A-SMGCS Environment Ed 1.1 dated 3 May 2005]

- a) Replies to Mode A/C/S all call and Mode S only all call interrogations shall always be inhibited when the aircraft declares the on the ground state. It shall not be possible to inhibit replies to discretely addressed Mode S interrogations regardless of whether the aircraft is airborne or on the ground.
- b) Mode A/C replies should be inhibited (i.e. Mode A/C transponder set to standby) when the aircraft is on the ground to prevent interference when in close proximity to an interrogator or other aircraft. Mode S discretely addressed interrogations do not give rise to such interference. An exception on the recommendation to inhibit Mode A/C replies will be at airports having Multilateration systems working with Mode A/C.
- c) Mode S transponders shall be set to the correct mode according to its flight status (i.e. airborne mode when it's in the air and ground mode when on the ground). When an aircraft is in ground mode, replies to all call are inhibited. It is recommended that aircraft provide means to determine the on-the-ground state automatically and provide that information to the transponder.

7.3 Mode S Interrogator

7.3.1 Working Principles

The Mode S interrogators transmit interrogation to elicit replies for detection of Mode S transponders and more information from the aircraft. Use of a unique ICAO 24-bit aircraft address and provision of all the required aircraft data in one reply will reduce interrogation rates.

Each aircraft can be interrogated selectively, needing only one or two 'hits' per aircraft per scan and minimizing interference problems associated with SSR Mode A/C.

The operation of a Mode S interrogator will not interfere with the SSR performance of any aircraft equipped with a Mode A/C transponder.

A Mode S interrogator is capable of performing the conventional surveillance function with Mode A/C transponders.

7.3.2 Interrogator Codes

The Mode S system requires each interrogator to have an IC, which can be carried within the uplink and downlink transmissions. The 4-bit IC uplink field in UF11 shall contain either 4-bit II code or the lower

4 bits of the 6-bit SI codes. It is recommended that whenever possible an interrogator should operate using a single interrogator code.

The II codes shall be assigned to interrogators in the range from 0 to 15. The II code value of 0 shall only be used for supplementary acquisition. The SI codes shall be assigned to interrogators in the range from 1 to 63. The SI code value of 0 shall not be used.

The assignment of interrogator II or SI codes, where necessary in areas of overlapping coverage, across international boundaries of flight information regions, shall be the subject of regional air navigation agreements. The ICAO Asia Pacific Regional Office maintains a register of II codes used – where States have provided this information to the office. States are encouraged to provide this information to the Regional Office and update it when changes are made.

7.3.3 Interrogation Methods [AA2]

The particular air traffic and environment of each interrogator will influence the selection of suitable interrogation periods, interrogation repeat frequency, MIP and Probability of Reply.




Figure.7-1 The Typical MIP

The repetition frequency and duration of the All-Call period is a local implementation issue (the stated ICAO maximum is 250Hz). The exact duration of either period will depend on the characteristics of the system such as the antenna revolution rate, the beam-width and the maximum range. There will normally be several all-call periods (and hence roll-call periods as one will always follow the other) available to interrogate all targets in range during one revolution.

There is a careful balance between the reliable acquisition of all targets and the potential of flooding the RF environment with unwanted replies to acquisition interrogations. It is necessary to choose an appropriate Mode Interlace Pattern to manage the acquisition activities to ensure minimal interference. The default objective is to define a MIP which effectively detects and performs surveillance on classical SSR Mode A/C aircraft using Mode A/C interrogations which also detects and acquires Mode S aircraft using Mode S interrogations. The MIP is constructed in order to separate Mode A/C and Mode S all-calls from Mode S selective (roll-call) activity. MIP defines the sequences of all-call interrogation types that might be made during cycles of all-call periods. Every interrogator is likely to have different needs and hence different ways of operating.


7.3.4 Interrogate Comm-B Data

The GICB procedure is initiated by a Mode S interrogator for eliciting the Mode S DAPs containing aircraft derived data from a Mode S aircraft installation.

The GICB protocol allows for the immediate transfer of data required by the ground and the extraction of information stored in the Mode S transponder. This information (if available) is contained in the reply to an interrogation specifying the address (BDS code) of the storage location containing that information.

The interrogation with specific BDS can elicit the corresponding Comm-B data where contained in Mode S transponder's registers. The Mode S DAPs can be implemented in two stages: ELS and EHS.

The first processing step for any Mode S data link application is to obtain the transponder CA value from the aircraft. The 3-bit CA field is found in the “Mode S All-Call Reply” (DF=11) and the “Extended Squitter” (DF=17) downlinks. If CA=0, then this transponder is surveillance-only and supports no data link functions at all. If CA \geq 4 indicate that the Mode S transponder is fully capable of at least 56-bit short uplink and downlink message transfer. These Mode S transponders may support the ELS, EHS requirements. The values of CA= 1, 2, 3 are reserved.

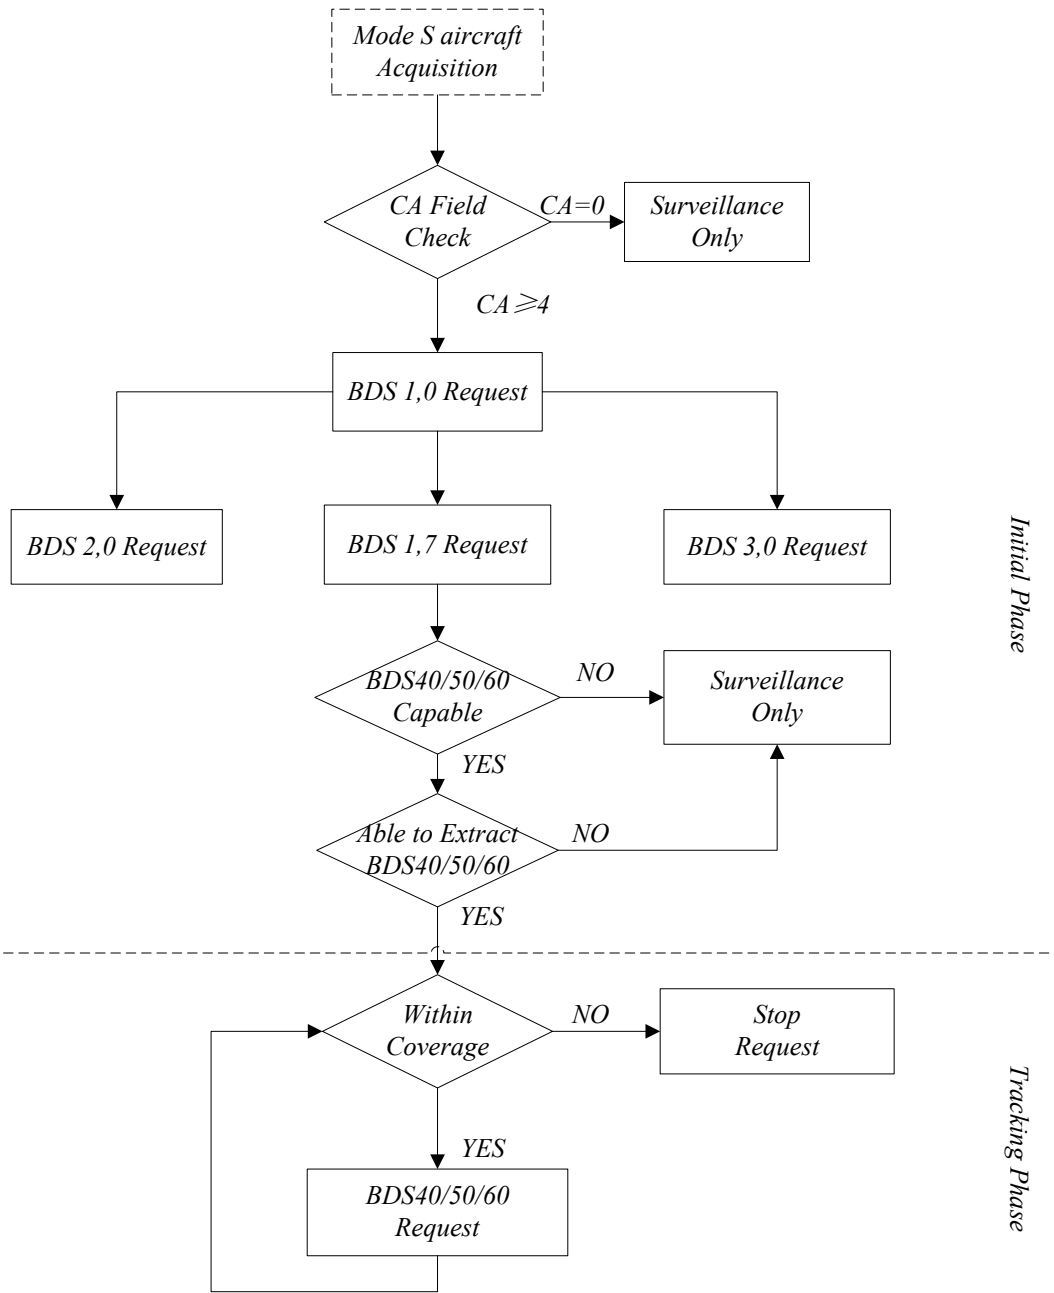

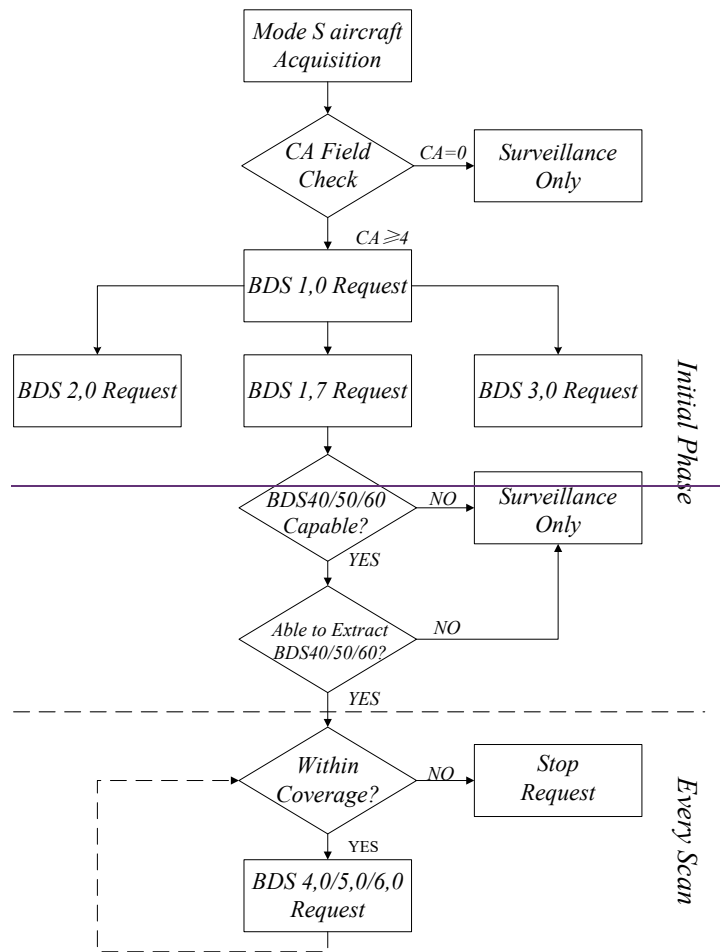


Figure.7-2 The Typical Procedure of DAPs Extraction

Given that the Mode S transponder's CA value is 4 or greater, the second processing step for any Mode S data link application is to extract the transponder's Mode S data link capability report register BDS code 1,0. Bits in this register indicate the support of such Mode S data link functions as aircraft identification (register BDS code 2,0), ACAS (register BDS code 3,0), common-usage capability (register BDS code 1,7) etc. The Mode S-Specific services capability bit in register BDS code 1,0 indicates whether the avionics installation supports further data link functions. If this bit is set, the Mode S data link application would next extract the common-usage capability register BDS code 1,7. All of the registers involved with the ELS, EHS application have bit flags assigned in this register BDS code 1,7. If the bit flag is set, it indicates that the corresponding register has been updated in a timely manner and contains valid data which can be extracted by the interrogator. The processing protocol is sufficient initialization for basic data link applications such as ELS, EHS since all their status and configuration information is available from register BDS code 1,0 and register BDS code 1,7.

SoSo, the Mode S interrogator should transmit the selectively interrogation to elicit the Mode S transponder reply with the specific formats and Comm-B data contained in the corresponding registers.

Normally, the more Comm-B data requested by the Mode S interrogator, the more information can be extracted from the aircraft transponder registers. It will also help the ATC controller get the aircraft's flight status and flight intention. However, there should be some necessary limitations for the Comm-B data request to avoid the phenomenon of Comm-B data discontinuity because of the limited Roll-Call interrogation duration.

It is suggested that the number, periodicity and priority of BDS data extraction rule be reasonably and effectively implemented according to the requirements and the number of aircraft in the airspace. The scientific strategy can ensure the ATC controller get Comm-B data timely and effectively.

7.4 ATM Automation System

7.4.1 Elementary Surveillance

For the Elementary Surveillance, the following parameters of aircraft can be beneficial to the ATM automation system:

- a) ICAO 24-bit Aircraft Address/Aircraft Identification
 - 1) The ATM automation system should collect the real aircraft address/aircraft identification from the received message, and the aircraft address/aircraft identification can be shown on the control HMI to identify the aircraft.
 - 2) The ATM automation system can use the aircraft address/aircraft identification to correlate an aircraft's track with the flight plan, so the use of aircraft address/aircraft identity can alleviate the shortage of Mode 3/A code. Correlation between track and flight plan-s is normally based on either the ~~The elements that influence the automation system~~ correlation function generally include 24-bit aircraft address, aircraft identification, ~~and/or the Mode 3/A code. The ATM automation system can determine the correlation will depend on based on their weights and of the above elements or the priority of them.~~
 - 3) The ATM automation system can also utilize the aircraft address/aircraft identification to improve the tracking function.
 - 3)4) The ATM automation system could provide DUPE warning between aircrafts which have the same ICAO 24-bit aircraft address, s-or same aircraft identification or the same MODE 3/A code.

- b) Transponder Capability Report

The ATM automation system can collect datalink capability of transponder from the receive message and show the information to the controller. The controller can estimate whether the aircraft with this transponder meets the requirement in the airspace

- c) Altitude reporting in 25ft interval

The ATM automation system can collect aircraft altitude reporting in 25ft increments and provides valuable improvements to the quality of safety nets. The improvements should reduce the number of nuisance alerts and enhance the integrity of separation assurance.

- d) Flight status (airborne/on the ground)

The ATM automation system can collect the flight status of the aircraft. Whether the aircraft is airborne or on the ground can be shown in the system to improve situational awareness of the controller. Also, the flight status can be used to filter the aircraft on the ground in the system if necessary.

- e) ACAS Resolution Advisory Report

The ATM automation system can collect the ACAS Resolution Advisory Report and the information can be shown in the system to improve situational awareness of the controller.

7.4.2 Enhanced Surveillance

For the Enhanced Surveillance, the following parameters of aircraft can be beneficial to the ATM automation system:

- a) Selected Altitude
 - 1) The ATM automation system can collect the selected altitude of the aircraft and show the information to the controller to improve the situational awareness of the controller.
 - 2) The ATM automation system can generate an optimized CLAM alert when the SFL chosen by the crew does not match the cleared altitude given by the controller, alerting the controller to take appropriate action to remedy the issue.
 - 3) The ATM automation system can also utilize the SFL to improve the accuracy of safety net.

- b) Barometric data

The ATM automation system can collect the barometric data of the aircraft and show the information to the controller. The system can provide a warning when the barometric data transmitted by the aircraft does not match the parameter of the area where the aircraft is operating.

- c) Roll Angle, Track Angle Rate, True Track Angle, Ground Speed, Magnetic Heading, True Airspeed
 - 1) The ATM automation system can collect these parameters and may allow the display of some of the information to the controller to improve the situational awareness of the controller. Display of some parameters, provides a clearer picture to the controllers generating a reduction in radio calls with the pilot, so the R/T usage between controller and individual aircraft under service are reduced.
 - 2) The system can utilize the kinematics information of the aircraft to perform a more precise tracking function and improve the accuracy of safety net.
 - 3) The system may use True track angle, Magnetic Heading, True Airspeed and Ground Speed to calculate a wind direction and speed of a specific area, which will enable the updating of forecast winds and improve trajectory modeling in the system. The system may also show the wind information to the controller to improve situational awareness of the controller.

- d) Vertical Rate

The ATM automation system can collect the vertical rate data of the aircraft to improve the precision of the compute altitude and the accuracy of the related alert. The system can make use of the data to realize an optimized CFL protection in STCA and MSAW analysis function.

- e) Indicated Air Speed/Mach Number

The ATM automation system can acquire indicated air speed/Mach number of the aircraft, allow ATC to monitor the aircrew compliance with the controller's instructions, and if required provide a warning to the controller when there is a mismatch.

7.5 Flight Planning

7.5.1 ICAO Flight Plan Item 7 - Aircraft Identification

ACID must be accurately record in item 7 of the ICAO Flight Plan form as per the following instructions:

Aircraft Identification, not exceeding 7 alphanumeric characters and without hyphens or symbols is to be entered both in item 7 of the flight plan and replicated exactly when set in the aircraft (for transmission as Flight ID) as follows:

Either,

- a) The ICAO designator for the aircraft operating agency followed by the flight identification (e.g. KLM511, NGA213, JTR25), when in radiotelephony the call sign to be used by the aircraft will consists of the ICAO telephony designator for the operating agency followed by the flight identification (e.g. KLM 511, NIGERIA213, JESTER25).

Or,

- b) The nationality or common mark registration marking of the aircraft (e.g. EIAKO, 4XBCD, N2567GA), when:
 - 1) in radiotelephony the callsign used by the aircraft will consists of this identification alone (e.g. CGAJS), or preceded by the ICAO telephony designator for the operating agency (e.g. BLIZZARD CGAJS),
 - 2) the aircraft is not equipped with radio.

Note 1: No zeros, hyphens, dashes or spaces are to be added when the Aircraft Identification consists of less than 7 characters.

Note 2: Appendix 2 to ICAO DOC4444 (PANS-ATM 16th edition, 2016) refers.

Note 3: Standards for nationality, common and registration marks to be used are contained in Annex 7, section 3.

Note 4: Provisions for the use of radiotelephony call signs are contained in Annex 10, Volume II, Chapter 5. ICAO designators and telephony designators for aircraft operating agencies are contained in Doc 8585 — Designators for Aircraft Operating Agencies, Aeronautical Authorities and Services.

7.5.2 Equipment (Surveillance Equipment /SSR Equipment)

- a) ICAO Flight Plan Item 10 – Surveillance Equipment and Capabilities

When an aircraft is equipped with a Mode S Transponder, appropriate Mode S designator shall be entered in item 10 of the flight plan to indicate that the flight is capable of transmitting Mode S DAPs messages.

These are defined in ICAO DOC 4444 as follows:

‘N’ No surveillance equipment for the route to be flown is carried, or the equipment is unserviceable

SSR Mode A and C

‘A’ Mode A transponder

‘C’ Mode A and Mode C transponder

SSR Mode S

‘E’ Mode S transponder, including aircraft identification, pressure-altitude and extended squitter (ADS-B) capability

‘H’ Mode S transponder, including aircraft identification, pressure-altitude and enhanced surveillance capability

‘I’ Mode S transponder, including aircraft identification, but no pressure-altitude capability

‘L’ Mode S transponder, including aircraft identification, pressure-altitude, extended squitter (ADS-B) and enhanced surveillance capability

‘P’ Mode S transponder, including pressure-altitude, but no aircraft identification capability

‘S’ Mode S transponder, including both pressure altitude and aircraft identification capability

‘X’ Mode S transponder with neither aircraft identification nor pressure-altitude capability

Note: Enhanced surveillance capability is the ability of the aircraft to down-link aircraft derived data via a Mode S transponder.

b) ICAO Flight Plan Item 18 – Other Information

Where required by the appropriate authority the ICAO AA (24 Bit Code) may be recorded in Item 18 of the ICAO flight plan, in hexadecimal format as per the following example:

CODE/7C432B

Members or states should note that use of hexadecimal code may be prone to human error and is less flexible in regard to airframe changes for a notified flight.

7.5.3 Inconsistency between Mode S Flight Planning and Surveillance Capability

Inconsistency between flight planning of Mode S and surveillance capability of an aircraft can impact on ATC planning and situational awareness. States are encouraged to monitor for consistency between flight plan indicators and actual surveillance capability. Where discrepancies are identified aircraft operators should be contacted and instructed to correct flight plans, or general advice (as appropriate to the operational environment and type of flight planning problems) should be issued to aircraft operators.

Advice to Operators:

Concerning inconsistency between Mode S Flight Planning and Surveillance Capability:

- a) ICAO AA (24 Bit Code) not submitted, or submitted incorrectly.
- b) Mode S and surveillance capabilities indicators incorrectly.

The flight planning requirements for aircraft are described in local document reference or ICAO DOC 4444 Appendix 2. The capability of the aircraft transponder and ADS-B capability will typically be available in the transponder manual or in the aircraft flight manual for the aircraft. If in doubt, consult the transponder manual, aircraft flight manual or the Licensed Aircraft Maintenance Engineer.

7.5.4 Setting Flight ID in Cockpits

a) Flight ID Principles

The Flight ID is the equivalent of the aircraft callsign and is used in both Mode S SSR and ADS-B technology. Up to seven characters long, it is usually set in airline aircraft by the flight crew via a cockpit interface. It enables air traffic controllers to identify an aircraft on a display and to correlate a radar or ADS-B track with the filed flight plan ACID. Flight ID is critical, so it must be entered carefully. Punching in the wrong characters can lead to ATC confusing one aircraft with another.

It is important that the Flight ID entered in the transponder exactly matches ACID entered in the flight plan.

Intuitive correlation between an aircraft's flight identification and radio callsign enhances situational awareness and communication. Airlines typically use a three letter ICAO airline code in flight plans, NOT the two letter IATA codes.

b) Setting Flight ID

The callsign dictates the applicable option below for setting Mode S or ADS-B Flight ID:

- 1) The flight number using the ICAO three-letter designator for the aircraft operator if a flight number callsign is being used (e.g. QFA1 for Qantas 1, THA54 for Thai 54).
- 2) The nationality and registration mark (without hyphen) of the aircraft if the callsign is the full version of the registration (e.g. VHABC for international operations).
- 3) The registration mark alone of the aircraft if the callsign is the abbreviated version of the registration (e.g. ABC for domestic operations).
- 4) The designator corresponding to a particular callsign approved by the ANSP or regulator (e.g. SPTR13 for firespotter 13).
- 5) The designator corresponding to a particular callsign in accordance with the operations manual of the relevant recreational aircraft administrative organization (e.g. G123 for Gyroplane 123).

7.6 Contingency Plan

ANSPs should prepare appropriate contingency plans in the event of a system failure that prevents use of Mode S DAPs.

8. TRAINING AND COMPETENCE

8.1 Introduction

Training and development play an important role in the effectiveness of organizations and to the experiences of people in work. Training on DAPs has implications in improving productivity, aviation safety and personal development. The primary goal of the training is to develop and maintain an appropriate level of trust in DAPs related module, i.e. to make ATC and ATSEP aware of the likely situations where DAPs will be effective and, more importantly, situations in which DAPs will not be so effective (e.g. sudden, unexpected maneuvers).

8.2 Training of an Air Traffic Controller (ATC) in DAPs

With the inclusion of DAPs into surveillance and ATM automation system, an ATC training plan should adopt a modular approach. This approach progressively introduces various features, functionality of the new system on one hand and allows for integration with the ATC operational procedures. Additional benefits include shorter, logical self-contained units, clear attainable goals, better evaluation of training effectiveness and simplified self-assessment.

The ANSP should develop familiarization and rating focused training to ATC prior to adoption of DAPs in Surveillance and ATM automation systems.

The ANSP should ensure that all ATC concerned are assessed as competent for the use of the relevant DAPs module.

8.3 Training of an ATSEP in DAPs

- a) The ANSP should develop an ATSEP training programme that is acceptable to the ANS Regulator prior to its implementation.
- b) As a minimum, the training programme should comprise three levels as described below:
 - 1) Level 1 (Basic training). This should comprise training on the basic Surveillance and ATM automation systems operating in the State and their impacts on the safety of aircraft operations. The ANSP should ensure every ATSEP undergoes the basic training.
 - 2) Level 2 (Qualification training). This should comprise training to develop knowledge and skills on Surveillance and ATM automation systems. The ANSP should ensure each ATSEP is trained in one or more domains depending on their job scope.
 - 3) Level 3 (Specialized training). This should comprise training on specific Surveillance and ATM automation systems installed in the State, followed by on-the-job training.
- c) The ANSP should conduct a yearly review of the training plan for each ATSEP at the beginning of the year to identify any gaps in competency or changes in training requirements and priorities the type of training required for the coming year in regards of DAPs development.
- d) The ANSP should keep records of individual ATSEP training, competency assessment and approval history, where applicable, and associated documents. The records should be kept at least until the Surveillance and ATM automation system of which the ATSEP was trained on is no longer in use with the ANSP.
- e) The individual training records for each of ATSEP should include a training plan detailing the courses completed as well as the time-frame for attending future courses as required under

his/her training plan.

8.4 Competency Assessment of an ATSEP in DAPs

- a) The ANSP should develop an assessment methodology to determine the competency of an ATSEP in accordance with the competency framework developed in PANS-Training and which should be adapted to suit the local context.
- b) The ANSP may select a person to be a competency assessor only if the person –
 - 1) is an ATSEP approved in accordance with paragraph 8.3 for the particular Surveillance and ATM automation system; and
 - 2) has received adequate training in the conduct of competency assessment, practical checks and oral questionings.
- c) A competency assessor should not conduct a competency assessment on an ATSEP who is under the direct supervision of the competency assessor, unless the assessment is done in the presence of a second independent assessor.
- d) The assessment methodology should include a process for on-going competency checking and refresher training to ensure retention of competence.

9. SPECIFIC EXAMPLES ON MODE S DAPs APPLICATION

9.1 Use of Selected Altitude

Since August 2013, Mode S data processing functions have been implemented in Chengdu ATM automation system. The system uses the select altitude data extracted from the Mode S DAPs to provide an optimized CLAM alert for controllers. The system will generate the alert when the SFL chosen by the crew does not match the cleared altitude recorded in the ATM automation system. And a time delay parameter is predefined for the response time of the flight after controllers input to the ATM automation system (typically at the time of instruction given to the pilot).

Thanks to this new kind of alert, controllers have a better awareness of the intention of the airplanes and may discover the crew's mis-operation much earlier than the traditional CLAM, and then take actions timely to avoid the potential conflict.

In April 2017, an A320 aircraft was maintaining level flight at 27600 feet with another flight flying nearby at 26600 feet. Suddenly, the crew set an error altitude 22600 feet. The ATM automation system triggered the alert immediately even before the aircraft began to descend. The controller quickly noticed the alert and informed the crew in time. The aircraft successfully stopped descend at 27400 feet.

9.2 Use of ACAS RA [AA3]

~~With the advancement increasingly growing development of the ASTERIX standards and DAPs application, an ATCM system canis highly qualified to handle the derived data from Aircrafts, which is detected, received and transmitted through the Mode S Radar Mode S, ADS-B station, and WAM sensors station. In the event that an The most important of these, in ease Airborne Collision Avoidance System (ACAS) emergency occurs when a Resolution Advisory (RA), is associated to a system track, is that ATCM system is able to eapable of providinge a visual and aural alarm warning and indicative pilot intention to the controllermanifested on the position screen, with an aural alarm raised as defined.~~

~~The surveillance track update function in the ATC system shall process the offline defined DAPs data including Communication/ACAS capability and ACAS resolution. On the other hand, Resolution Advisory (RA) alerting function works is of vital importance and essential requisite that is offline allowed and the presence and removal of that is defined as follows:~~

~~- A resolution advisory is present when, in the subfields I048/260, I020/260, I021/260, I021/260 or I062/380 subfield #12(ACS), the bits are set as follows:~~

- ~~• the first bit of the ARA field set to 1 and the RAT bit set to 0 or,~~
- ~~• the first bit of the ARA field set to 0, the MTE bit set to 1 and the RAT bit set to 0.~~

~~- A resolution advisory is removed when:~~

- ~~• the ACAS RA report subfield (I048/260, I020/260, I021/260 or I062/380 subfield #12(ACS)) contains the RAT bit set to 1, or~~
- ~~• An ACAS RA report is not received in the relevant Data Item of the ASTERIX report.~~

~~Besides, the Resolution Advisory Intention is populated base on the PILOT selection and according to the following table:~~

<u>MTE</u> <u>(60)</u>	<u>ARA</u> <u>(41)</u>	<u>42</u>	<u>43</u>	<u>44</u>	<u>45</u>	<u>46</u>	<u>47</u>	<u>RA Selection</u>	<u>RA Intention</u>
<u>1</u>	<u>0</u>	<u>Any</u>	<u>0</u>	<u>Any</u>	<u>1</u>	<u>Any</u>	<u>Any</u>	<u>Descend</u>	<u>Positive descend (Descent to avoid the threat)</u>
<u>1</u>	<u>0</u>	<u>Any</u>	<u>1</u>	<u>Any</u>	<u>0</u>	<u>Any</u>	<u>Any</u>	<u>Climb</u>	<u>Positive climb (Climb to avoid the threat)</u>
<u>1</u>	<u>0</u>	<u>Any</u>	<u>0</u>	<u>Any</u>	<u>0</u>	<u>Any</u>	<u>Any</u>	<u>Other</u>	<u>Other (reduce rate of climb or descent, etc)</u>

*NOTE: ACAS Airborne Collision Avoidance System, applied in the EURO Aviation System, [has](#) the same meaning as TCAS abbreviated to Traffic Alert and Collision Avoidance System in the USA Aviation System

APPENDIX 1: Mode S DAPs Analysis

a) Data Recording Configuration

Figure 1 represents an example of a configuration for data recording. The Mode S sensor sends interrogations to an individual aircraft using a unique ICAO 24-bit aircraft address. The Mode S transponder has 255 BDS Registers. Each register stores aircraft parameters data derived from FMS or other sensors. An interrogation uses GICB protocol to request a specific BDS Register data. In response to the interrogation, Mode S transponder sends a reply which contains the BDS register data.

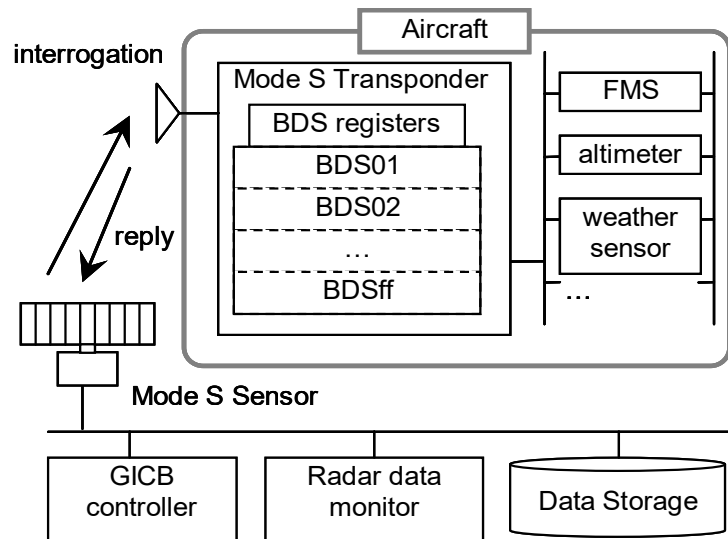


Figure1 - Example of Data Recording Configuration

b) Data Analysis

As described above section, erroneous DAPs data have been observed due to failure or improper setting/installation of Mode S avionics equipment. Bad data hinders the use of DAPs by the ATEM service. To employ DAPs for ATEM services, the reliability of DAPs is important. Therefore, it is necessary to analyze the recorded data to ensure reliability of the DAPs data.

If a controller finds some problem during the application of the Mode S DAPs, the ATS providers can analyze the recorded data to find the exact reason which caused the problem. If the ATS equipment has a fault which caused the problem, the ATS provider should implement a solution as soon as possible. If the ATS provider proves that the problem is caused by an avionics fault, then the problem should be reported to the appropriate party to solve the problem. The ATS providers need to devise mechanisms and procedures to address identified faults.

ATS providers should develop systems to analyze the routine recorded data. From the analyses, ATS providers can provide more information of the transponder's performance such as SI capability, datalink capability etc. The information can be used to improve the capability of the operation of Mode S DAPs equipment. By analyzing the recorded data, advice on avionics anomalies and faults, which have been detected, can be passed onto the regulators and the aircraft operators.

c) DAPs Data Validation

~~In order to~~ ensure that Mode S DAPs are operating in conformance with the ICAO requirements, validating DAPs data is highly recommended. It has been noted that there are some drawbacks in the traditional methodology of executing tests for aircraft on the ground as follows:

- 1) Avionics for DAPs consist of ~~a number of several~~ devices and functional blocks. They are ~~interconnected~~ interconnected, and the configuration is complicated.
- 2) Avionics and configuration differ depending on each aircraft.
- 3) It is difficult to cover the possible test patterns completely.
- 4) Ground test methodology would not detect failures or anomalies that occur after the testing.

Responding to these drawbacks, MIT Lincoln Laboratory developed and proposed a DAPs validation methodology, which monitors DAPs data received from actual flying aircraft to detect erroneous data. The MIT validation methodology is mainly categorized by two groups, static value tests and dynamic value tests.

Static value tests are executed to detect erroneous values of the bits and fields in BDS registers which do not change during a flight. Those bits and fields represent the avionics system's configuration, capability, and status information. These tests verify that those bits and fields are proper values in compliance with the ICAO regulations for DAPs applications. Table 1 shows an example of static value tests. As can be seen by the table, failed data were detected in each BDS register test. For BDS Register 20₁₆, failed data with wrong character coding were caused not due to equipment problem, but to faulty data input.

Table 1 Example of Static Value Tests

BDS Register	Test Item	Total Count		Aircraft	
		Executed	Failed	Executed	Failed
BDS code 1,0	Aircraft identification capability flag = '1'	544,980	7,183	3,615	146
BDS code 2,0	Each character conforms to ICAO 6-bit character coding	737,993	1,516	3,596	144
BDS code 4,0	Unavailable data fields are set at zero	54,248,802	1,755	3,614	4

Dynamic value tests validate the values which dynamically change according to aircraft motion, such as aircraft speed and track angle. The tests compare the DAPs values with equivalent data like radar-measured positions. If the difference between DAPs values and radar-derived parameters exceeds the acceptability threshold, the DAPs value is accounted as an error. Figure 2 represents an example of dynamic value tests. This figure indicates that ground speed differences between DAPs data and radar-derived data fall inside the threshold range.

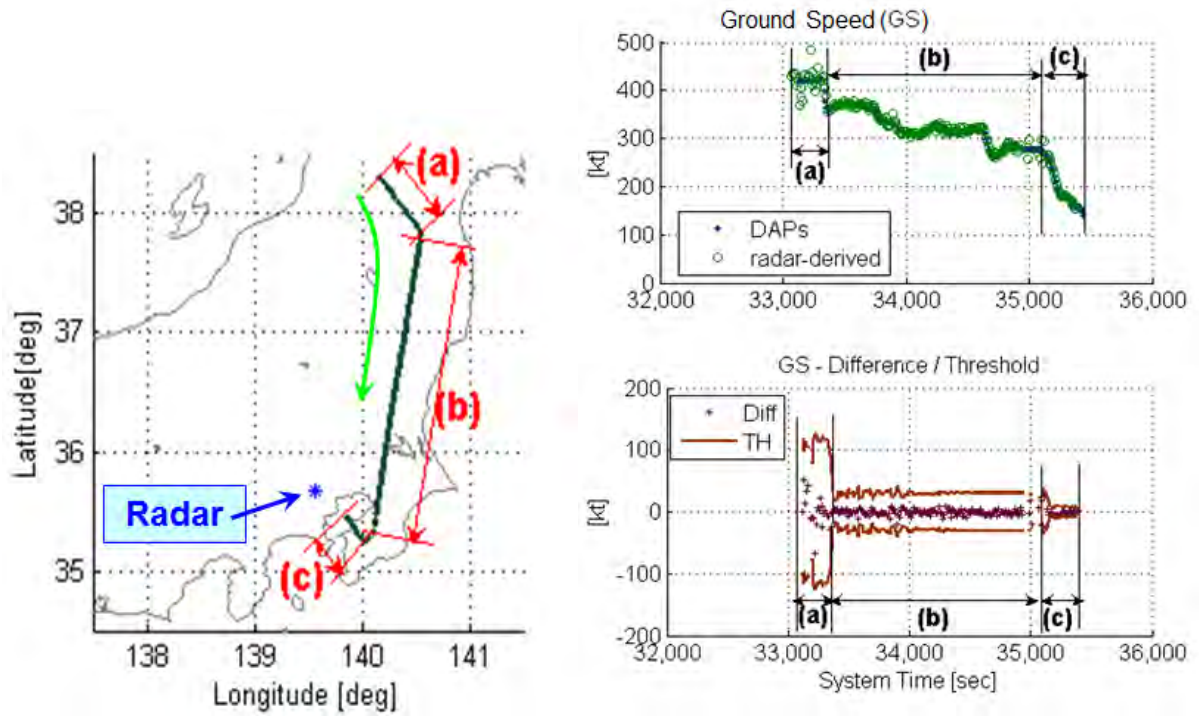


Figure 2 - Example of Dynamic Value Tests

left to blank

APPENDIX 2: LIST OF IDENTIFIED ISSUES

Ref.	Issue	Cause	Safety Implications to ATC (Yes / No)	Recommendations
1.	Wrong ground bits in DAPs led to the track decoupling from the flight plan	Through joint investigation with the airlines, it found that parts of the aircraft A were exchanged with another aircraft B for test. The malfunction part was discovered when the wrong ground bits data was found coming from the aircraft B.	Yes The wrong ground bits in DAPs could make ATM automation system display track decoupled with flight plan	
2.	Wrong aircraft identification	Many cases of wrong aircraft identification were found at the beginning of mode S operation. All related data collected and sent to the relevant airlines by the management department. Through joint investigation with the airlines, it was found that the issue is normally due to pilot's error.	Yes Wrong aircraft identification could lead to wrong flight plan coupling.	Through the joint efforts of ATMB and the airlines, the aircraft identification data became more and more accurate.
3.	Wrong Barometric Pressure	Barometric Pressure, such as BARO or QNH, is available in Mode S BDS code 4,0. Initial testing found that data above the transition level for some aircraft types would not be useful due to a mismatch between what the crew set in the cockpit, and what the aircraft Downlinked.	Yes There will display a wrong Barometric Pressure with aircraft in ATM automation system.	EASA Safety Information Bulletin SIB-2016-05R2 (“Incorrect Downlink Barometric Pressure Settings”) covers this issue.
4.	Different processing between Mode A/C and Mode S Altitude	Currently, the altitude accuracy of Mode A/C radar is 100ft, while that of Mode S radar is 25ft. The altitude tracking tracking, and display mechanism of ATM automation systems could be received both precisions altitude data.	Yes In Mode S radar and Mode Mode, A/C radar overlapped area, the ATM automation systems might display an altitude jumping.	The altitude tracking tracking, and display mechanism of ATM automation systems need to be optimized to avoid altitude jumping.

5.	Mode S interrogators request the aircraft transponder registers too frequently in busy airspace	If Mode S interrogators request the aircraft transponder registers too frequently in busy airspace, it may appear that the transponder registers information cannot complete the whole transmission process. The BDS parameters requesting rule needs to be set by the Mode S interrogator reasonably.	Yes ATM automation system would display track delay or intermittent interruption of radar data.	The data transmission rate of Mode S radar to feed ATM automation system needs to be selected reasonably to meet the requirements of ATC operations in busy airspace to prevent track delay or intermittent interruption of radar data.
6.	Mode S DAPs data does not correspond to the content of the requested register	<p>It has been noted that from time to time Mode S DAPs data does not correspond to the content of the requested register. For example, the content of BDS code 5,0 is received when extracting BDS code 4,0. This phenomenon is called “BDS swap”.</p> <p>Table 1 represents an example data of BDS swap. The table shows the data of BDS code 0,5/4,0/5,0 data downlink from an aircraft in three sequential scans. As can be seen by the table, BDS swap occurred at 08:05:45.</p>	Yes Wrong information could display to controller.	<p>Different options can be implemented to decrease the impact of such as:</p> <ol style="list-style-type: none"> 1. limit the number of radarradars extracting aircraft registers 2. implement specific filters in radar or in the surveillance data processing to discard the erroneous data (e.g. when two different registers are received with the same content they are both discarded)

7.	Duplicated aircraft address	<p>One case was related to a local airline, wrong spare parts of the airplane were installed by mistake during maintenance. The airline replaced the spare parts after being informed. Another case was military aircraft.</p> <p>Another reason has been observed that in many cases the 24-bit aircraft address transmitted by the aircraft does not match its nationality (i.e. its State of Registry's block) or is otherwise incorrectly configured in the transponder. Care needs to be taken to ensure that the registration and the 24-bit address of every aircraft are processed and assigned simultaneously by the regulatory authority, and reporting mechanisms are in place to rectify incorrect configurations.</p>	<p style="text-align: center;">Yes</p> <p>The possible consequences are as follows:</p> <ol style="list-style-type: none"> 1. An aircraft may be locked out in error, if it is the same beam. This may result in a new aircraft not being detected when it enters Mode S radar coverage. 2. Possible track label swap for crossing aircraft, this may result in incorrect labeling of an aircraft on the Radar screen. 3. In the technical operation of Mode S Elementary surveillance, duplicated address may result in the possible loss of a track when the two aircraft are crossing due to the interrogation scheduling within the ground station. 	<p>According to Annex 10, the aviation authority of each State is responsible for assigning 24-bit addresses to all aircraft in its registry using the block allocated by ICAO to that State.</p> <p>The duplicate address should be detected and reported.</p> <p>Without duplicate address detection, if an aircraft enters the range of the Mode S SSR with the same ICAO 24-bit address as that of an existing target, the information of the new aircraft could be erroneously associated with the existing target.</p> <p>Once the Mode S DAPs System detect more than one aircraft is transmitting the same ICAO 24-address, it will initiate a duplicate address report and a duplicate address condition shall be declared, and when receive new information of this address, the system should associate the information by ID or position but not the address.</p>
8.	incorrect aircraft address in flight plan	<p>Although the overwhelming majority aircrafts are equipped with Mode S transponders, many flight plans are not filed with the correct aircraft address in</p>	<p style="text-align: center;">Yes</p> <p>This affects the function of aircraft address correlation in ATM automation system.</p>	

		item 18.		
9.	incorrect wind speed and direction	Aircrew round the system output figures from Spot Wind data was the main reason for variations by crew response. e.g. Recorded wind 283/42kts, crew response 280/40kts.	No	

Table 1 Example Data of BDS Swap

BDS Register	Time of Scan		
	08:05:35	08:05:45 (BDS swap occurred)	08:05:55
BDS code 0,5	605f80c056966f	a3280030a40000	605f845303ce8d
BDS code 4,0	a3280030a40000	a3280030a40000	a3280030a40000
BDS code 5,0	fff8cf1f800489	a3280030a40000	ffb8cf1f80048a

APPENDIX 3: LIST OF PARTICIPANTS

Name	States/Administration	Name	States/Administration
Luo Yi	ICAO	Xie Yulan	China
Cao Susu	China	Guo Jianhua	China
Jin Lijie	China	Duan Bo	China
Zhang Kai	China	Wang Xiaowei	China
Chen Yang	China	Wang Yu	China
Zhou Shuiping	China	Tang Weisheng	China
Yao Yuan	China	Michael MH Chu	Hong Kong, China
Charles Leung Charn Wai	Hong Kong, China	Hiromi Miyazaki	Japan
Yasuhiro Otani	Japan	Ho Wee Sin	Singapore
Mei Chin NG	Singapore	Chin Lin KWEK	Singapore
Meng Soon KHOO	Singapore	Khairul Nazmi Bin Zainol Ariffin	Malaysia
Mohd Shahrul Azree Bin Remly	Malaysia	Shairyzal B. Mohammad C. Azizan	Malaysia
Alford Andy	New Zealand	Milns Alex	Australia

Left to blank

APPENDIX 4: A Brief Introduction of Mode S DAPs Data Source

1. Introduction

1.1 During the 2nd meeting of ICAO APAC Mode S DAPs WG, China presented an information paper regarding the Mode S DAPs data source, the meeting was of the view that the content of the paper will help in the understanding of the basic mechanism of avionics relevant to surveillance application and implementation of DAPs.

-Refer to Mode S DAPs WG/2 IP05 “Preliminary Study of DAPs Data Sources”

1.2 The Mode S DAPs provides useful ~~can reveal very detailed~~ information ~~onf the aircraft that and meanwhile describe immediate dynamic of the aircraft.~~ It will ~~enhance greatly benefit~~ ATM operations. ~~but research shows M~~more attention should be paid when introducing Mode S DAPs and it’s important to clearly understand what these parameters are ~~?~~ ~~A~~and where these parameters come from. ~~?~~ This text ~~provides tries to~~ give some brief information about ~~the parametersthat.~~

2. Mode S DAPs ELS and EHS

2.1 ~~Based on the usage of different parameter sets, T~~the Mode S DAPs-based surveillance includes ELS (Elementary Surveillance) and EHS (Enhanced Surveillance).

2.2 Most of the ELS parameters are capability parameters of the aircraft, hence are static. ~~T~~they can be used for ~~better tracking performance and~~ improved aircraft identification, and ~~hasve seems to have~~ less directly impact on ATC operations. The ELS parameters are shown in Table 2.1.

Table 2.1 ELS Parameters Information

	Register	DAP Set	Bits	Units	Quantity	Range
ELS		24-Bit Aircraft Address (AA)	NA	NA	NA	NA
		Transponder Capability (CA)	NA	NA	NA	NA
		Flight Status (FS)	NA	NA	NA	NA
		Altitude Reporting in 25ft	NA	ft	25	[-1000, 50175]
	BDS 1.0	Datalink Capability Report	56	NA	NA	NA
	BDS 1.7	Common GICB Capability Report	56	NA	NA	NA
	BDS 2.0	Aircraft Identification Report	56	NA	NA	NA
	BDS 3.0	ACAS Resolution Advisory Report	9-22	NA	NA	NA

2.3 ~~While the~~ EHS parameters are more ~~related to issues about~~ the aircraft’s intention and status, and most of them are dynamic. ~~T~~the implementation of EHS parameters ~~has a larger seems to have huge impacts~~ on controllers. The EHS parameters are shown in Table 2.2.

Table 2.2 EHS Parameters Information

	Register	DAP Set	Bits	Units	Quantity	Range
EHS		Selected Altitude (MCP/FCU)	2-13	ft	16	[0, 65520]
	BDS 4.0	Selected Altitude (FMS)	15-26	ft	16	[0, 65520]
		Barometric Pressure Setting	28-39	mb	0.1	[0, 410]

BDS 5.0	Roll Angle	3-11	dg	45/256	[-90, +90]
	True Track Angle	14-23	dg	90/512	[-180, +180]
	Ground Speed	25-34	kt	2	[0, 2046]
	Track Angle Rate	37-45	dg/s	8/256	[-16, +16]
	True Airspeed	47-56	kt	2	[0, 2046]
BDS 6.0	Magnetic Heading	3-12	dg	90/512	[-180, +180]
	Indicated Airspeed	14-23	kt	1	[0, 1023]
	Mach No	25-34	NA	2.048/512	[0, 4.092]
	Barometric Altitude Rate	37-45	ft/min	32	[-16384, +16352]
	Inertial Vertical Velocity	48-56	ft/min	32	[-16384, +16352]

3. Mode S DAPs Data System

3.1 The ELS and EHS parameters originate from various sensors and cockpit settings. After being organized by the avionics systems, the information is sent to the transponder through standard aircraft data buses, and subsequently formatted by the transponder and stored inside the relevant Binary Data Storages (BDS). The ground-based surveillance system could downlink desired DAPs by specific Mode S GICB (Ground Initiated Comm-B) protocol.

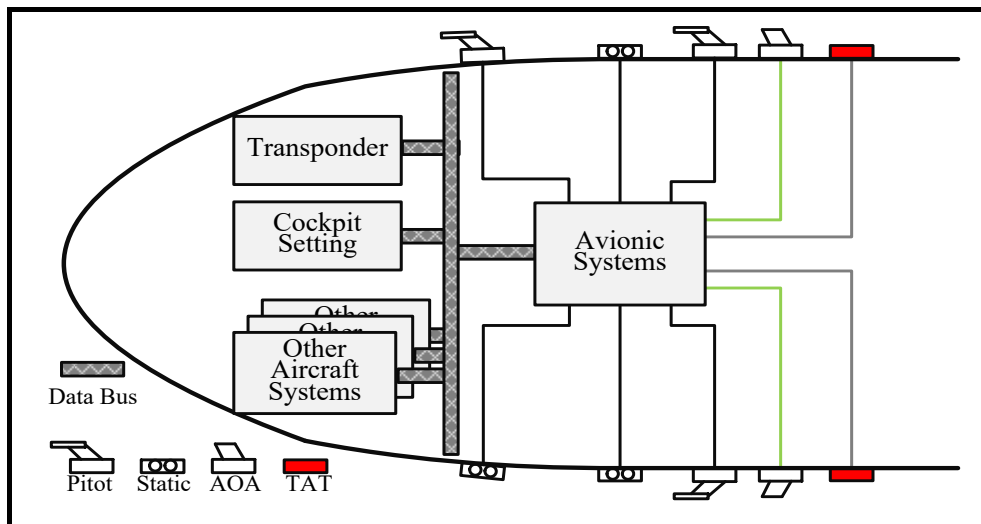


Figure 3.1 Typical DAPs Data Source Block Diagram

Transponder and TCAS Computer

3.2 The most common standard used transponder of the civil aircraft transponder, the Mark 4 Air Traffic Control Transponder, is based on defined by the ARINC 718A standard, which is the Mark 4 Air Traffic Control Transponder. There are 3 main interface plugs defined on the rear panel, namely the names are TP (Top Plug), MP (Middle Plug), and BP (Bottom Plug).

3.3 The airborne collision avoidance system, Traffic Computer TCAS and ADS-B Functionality, is based on defined by the ARINC 735B standard, which is the Traffic Computer TCAS and ADS-B Functionality. There are 6 main interface plugs defined on the rear panel, namely they are LTP (Left Top Plug), LMP (Left Middle Plug), LBP (Left Bottom Plug), RTP (Right Top Plug), RMP (Right Middle Plug) and RBP (Right Bottom Plug).

sensor fitted on the aircraft, but some GA planes use manual means to indicate the status by switching the transponder knob to the GND option. The [AA5] transponder receives on-the-ground status from the TP pins (5J and 5K), make validation of the status with Ground Speed, Radio Altitude or Airspeed, and then announce the status. The transponder capability level is a static value which is fixed after from the manufacturing.



Figure 3.4 TT31 Mode S Transponder from TRIG

3.7 The Flight Status (FS) is a result of combination of the on-the-ground status, SPI, and Alert. The on-the-ground is the same as in 3.64, the SPI is from pushing IDENT function button of the transponder by pilot, and the Alert is produced by changing Mode A code (If changed to 7500, 7600, 7700, that's permanent alert; and if changed to other codes, that's 18 seconds temporary alert).

3.8 The Common Usage GICB Capability Report is generated by the transponder itself by detecting the corresponding input data availability, and then set the corresponding bit related to that GICB register.

3.9 The main source of Aircraft Identification is from FMS, input by pilot through Flight ID (or Flight No) menu, and the related data transmitted to transponder by specific data bus (ARINC 429 Labels 233~237). If the Flight ID is empty, then the Aircraft Registration data may be provided within another data bus (ARINC 429 Labels 301-303).

3.10 According to TCAS standard (ARINC 735B Chapter 3.3.4.1), the Datalink Capability Report and the Resolution Advisories Report are sent to the Transponder from TCAS Computer by specific protocol (TGD-TCAS to Transponder data transfer protocol, and Transponder to TCAS data transfer protocol is named XGD. The data bus used is ARINC 429 Label 270). The data are sent from RMP of the TCAS Computer to TP of the Transponder, related pins refer to Figure 3.5.

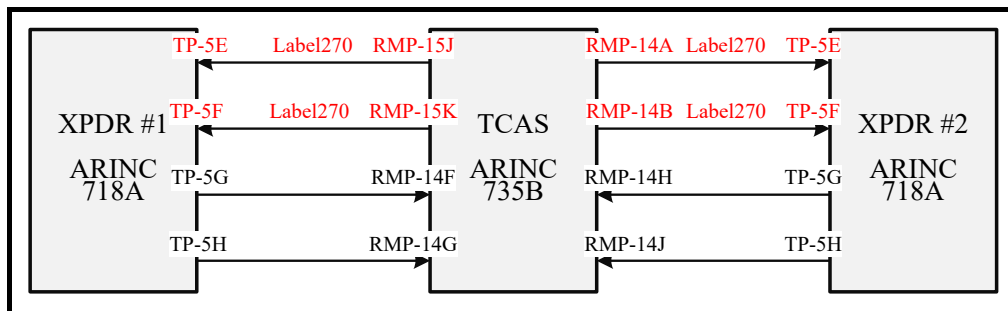


Figure 3.5 Illustrations of Datalink Capability and RA Report Transfer

3.11 There are 2 kinds of Selected Altitude, one is from MCP/FCU (Boeing’s Mode Control Panel) and FCU (Airbus’s Flight Control Unit), and the other is from FMS (Flight Management System). The first one is set by the pilot in response to a obeying controller’s [WSH(6)] instruction during the flight, the second one is calculated by the FMS automatically to achieve the best cost-efficient [AA7].



Figure 3.6 MCP of Boeing B787 & FCU of Airbus A380

3.12 The Barometric Pressure Setting (BPS) is also located in the MCP/FCU, and set by the pilot rotating the knob to the pressure value comes from the aerodrome’s ATIS (Automatic Terminal Information System).

3.13 The other parameters mainly come from the sensors onboard the aircraft, the sensors are organized in 3 groups, the air data sensors, the inertial sensors and the magnetic sensor.

3.14 The air data sensors are used to sense the medium through which the aircraft is flying, including pitot (static) probe, static port, temperature sensor, angle of attack sensor. Typical sensed parameters are total pressure (Pt), static pressure (Ps), pressure changing rate, air temperature (TAT), and angle of attack. Derived data includes Barometric Altitude (ALT), Indicated Airspeed (IAS), Vertical Speed (VS), Mach (M), Static Air Temperature (SAT), Total Air Temperature (TAT), True Airspeed (TAS) and Angle of Attack (AOA). The simplest system provides ALT and IAS.



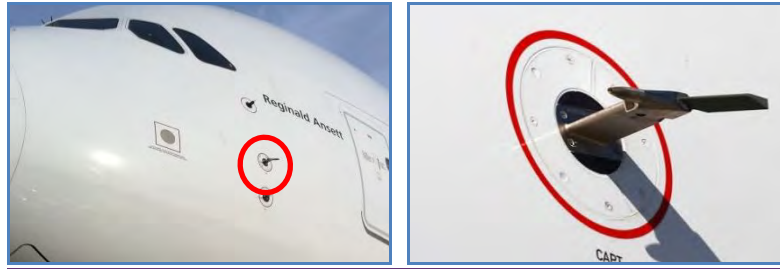


Figure 3.7 Air Data Sensors and Integrated Sensor on Airbus A380

3.15 The inertial sensors are used to detect the motion of the aircraft in a universal reference system, including position gyroscopes, rate gyroscopes and accelerometers. By detection of the 3D dynamic of the aircraft, derived data includes Ground Speed (GS), Wind Speed, Wind Direction, True Track Angle, Roll Angle, and Track Angle Rate and so on.

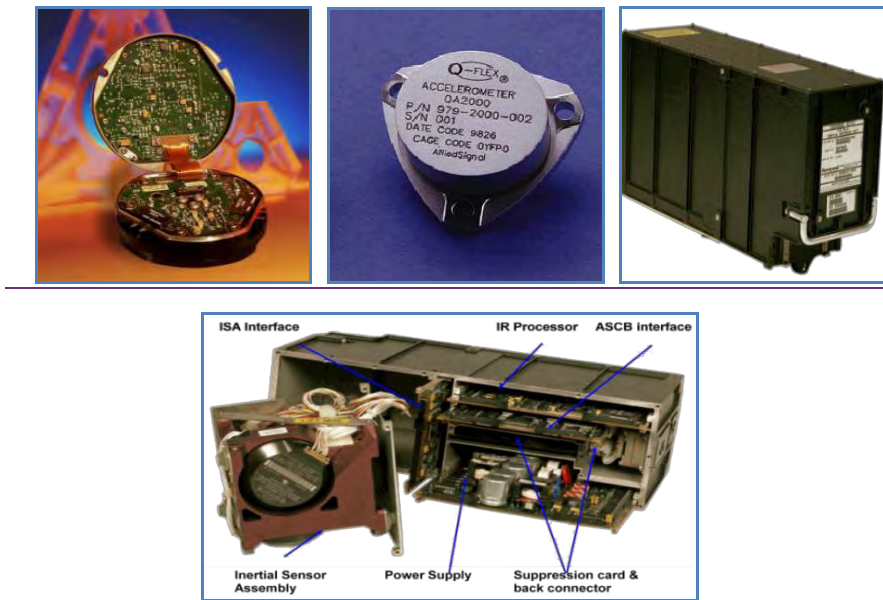


Figure 3.8 Gyro, Accelerometer and LASEREF IV IRU from Honeywell

3.16 The magnetic sensor is used to sense the direction and to find the magnetic north, and give out the main parameter of Magnetic Heading. The world magnetic model is show below:

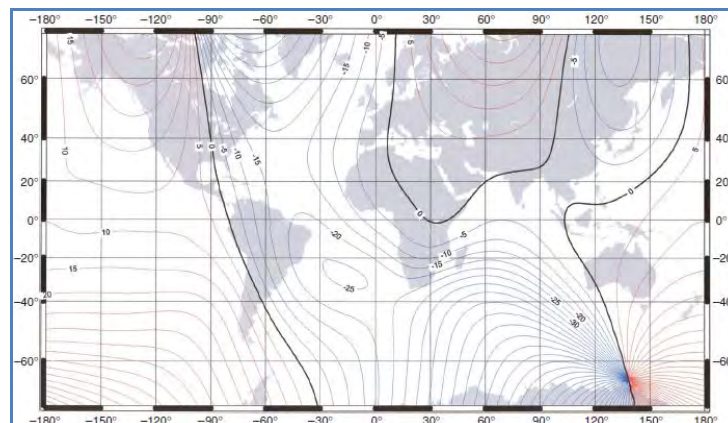


Figure 3.9 World Magnetic Model 2000

3.17 Some airplane platform uses an integrated solution to process these data, each air data sensor is connected with an Air Data Module (ADM) which converts the analog data to digital data and make the compensation of the instrumental and positional error. These data then feed to the input of Air Data Inertial Reference Systems (ADIRS) to calculate all the parameters mentioned before. And after that the parameters are sent to transponder and other avionics systems by the Data Bus.

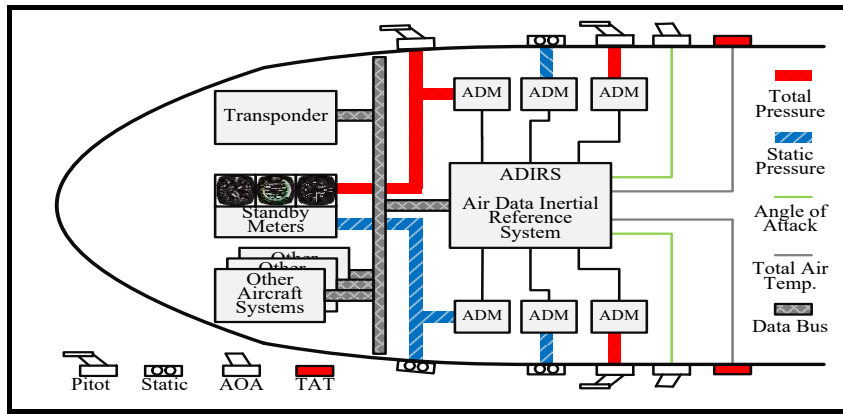


Figure 3.10 Typical ADIRS Architecture

3.18 The most commonly used data bus for parameters from ADIRS is ARINC 429 (and the newest evolution is AFDX invented by Airbus and implemented in various new aircrafts like A380 and B787), and the standard ARINC 429 Labels used by these parameters are as follows:

Table 3.1 ADIRS Parameters Used Labels of ARINC 429

<u>No</u>	<u>DAP Item</u>	<u>Label</u>
<u>1</u>	<u>Mach No.</u>	<u>205</u>
<u>2</u>	<u>Indicated Air Speed</u>	<u>206</u>
<u>3</u>	<u>True Air Speed</u>	<u>210</u>
<u>4</u>	<u>Barometric Altitude Rate</u>	<u>212</u>
<u>5</u>	<u>Ground Speed</u>	<u>312</u>
<u>6</u>	<u>True Track Angle</u>	<u>313</u>
<u>7</u>	<u>Magnetic Heading</u>	<u>320</u>
<u>8</u>	<u>Roll Angle</u>	<u>325</u>
<u>9</u>	<u>Track Angle Rate</u>	<u>335*</u>
<u>10</u>	<u>Inertial Vertical Velocity</u>	<u>365</u>

**Note: This label in GAMA configuration is not used for Track Angle Rate*

3.19 By using these parameters, the aircraft dynamic is illustrated as in Figure 3.11.

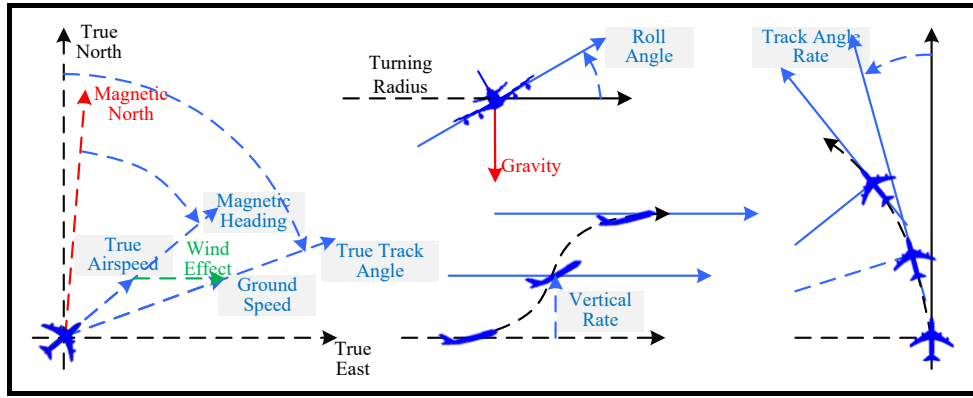


Figure 3.11 Illustration of Aircraft Dynamic

REVISED TERMS OF REFERENCE OF MODE S DAPS WORKING GROUP

Working Arrangement of the Mode S DAPS WG

Membership: The Mode S DAPS WG shall be composed of experts involved in technical and operation of surveillance services as well as operational experts. Member States of SURICG are encouraged to volunteer to form this Working Group. The working group shall normally invite representatives of International Organizations recognized by the ICAO Council and Industry Partners as required by the group which represent important civil aviation interests to participate in its work in a consultative capacity.

Meetings: The Mode S DAPS WG shall convene annually with at least one face-to-face meeting per year, and supplemented with WebEx meetings as required. The outcome of the meetings shall be reported to the SURICG.

Schedule and delivery: Subject to the extent of prioritized applications considered by the Mode S DAPS WG, the schedule for delivery of the working group shall be 3 years after initiation of the Mode S DAPS WG (28 March 2018). The delivery point(s) will be nominated by SURICG through discussion. The Mode S DAPS WG shall report to the APANPIRG via the SURICG.

Terms of Reference. See next section.

Term of Reference

The Objectives of Mode S DAPs Working Group are to:

- 1) Ensure harmonized implementation of Mode S DAPs in the Asia and Pacific Regions according to Surveillance Strategy adopted by APANPIRG;
- 2) Facilitate the implementation of Mode S DAPs application in the Asia and Pacific Regions using the project management principles where appropriate to maximize its benefit to region; and
- 3) Review, identify and address major issues in technical, operational and regulatory aspects to facilitate the Mode S DAPs implementation in the Asia and Pacific Regions.

Deliverables to meet the Objectives:

- 1) Progress report to be submitted to SURICG addressing the Mode S DAPs Working Group deliverables (listed in 2 to 7 below);
- 2) To study and identify applicable Mode S DAPs applications in the Asia and Pacific Regions considering:
 - Concept of use/operation;
 - Cost of system;
 - Requirement of surveillance systems (focusing on radar);
 - Matching functionality in ATC automation system;
 - Other currently available or emerging technologies;
 - ICAO Global Air Navigation Plan (GANP) and Aviation System Block Upgrades (ASBU); and
 - Evaluation method for Mode S DAPs performance.

- 3) To identify and develop the regional requirements of Mode S DAPs capability in the area of aircraft equipage, surveillance systems (focusing on radar) and ATC automation system, taking into account the relevant performance expectations of the Asia/Pacific Seamless ANS Plan;
- 4) To develop roadmap for Mode S DAPs application in the Asia and Pacific Regions taking into account of:
 - Available equipment standards;
 - Readiness of airspace users and ATS providers; and
 - Development of standardized and systematic approach to Mode S DAPs application.
- 5) To develop guidance materials to assist States and airspace users on the use of Mode S DAPs in the Asia and Pacific Regions;
- 6) To encourage research and development, trials and demonstrations in the field of Mode S DAPs application; and
- 7) Draft Conclusions and Decisions to be formulated relating to matters in the field of Mode S DAPS that come within the scope of the SURICG work plan.

[Note: Mode S DAPS Working Group will report to SURICG and SURICG will coordinate with CNS Sub-group.]

Current Members: The working group is currently comprised of representatives from Australia, Cambodia, China, Hong Kong China, India, Indonesia, Japan, Republic of Korea, Malaysia, Nepal, New Zealand, Philippines, Singapore, Sri Lanka, Thailand and Viet Nam, and is led by China and Singapore.

TERM OF REFERENCE

The Objectives of Mode S DAPs Working Group are to:		Efforts thus far
1	Ensure harmonized implementation of Mode S DAPs in the Asia and Pacific Regions according to Surveillance Strategy adopted by APANPIRG;	Discussed at this meeting.
2	Facilitate the implementation of Mode S DAPs application in the Asia and Pacific Regions using the project management principles where appropriate to maximize its benefit to region; and	High level principle is in the guidance material.
3	Review, identify and address major issues in technical, operational and regulatory aspects to facilitate the Mode S DAPs implementation in the Asia and Pacific Regions.	Issues are being discussed in the Working Group.
Deliverables to meet the Objectives:		
1	Progress report to be submitted to SURICG addressing the Mode S DAPs Working Group deliverables (listed in 2 to 7 below);	
2	To study and identify applicable Mode S DAPs applications in the Asia and Pacific Regions considering: <ul style="list-style-type: none"> - Concept of use/operation - Cost of system - Requirement of surveillance systems (focusing on radar) - Matching functionality in ATC automation system - Other currently available or emerging technologies; - ICAO Global Air Navigation Plan (GANP) and Aviation System Block Upgrades (ASBU); - Evaluation method for Mode S DAPs performance. 	Applications are being discussed in the Working Group.
3	To identify and develop the regional requirements of Mode S DAPs capability in the area of aircraft equipage, surveillance systems (focusing on radar) and ATC automation system, taking into account the relevant performance expectations of the Asia/Pacific Seamless ANS Plan;	Discussed at this meeting.
4	To develop roadmap with a view to formulate mandates for Mode S DAPs application in the Asia and Pacific Regions taking into account of: <ul style="list-style-type: none"> - Available equipment standards - Readiness of airspace users and ATS providers - Development of standardized and systematic approach to Mode S DAPs application; 	Discussed at this meeting.
5	To develop guidance materials to educate States and airspace users on the use of Mode S DAPs in the Asia and Pacific Regions:	Guidance material to educated States is adopted by SURICG/4. No guidance material for airspace users available yet.
6	To encourage research and development, trials and demonstrations in the field of Mode S DAPs application; and	Research and development activities are being shared in the Working Group.
7	Draft Conclusions and Decisions to be formulated relating to matters in the field of Mode S DAPS that come within the scope of the SURICG work plan.	Ongoing.

Third Meeting of Mode S Downlinked Aircraft Parameters Working Group (Mode S DAPs WG/3)
 Web-conference, 12 – 15 May 2020

Attachment 1 to the Report

LIST OF PARTICIPANTS

	STATE/NAME	TITLE/ORGANIZATION	TEL/FAX/E-MAIL
1.	AUSTRALIA		
	1. Mr. Jeffrey Bollard	Service and Asset Performance Advisor – Surveillance Airservices Australia P.O. Box 367 Canberra ACT, 2601 <u>AUSTRALIA</u>	Tel: +61 423 390 757 E-mail: jeffrey.bollard@airservicesaustralia.com
2.	CHINA (9)		
	2. Mrs. Susu Cao	Assistant of CNS Division CNS Division of Air Traffic Management Bureau of CAAC, Air Traffic Management Bureau (ATMB) No. 12, East Third Ring Road, Chaoyang District, Beijing <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 (10) 8778 6969 Fax: E-mail: caosusu@atmb.net.cn
	3. Mr. Bo Duan	Assistant of CNS Division CNS Division of Southwest Regional Air Traffic Management Bureau of CAAC Airport Nan'er Road, Shuangliu District Chengdu, Sichuan <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 (28) 8570 5473 Fax: E-mail: duanbo1985@yeah.net
	4. Mrs. Yulan Xie	Chief Engineer North China Regional Air Traffic Management Bureau of CAAC No. 11, Hang An Road, Chaoyang District Beijing <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 (10) 6459 3889 Fax: E-mail: xie_yulan@qq.com

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	5.	Mr. Xin Zhao	Engineer Technical Center of Air Traffic Management Bureau of CAAC, No. 301, Dongwei Road, Chaoyang District Beijing <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 (10) 8424 7240 Fax: E-mail: zhaox@atmb.net.cn
	6.	Mr. Weisheng Tang	Engineer Middle East China Regional Air Traffic Management Bureau of CAAC, No. 3, Nanyun East Street Airport Road, Baiyun District Guangzhou <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 189 2873 5510 Fax: E-mail: 11498132@qq.com
	7.	Mrs. Lijie Jin	Associate Research Fellow The Second Research Institute of CAAC No. 17, Second South Ring Road, Wuhou District Chengdu, Sichuan <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 (28) 8290 9987 Fax: E-mail: jinlijie@caacsri.com
	8.	Mr. Yu Wang	Deputy Director of Network Management Center Middle & South China Regional Air Traffic Management Bureau of CAAC No.3 nan-yun-dong-jie, Jichang Road Baiyun District, Guangzhou City Guangdong Province <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 (20) 8612 7170 Fax: E-mail: wangyu@atmb.org

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	9.	Mr. Yuan Yao	Middle South China Regional Air Traffic Management Bureau of CAAC No.: .3 Nanyun East Street, Airport Road Baiyun District Guangzhou, China <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: +86 159 205 19742 Fax: E-mail: yaoyuan@atmb.org
	10.	Mr. Yang Chen	Radar Engineer Southwest Regional Air Traffic Management Bureau of CAAC Airport Nan'er Rd, Shuangliu District Chengdu, Sichuan <u>CHINA (PEOPLE'S REPUBLIC OF)</u>	Tel: ++86 (28) 8570 4860 Fax: E-mail: 93411891@qq.com
3.	HONG KONG, CHINA			
	11.	Ms. Michelle SIU	Electronics Engineer Civil Aviation Department Hong Kong, China	Tel: Fax: E-mail: mmsiu@cad.gov.hk
	12.	Mr. Dennis WONG	Electronics Engineer Civil Aviation Department Hong Kong, China	Tel: Fax: E-mail: dwmwong@cad.gov.hk
4.	INDIA (2)			
	13.	Mr. Vinay Kumar	Senior Manager (CNS) Airports Authority of India Office of ED (CNS-OM) Rajiv Gandhi Bhawan, Safdarjung Airport New Delhi 110003 <u>INDIA</u>	Tel: +91 941 681 5918 Fax: E-mail: vinaykumar@aai.aero

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	14.	Mr. Sharad Chandra Dubey	Assistant General Manager (CNS) Airports Authority of India Office of ED (CNS-OM) Rajiv Gandhi Bhawan, Safdarjung Airport New Delhi 110003 <u>INDIA</u>	Tel: +91 885 161 3456, 964 661 5499 Fax: E-mail: scdubey@aai.aero
5.	INDONESIA (7)			
	15.	Mr. Arif Fajar Sidik	DGCA Inspector Gedung Perkantoran Bandara Soekano – Hatta, Jl. C3, Gengkarang Tangerang <u>INDONESIA</u>	Tel: +62 813 8932 3963 Fax: E-mail: rifsidik@gmail.com
	16.	Ms. Dwi Yuliansari	Air Navigation Inspector DGGGA Indonesia Medan Merdeka Barat Street No. 8, Jakarta 10110 <u>INDONESIA</u>	Tel: +62 813 1710 7971 Fax: E-mail: dwi.yuliansari@yahoo.com
	17.	Mrs. Emi Astuti	Air Navigation Inspector DGGGA Indonesia Medan Merdeka Barat Street No. 8, Jakarta 10110 <u>INDONESIA</u>	Tel: +62 8111 048085 Fax: E-mail: emiastuti.atc6@gmail.com
	18.	Mr. M. Riza Semaryan Lubis	Air Navigation Inspector DGGGA Indonesia Ministry of Transportation, Jl. Medan Merdeka Barat No. 8, Jakarta <u>INDONESIA</u>	Tel: +62 85281 113 113 Fax: E-mail: mrizaslubis@gmail.com

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	19.	Mr. Yung Bramana Putra	DGCA Inspector Gedung Perkantoran Bandara Soekano – Hatta, Jl. C3, Gengkarang Tangerang <u>INDONESIA</u>	Tel: +62 812 1098 9198 Fax: E-mail: ybputra@gmail.com
	20.	Mr. Setio Anggoro	VP Air Navigation Service Planning AirNav Indonesia Ir. H. Juanda Road #1 Tangerang Banten 15117 <u>INDONESIA</u>	Tel: +62 813 5506 9001 Fax: E-mail: setio@airnavindonesia.co.id
	21.	Mr. Justinus Aries Pancoro.	ATS System Junior Manager AirNav Indonesia Ir. H. Juanda Road #1 Tangerang Banten 15117 <u>INDONESIA</u>	Tel: +62 812 386 5600 Fax: E-mail: justinus2208@gmail.com
6.	JAPAN (1)			
	22.	Mr. Hiromi Miyazaki	Principal Researcher Electronics Navigation Research Institute 7-24-23 Jindaiji-higashi Chofu, Tokyo 151-0051 <u>JAPAN</u>	Tel: +81 422 413 179 Fax: E-mail: hiro@mpat.go.jp
7.	MALAYSIA (4)			
	23.	Mr. Khairul Nazmi Bin Zainol Ariffin	Senior Assistant Director Civil Aviation Authority of Malaysia No. 27 Persiaran Perdana, Precint 4 Level 1, Podium Block B, 62618, Putrajaya <u>MALAYSIA</u>	Tel: +603 8871 4039 Fax: E-mail: k.nazmi@caam.gov.my

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	24.	Mr. Mohd Shahrul Azree Bin Remly	Assistant Director Civil Aviation Authority of Malaysia No. 27 Persiaran Perdana, Precint 4 Level 1, Podium Block B, 62618, Putrajaya <u>MALAYSIA</u>	Tel: +603 8871 4045 Fax: E-mail: shahrulazree@caam.gov.my
	25.	Mr. Shairyzal B. Mohamad C. Azizan	Engineer Advanced Air Traffic System 8, Jalan Pengacara U1/48, Temasya Industrial Park 40150 Shah Alam, Selangor <u>MALAYSIA</u>	Tel: +603 5569 1515 Fax: E-mail: shairyzal@aat.my
	26.	Dr. Istas Fahrurrazi B. Nusyirwan	University Technology Malaysia Faculty of Mechanical Engineering University Technology Malaysia 81310 Utm Skudai, Jahor <u>MALAYSIA</u>	Tel: +601 3744 23210 Fax: E-mail: istaz@utm.my
8.	NEPAL (4)			
	27.	Mr. Sanjeev Singh Kathayat	Dy. Director, ANSSD	Tel: Fax: E-mail: kathayat@hotmail.com
	28.	Mr. Lekh Nath Subedi	Manager	Tel: Fax: E-mail: subedilekh@yahoo.com
	29.	Mr. Hemant Yadav	Dy. Manager, TIACAO	Tel: Fax: E-mail: remhemanta@outlook.com

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	30.	Mr. Samrat Pradhan	Senior Officer, Airworthiness Inspection Division	Tel: Fax: E-mail: samrat.pradhan@caanepal.gov.np
9.	PHILIPPINES (3)			
	31.	Mr. Rodrigo E. Maglahus	ATMO/Cluster Head, Mactan Davao APP Air Traffic Service Civil Aviation Authority of the Philippines ATMC Building, Naia Road Pasay City 1300 <u>PHILIPPINES</u>	Tel: Fax: E-mail: rod_maglahus@yahoo.com
	32.	Mr. Davey Arce Jamera	CNSSO-II Air Traffic Service Management Center Old Mia Road, Pasay City 1300 <u>PHILIPPINES</u>	Tel: +63 8672 7729 Fax: E-mail: jamfox30@gmail.com
	33.	Mr. Ariel J. Carabeo	Facility Chief, Manila ACC Civil Aviation Authority of the Philippines Manila ACC, Philippines ATM Center CAPP Compound, Naia Road Pasay City <u>PHILIPPINES</u>	Tel: Fax: E-mail: arielcarabeo@yahoo.com
10.	REPUBLIC OF KOREA (4)			
	34.	Mr. Jang Kyung Joom	Assistant Director Ministry of Land, Infrastructure and Transport (MoLIT) # 11, Doom-ro6 Sejung Special Governing City <u>REPUBLIC OF KOREA</u>	Tel: +82 10 2696 0609 Fax: E-mail: skyjjan@korea.kr

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	35.	Ms. Jeong Mi Jin	Assistant Manager Ministry of Land, Infrastructure and Transport (MoLIT) # 11, Doom-ro6 Sejung Special-governing City, 30103 <u>REPUBLIC OF KOREA</u>	Tel: +82 44 201 4364 Fax: E-mail: mj.jeong@korea.kr
	36.	Mr. Pak Seong Joon	Engineer Incheon International Airport 424-47, Gonghang-Gil, Jung-Gu, Incheon <u>REPUBLIC OF KOREA</u>	Tel: +82 (32) 10 4422 0015 Fax: E-mail: riniusia@naver.com
	37.	Mr. Cho Jin Hyung	Manager of Radar Control Department Korea Airports Corporation 150, Deoksuehon 2- ro Deog Yang-gu Goyang-si, Gyeonggi-do <u>REPUBLIC OF KOREA</u>	Tel: +82 (10) 6968 0031 Fax: E-mail: jhandhj7@airport.co.kr
11.	SINGAPORE (4)			
	38.	Mr. Ho Wee Sin	Deputy Director (Technical Standards and Support) Civil Aviation Authority of Singapore Singapore Changi Airport P.O. Box 1 <u>SINGAPORE</u> 918141	Tel: +65 6595 6061 Fax: +65 6542 2447 E-mail: ho_wee_sin@caas.gov.sg
	39.	Ms. Ng Mei Chin	Head (Surveillance Projects) Civil Aviation Authority of Singapore Singapore Changi Airport P.O. Box 1 <u>SINGAPORE</u> 918142	Tel: +65 6541 2402 Fax: +65 6542 2447 E-mail: ng_mei_chin@caas.gov.sg

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	40.	Mr. Aloysius Ang Cheng How	Air Traffic Control Manager (Systems Planning) Civil Aviation Authority of Singapore Singapore Changi Airport P.O. Box 1 <u>SINGAPORE</u> 918143	Tel: +65 6422 7669 Fax: +65 6441 0221 E-mail: aloysius_ang@caas.gov.sg
	41.	Mr. Khoo Meng Soon	Engineer (Surveillance Systems) Civil Aviation Authority of Singapore Singapore Changi Airport P.O. Box 1 <u>SINGAPORE</u> 918144	Tel: +65 6595 6076 Fax: +65 6542 2447 E-mail: khoo_meng_soon@caas.gov.sg
12.	SRI LANKA (7)			
	42.	Mr. M A K Prasanna	Director Air Navigation Services Civil Aviation Authority of Sri Lanka No.:152/1 Minuwangoda Road (Opposite Radar Tower) Katunayake <u>SRI LANKA</u>	Tel: +94 (11) 235 8849 Fax: E-mail: dans@caa.lk
	43.	Mrs. Thilini Herath	Senior Civil Aviation Inspector (ATM Standards & Procedures) Civil Aviation Authority of Sri Lanka No. 152/1, Minuwangoda Road (Opposite Radar Tower) Katunayake <u>SRI LANKA</u>	Tel: +94 (11) 235 8853 Fax: E-mail: scaiatmsp@caa.lk
	44.	Mr. Ranawakaarachchige Ananda Perera	Senior Civil Aviation Inspector (ATM Technical) Civil Aviation Authority of Sri Lanka No. 152/1, Minuwangoda Road (Opposite Radar Tower) Katunayake <u>SRI LANKA</u>	Tel: +94 (11) 23588 Fax: E-mail: scaiatmtech@caa.lk

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	45.	Mr. Sumith Janapriya Tennakoon	Senior Manager Air Traffic Control Area Control Centre Colombo Airport, Ratmalana <u>SRI LANKA</u>	Tel: +941 262 5555 Fax: E-mail: sumithatc.ans@airport.lk
	46.	Mr. Asanga Senarath Bandara	Airport & Aviation Services (Sri Lanka) Ltd. E & ANE-BIA Section Navigation Service Complex Katunayake <u>SRI LANKA</u>	Tel: +94 86 824 2654 Fax: E-mail: asanga.eane@airport.lk
	47.	Mr. Chamara Madhusanka Liyanage	Senior Electronics Engineer Airport & Aviation Services (Sri Lanka) Ltd. Bandaranaike International Airport Katunayake <u>SRI LANKA</u>	Tel: +94 76 6677 7800 Fax: E-mail: chamara.eane@airport.lk
	48.	Mr. R.M.J. Bhatiya Ratnayake	Manager (Air Traffic Control) Airport & Aviation Services (Sri Lanka) Ltd. Approach Control Centre Air Navigation Services Division Bandaranaike International Airport, Katunayake <u>SRI LANKA</u>	Tel: +947 6667 7863 Fax: E-mail: jbratc@gmail.com
13.	THAILAND (10)			
	49.	Mr. Krisanapon Paisal	Air Navigation Services Standards Officer Civil Aviation Authority of Thailand 333/105 Lak Si Plaza Khamphaeng Phet 6 Road Talat Bang Khen, Lak Si Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 568 8800 Fax: E-mail: krisanapon.p@caat.or.th

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	50.	Mr. Takdanai Wuthisen	Air Navigation Services Standards Officer Civil Aviation Authority of Thailand 333/105 Lak Si Plaza Khamphaeng Phet 6 Road Talat Bang Khen, Lak Si Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 568 8825 Fax: E-mail: takdanai.w@caat.or.th
	51.	Mr. Jitanan Tipyasak	Air Navigation Services Standards Officer Civil Aviation Authority of Thailand 333/105 Lak Si Plaza Khamphaeng Phet 6 Road Talat Bang Khen, Lak Si Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 568 8825 Fax: E-mail: Jitanan.t@caat.or.th
	52.	Mr. Chanyut Phrukumwong	Director, Air Traffic Services Engineering Research and Development Department Aeronautical Radio of Thailand Ltd. 102 Ngamduplee, Rama IV Tungmahamek, Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 287 8591 Fax: E-mail: chanyut.ph@aerothai.co.th
	53.	Mr. Sutham Sujarittammakun	Executive Air Traffic Systems Engineer Aeronautical Radio of Thailand Ltd. 102 Ngamduplee, Rama IV Tungmahamek, Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 287 8076 Fax: E-mail: sutham.su@aerothai.co.th
	54.	Mr. Rapeepat Phraprasert	Air Traffic Systems Engineer Aeronautical Radio of Thailand Ltd. 102 Ngamduplee, Rama IV Tungmahamek, Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 287 8522 Fax: E-mail: rapeepat.ph@aerothai.co.th

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	55.	Mr. Nontawat Limprasert	Air Traffic Engineering Manager Aeronautical Radio of Thailand Ltd. 102 Ngamduplee, Rama IV Tungmahamek, Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 285 9146 Fax: E-mail: nontawat.li@aerothai.co.th
	56.	Mr. Pattharasit Phankrawee	Air Traffic Engineering Manager Aeronautical Radio of Thailand Ltd. 102 Ngamduplee, Rama IV Tungmahamek, Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 287 8270 Fax: E-mail: pattharasit.ph@aerothai.co.th
	57.	Mr. Ronnachit Apichatmetee	Air Traffic Engineering Manager Aeronautical Radio of Thailand Ltd. 102 Ngamduplee, Rama IV Tungmahamek, Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 285 9139 Fax: E-mail: ronnachit.ap@aerothai.co.th
	58.	CPO1 Chaichana Kujareanpaisal	Air Traffic Engineering Manager Aeronautical Radio of Thailand Ltd. 102 Ngamduplee, Rama IV Tungmahamek, Bangkok 10120 <u>THAILAND</u>	Tel: +66 (2) 287 8259 Fax: E-mail: chaichana.ku@aerothai.co.th
14.	USA (2)			
	59.	Mr. Michael Watkins	Senior Air Traffic Representative, Asia Pacific Federal Aviation Administration Air Traffic Organization, System Operations American Embassy, Singapore, 27 Napier Road <u>SINGAPORE</u> INTEL 258508	Tel: +65 6476 9462 Fax: E-mail: michael.w.watkins@faa.gov

	STATE/NAME		TITLE/ORGANIZATION	TEL/FAX/E-MAIL
	60.	Mr. Alejandro Rodriguez	General Engineer Federal Aviation Administration (FAA) 800 Independence Avenue, SW Washington D.C. 20591 <u>USA</u>	Tel: +1 (322) 3874 Fax: E-mail: Alejandro.Rodriguez@faa.gov
15.	IFALPA (1)			
	61.	Captain Shavantha Pedris	RVP Asia/West International Federation of Air Line Pilots' Associations (IFALPA)	Tel: Fax: E-mail: shavantha.pedris@gmail.com
16.	ICAO (3)			
	62.	Ms. Muna Alnadaf (as observer)	Regional Officer CNS International Civil Aviation Organization Middle East Office	Tel: Fax: E-mail: malnadaf@icao.int
	63.	Mr. Luo Yi	Regional Officer CNS International Civil Aviation Organization Asia and Pacific Office 252/1, Vibhavadi Rangsit Road Ladyao, Chatuchak Bangkok 10900 <u>THAILAND</u>	Tel: +66 (2) 537 8189 ext. 155 Fax: +66 (2) 537 8199 E-mail: yluo@icao.int
	64.	Ms. Bhabhinan Sirapongkosit	Programme Assistant (CNS/MET/ENV) International Civil Aviation Organization Asia and Pacific Office 252/1, Vibhavadi Rangsit Road Ladyao, Chatuchak Bangkok 10900 <u>THAILAND</u>	Tel: +66 (2) 537 8189 ext. 47 Fax: +66 (2) 537 8199 E-mail: bsirapongkosit@icao.int

**Third Meeting of Mode S Downlinked Aircraft Parameters Working Group
(Mode S DAPs WG/3)**

Web-conference, 12 – 15 May 2020

Attachment 2 to the Report

LIST OF WORKING/INFORMATION PAPERS

WP/IP No.	Agenda	Subject	Presented by
WORKING PAPERS			
WP/1	1	Provisional Agenda	Secretariat
WP/2	2	Outcomes of Relevant Meetings on Surveillance	Secretariat
WP/3	8	Review of Terms of Reference	China, Singapore and Secretariat
WP/4	7	Amendments to the Guidance Material for Mandates	Singapore
WP/5	6	Guidance Material for Assignment of Interrogator Codes (IC) for MLAT and ADS-B	China, Malaysia and Singapore
WP/6	6	Mode S Roadmap	Singapore
WP/7	5	Review of Action Items	Secretariat
WP/8	7	Updates to the Mode s DAPS Implementation and Operation Guidance Document	China, New Zealand and Singapore
INFORMATION PAPERS			
IP/1	-	Meeting Bulletin	Secretariat
IP/2	4	1090 MHz Spectrum and 24-bit Aircraft Address Issues with UAS	Secretariat
IP/3	3	Mode D DAPs Implementation in China	China
IP/4	8	Allocation of 24-bit Aircraft Addresses	Singapore
IP/5	6	II/SI Operations	Singapore
IP/6	3	Mode S Radar Parameter Set and DAPs Extraction Strategy	China
IP/7	3	A Method of Mode-S Radar Roll-Call Scheduling Management	China
IP/8	4	Aircraft Parameters Availability in Mode S DAPs and ADS-B Add	China
IP/9	4	Experience in SSR Mode S Mix Mode Operation	Republic of Korea
IP/10	4	Empty RA Message Handling at ATM System	Republic of Korea
IP/11	3	Utilization of Mode-s DAPs Data for Weather Forecast	Japan (ENRI)