



International Civil Aviation Organization

MIDANPIRG Communication, Navigation and Surveillance Sub-Group

Eleventh Meeting (CNS SG/11)
(Muscat, Oman, 16-19 May 2022)

Agenda Item 4: CNS planning and implementation in the MID Region

**OMAN EXPERIENCE ON OLDI IMPLEMENTATION WITH UAE AND
AIDC TESTING WITH INDIA**

(Presented by Sultanate of Oman)

SUMMARY

This working paper is to share the implementations and gained experience over ATC operation in matters of Safety, workload and Flow management of Online Data Interchange (OLDI) with UAE and AIDC testing with India.

Action by the meeting is at paragraph 3.

REFERENCES

- GANP ASBU Threads
- PANS-ATM, Doc 4444
- MID Doc 006 *Mid Region Guidance for The Implementation of AIDC/OLDI.*

1. INTRODUCTION

1.1 ASBU Module FICE in Block 0 is introduced to improve coordination between air traffic service units (ATSUs) by using ATS inter-facility data communication (AIDC). The transfer of communication in a data link environment improves the efficiency of this process. The data link environment enhances capacity, efficiency, interoperability, safety and reduces cost.

1.2 Intended Performance Operational Improvement

1.3 Metrics to determine the success of the module are proposed in the *Manual on Global Performance of the Air Navigation System* (Doc 9883).

<i>Capacity</i>	Reduced controller workload and increased data integrity supporting reduced separations translating directly to cross sector or boundary capacity flow increases.
<i>Efficiency</i>	The reduced separation can also be used to more frequently offer aircraft flight levels closer to the flight optimum; in certain cases, this also translates into reduced en-route holding.

<i>Global interoperability</i>	Seamlessness: the use of standardized interfaces reduces the cost of development, allows air traffic controllers to apply the same procedures at the boundaries of all participating centers and border crossing becomes more transparent to flights.
<i>Safety</i>	Better knowledge of more accurate flight plan information.
<i>Cost Benefit Analysis</i>	Increase of throughput at ATS unit boundary and reduced ATCO workload will outweigh the cost of FDPS software changes. The business case is dependent on the environment.

1.4 The meeting may wish to recall the analysis carried out during the MID Region ATN-IPS WG5 meeting *Cairo, Egypt, 11-13 March 2013* it was noted that the majority of States in the MID Region have either implemented OLDI or are planning to implement OLDI and have no intention of using only AIDC. Therefore, the meeting agreed that OLDI implementation should be considered and accepted as regional variation of AIDC implementation as was the case in the European Region.

1.5 The MID Region ATN-IPS WG5 meeting further agreed that if both AIDC and OLDI are implemented, then it will be a bilateral issue and some States that are interfacing with adjacent Regions may require to support and implement dual capabilities (AIDC and OLDI).

1.6 The MID Region is monitoring the work of the joint taskforce harmonization of AIDC and OLDI in NAT and ASIA PAC as it is important to harmonize AIDC and OLDI in order that States in the interface areas have smooth operations.

2. DISCUSSION

2.1 Sultanate of Oman being an MID state that interfaces with the ASIA/PAC region. It had to opt to implement both OLDI within the MID region and AIDC with the ASIA/PAC interface states.

OLDI/AIDC implementation status in Oman			
State	OLDI	AIDC	Status
UAE	*		Implemented 2018
India		*	Testing Stage
Saudi Arabia	*		Planning and initial discussion Started Dec 2021
Iran	*		Pending
Pakistan		*	Pending
Yemen	TBD		Pending

Coordination statistics		
ATSU	Number of COPs	% of traffic coordinated
UAE	14	72%
India	7	67%
Saudi Arabia	6	23%
Iran	3	22%
Pakistan	3	24%
Yemen	5	21%

2.2 Initial technical challenges and operational constrains were faced during the OLDI testing with UAE as summarised in the main points below:

- No prior experience with OLDI.
- System compatibility issues.
- OLDI version compatibility.
- Developing Concept of operation.
- Training ATCOs and ATCAs.

Note: As UAE had previous experience with OLDI within the UAE ATSU's they shared their experience and knowledge that contributed to overcome the challenges faced.

2.3 The benefits realised by the implementation of OLDI between OOMS and OMAE:

- Operational accuracy and efficiency was realised, less coordination failure.
- Workload reduced among Controller and assistant on both sides.
- Reduced Verbal communication/coordination. Kept as a backup solution.
- Cost reduction.

2.4 As the sultanate of Oman is an interface state with ASIA/PAC region and had a system that is able to support both OLDI and AIDC. Agreement with Mumbai was achieved in Q2 2020 to initiate the initial testing of the service following the steps listed:

- Initial test was performed with India by using AFTN gateway to exchange coordination Messages.
- Basic messages were tested (ABI, EST, LAM and LRM)
- Oman Faced the same difficulty that faced with OLDI due to:
 - o No prior experience with AIDC.
 - o System issues
 - Processing of messages in the ATM system.
 - Processing of messages in the AFTN/AMHS Exchange system.
 - Messages format.

The details test procedures and results is at **Appendix A**.

2.5 Although testing is still ongoing with VABB, it might be wise to reconsider the implementation of two different data interchange protocols due to:

- System compatibility issues.
- High possibility confusion due to different concept of operation.
- Media dependencies (Point to Point vs AFTN/AMHS network).
- Different LoA agreements specially on the systems requirements with different States.

2.6 Consider the following Draft Conclusion:

DRAFT CONCLUSION 11/X: IN FLIGHT

That, for interfacing States with two or more data interchange connections, a common data interchange protocol shall be agreed on prior to investment on systems upgrades. Agreements shall address:

- 1. Data interchange protocol;*
- 2. Data interchange version; and*
- 3. Data interchange CONOPS.*

3. ACTION BY THE MEETING

3.1 The meeting is invited to:

- a) note the contents of this paper in particular the benefits brought by OLDI;
- b) amend Doc 006, for MID region to consider only OLDI as the main data interchange protocol; and
- c) consider Draft Conclusion in paragraph 2.6 .



APPENDIX A

Muscat-Mumbai AIDC Summary Test Report:

1. Introduction:

The AIDC application supports information exchanges between ATC application processes within automated ATS systems located at different ATSUs. This application supports the Notification, Coordination, and the Transfer of Communications and Control functions between these ATSUs.

In the interest of global standardisation, ICAO agreed methods and messages are used wherever possible. Where ICAO methods and messages do not meet requirements, new messages were identified using existing ICAO field definitions to the extent possible.

2. Testing:

2.1. Purpose:

The purpose of the AIDC Test is to validate the link between Muscat and Mumbai that will lead to automation of exchanging flight information.

2.2. Status:

Current status of exchanging flight information between Muscat and Mumbai is through verbal coordination.

2.3. Proposal:

On successful completion of the tests and subject to management approval, the flight data messages will be exchanged automatically between Muscat and Mumbai ATM systems through AIDC.

2.4. Testing Date and Duration:

The test was conducted on 22/03/2021 from 0530 to 0730 UTC.

2.5. Types of Messages exchanged:

Message Type	Description
ABI	Advance Boundary Information
EST	Coordination Estimate
MAC	Cancelation of Notification and/or Coordination
ACP	Acceptance
LAM	Logical acknowledgment
LRM	Logical rejection

2.6. Coordination Fix points:

- RASKI, PARAR, TOTOX, REXOD, LOTAV, KITAL, ASPUX.


2.7. Numbers of Messages Exchanged:

- 226 AIDC messages exchanged between Muscat and Mumbai.

Type of Messages	Number Of Messages Sent		Total Per Type
	OOMM	VABB	
ABI	35	26	61
EST	13	17	30
MAC	0	4	4
ACP	13	5	18
LAM	32	18	50
LRM	20	43	63
Sum Total	113	113	226

2.8. Numbers of Messages Processed and Rejected:

ATSU	Messages Received	Processed	Rejected
OOMM	52	32 (61.5%)	20 (38.5%)
VABB	61	18 (29.5%)	43 (70.5%)
Total	113	50 (44%)	63 (56%)

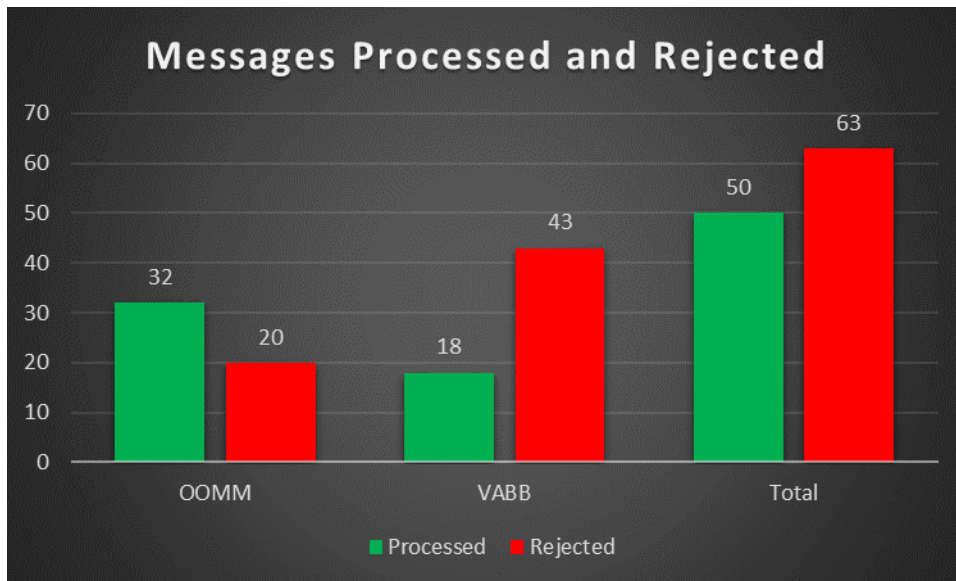

ATSU	Status	Message Type			
		ABI	EST	MAC	ACP
OOMM	Processed	15	13	4	0
	Rejected	11	5	0	5
VABB	Processed	0	5	0	13
	Rejected	35	8	0	0

2.9. Error Codes:

- 63 Errors were generated.

	Code 06	Code 07	Code 15	Code 41	Code 57	Code 65
OOMM	3	3	11	11	1	4
VABB	8	8	0	0	35	0
TOTAL	11	11	11	11	36	4

2.10. Error Code Description:

Error Code	Description
Code 06	Invalid Aircraft Call-sign (ACID)
Code 07	Duplicate ACID
Code 15	Invalid Equipment Designator
Code 41	Invalid ATS Route/Significant Point Designator
Code 57	Invalid Message
Code 65	Message Sequence Error

2.11. Observations During Test:

- AIDC messages from Mumbai to Muscat:
 - Muscat ATM system was able to process majority of the AIDC messages received from Mumbai.
 - Muscat ATM system was processing all real flight plans including the messages that contain "T element".
 - Muscat ATM system was rejecting any flight plans with T element that was created Manually by Mumbai.
 - Received LAM and LRM messages does not reflect on the SDD.

- AIDC messages from Muscat to Mumbai:
 - Mumbai system was rejecting majority of AIDC messages from Muscat.
 - Mumbai system rejected all ABI messages.
 - Within the ABI message, a gap in the aircraft speed element triggered a rejection. *E.g. (ABI-TEST1/A4012-OMDB-RASKI/0604F350-VABB-8/IS-9/B738/M-10/S/C-15/N04 81F350 VAXIM L301 RASKI L301 ANKOX-18/DOF/210322)*

2.12. Exchanged Messages Comparison:

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
1	<p>FF VABBAIDC 220531 OOMMAIDC 2.003571- 3.VABB000014-4.210322053125- 5.CF71- (LAM)</p>	<p>FF OOMMAIDC 220531 VABBAIDC 2.000014- 4.210322053123-5.405F- (ABI-IGO1757/A0652-VOCI- TOTOX/0621F380-OKBK -8/IN -9/A20N/M -10/SDE1FGHIRWYZ/LB1 -15/N0449F380 BOLIS P574 TOTOX L555 TUMET T -18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIJH EET/VABF0058 OOMM0241 OMAE0344 OBBS0413 OKAC0501 SEL/CDFJ CODE/800D9C PER/C RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 BAHRAIN AT P 20 10 ON 000469 REPATRIATION FLIGHT RT DESIGNATOR IFLY)</p>	<p>FF OOMMAIDC 220531 VABBAIDC 2.000014-4.210322053123-5.405F- (ABI-IGO1757/A0652-VOCI- TOTOX/0621F380-OKBK -8/IN - 9/A20N/M -10/SDE1FGHIRWYZ/LB1 - 15/N0449F380 BOLIS P574 TOTOX L555 TUMET T - 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIJH EET/VABF0058 OOMM0241 OMAE0344 OBBS0413 OKAC0501 SEL/CDFJ CODE/800D9C PER/C RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 BAHRAIN AT P 20 10 ON 000469 REPATRIATION FLIGHT RT DESIGNATOR IFLY)</p>	<p>FF VABBAIDC 220531 OOMMAIDC 2.003571-3.VABB000014- 4.210322053125-5.CF71- (LAM)</p>	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
2	FF VABBAIDC 220531 OOMMAIDC 2.003572- 4.210322053132-5.61F8- (LRM-RMK/57)	FF OOMMAIDC 220531 VABBAIDC 2.000000- 4.210322053130-5.2253- (EST-QTR8359/A0627-VOMM- REXOD/0530F400-OTHH)	FF OOMMAIDC 220531 VABBAIDC 2.000000-4.210322053130-5.2253- (EST-QTR8359/A0627-VOMM- REXOD/0530F400-OTHH)	FF VABBAIDC 220531 OOMMAIDC 2.003572-4.210322053132-5.61F8- (LRM-RMK/57)	Rejected Error code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
3	<p>FF VABBAIDC 220532 OOMMAIDC 2.003573- 3.VABB000015- 4.210322053244- 5.CF71- (LAM)</p>	<p>FF OOMMAIDC 220532 VABBAIDC 2.000015-4.210322053242- 5.753F- (ABI-FDX7-FAOR-KITAL/0623A100-OMDB -8/IS -9/B77L/H - 10/SDE1E2E3FGHIJ1J2J3J4J5M1P1P2P3RWXYZ/LB1D1 -15/N0494F350 RIGLO L516 KITAL T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNVD1E2A1 DAT/1FANSE2PDC SUR/RSP180 RSP400 260B DOF/210321 REG/N858FD EET/FQBE0030 FMMM0222 FSSS0255 VABF0608 OOMM0745 OMAE0836 SEL/LPJK CODE/ABC591 OPR/FDX RMK/GCAPFDX0122 CARGO TCAS EQUIPPED DISPATCHER TEL NO 9013971796 MOZAMBIQUE 0493A 2020 MADAGASCAR OF 0498 20 ACM DGE SGE CV CRT SEYCHELLES CA M2 726 2020 INDIA 7 98B 2019 IR DATED 23OCT2020 OMAN DAT OF FDX 0035 2020)</p>	<p>FF OOMMAIDC 220532 VABBAIDC 2.000015- 4.210322053242-5.753F- (ABI-FDX7-FAOR- KITAL/0623A100-OMDB -8/IS -9/B77L/H - 10/SDE1E2E3FGHIJ1J2J3J4J5M1P1P2P3RWXYZ/LB1D1 -15/N0494F350 RIGLO L516 KITAL T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNVD1E2A1 DAT/1FANSE2PDC SUR/RSP180 RSP400 260B DOF/210321 REG/N858FD EET/FQBE0030 FMMM0222 FSSS0255 VABF0608 OOMM0745 OMAE0836 SEL/LPJK CODE/ABC591 OPR/FDX RMK/GCAPFDX0122 CARGO TCAS EQUIPPED DISPATCHER TEL NO 9013971796 MOZAMBIQUE 0493A 2020 MADAGASCAR OF 0498 20 ACM DGE SGE CV CRT SEYCHELLES CA M2 726 2020 INDIA 7 98B 2019 IR DATED 23OCT2020 OMAN DAT OF FDX 0035 2020)</p>	<p>FF VABBAIDC 220532 OOMMAIDC 2.003573- 3.VABB000015- 4.210322053244- 5.CF71- (LAM)</p>	Processed

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
4	<p>FF OOMMAIDC 220535 VABBAIDC 2.000016-4.210322053533-5.B9AD- (ABI-FDX7-FAOR-KITAL/0623F400-OMDB -8/IS -9/B77L/H - 10/SDE1E2E3FGHIJ1J2J3J4J5M1P1P2P3RWXYZ/LB1D1 -15/N0494F350 RIGLO L516 KITAL T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNVD1E2A1 DAT/1FANSE2PDC SUR/RSP180 RSP400 260B DOF/210321 REG/N858FD EET/FQBE0030 FMMM0222 FSSS0255 VABF0608 OOMM0745 OMAE0836 SEL/LPK CODE/ABC591 OPR/FDX RMK/GCAPFDX0122 CARGO TCAS EQUIPPED DISPATCHER TEL NO 9013971796 MOZAMBIQUE 0493A 2020 MADAGASCAR OF 0498 20 ACM DGE SGE CV CRT SEYCHELLES CA M2 726 2020 INDIA 7 98B 2019 IR DATED 23OCT2020 OMAN DAT OF FDX 0035 2020)</p>	<p>FF OOMMAIDC 220535 VABBAIDC 2.000016-4.210322053533-5.B9AD- (ABI-FDX7-FAOR-KITAL/0623F400-OMDB -8/IS -9/B77L/H -10/SDE1E2E3FGHIJ1J2J3J4J5M1P1P2P3RWXYZ/LB1D1 -15/N0494F350 RIGLO L516 KITAL T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNVD1E2A1 DAT/1FANSE2PDC SUR/RSP180 RSP400 260B DOF/210321 REG/N858FD EET/FQBE0030 FMMM0222 FSSS0255 VABF0608 OOMM0745 OMAE0836 SEL/LPK CODE/ABC591 OPR/FDX RMK/GCAPFDX0122 CARGO TCAS EQUIPPED DISPATCHER TEL NO 9013971796 MOZAMBIQUE 0493A 2020 MADAGASCAR OF 0498 20 ACM DGE SGE CV CRT SEYCHELLES CA M2 726 2020 INDIA 7 98B 2019 IR DATED 23OCT2020 OMAN DAT OF FDX 0035 2020)</p>	<p>FF VABBAIDC 220535 OOMMAIDC 2.003574-3.VABB000016-4.210322053536-5.CF71- (LAM)</p>	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
5	FF VABBAIDC 220536 OOMMAIDC 2.003575- 3.VABB000017-4.210322053600- 5.CF71- (LAM)	FF OOMMAIDC 220535 VABBAIDC 2.000017- 4.210322053558-5.7DF4- (ABI-UAE505/A0316-VABB- PARAR/0626F380-OMDB -8/IS -9/B77W/H - 10/SDE2E3GHIJ1J3J4J5M1P2RWXYZ/LB1D1 -15/N0485F380 DOGET N571 PARAR/N0488F380 N571 KIPOL T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP SUR/RSP180 260B DOF/210322 REG/A6EPS EET/OOMM0126 OMAE0226 SEL/CFJS CODE/8963E2 PER/D RMK/ADCN776 FIC220246 NRP HAR TCAS ADSB)	FF OOMMAIDC 220535 VABBAIDC 2.000017-4.210322053558-5.7DF4- (ABI- UAE505/A0316-VABB-PARAR/0626F380- OMDB -8/IS -9/B77W/H - 10/SDE2E3GHIJ1J3J4J5M1P2RWXYZ/LB1D1 -15/N0485F380 DOGET N571 PARAR/N0488F380 N571 KIPOL T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP SUR/RSP180 260B DOF/210322 REG/A6EPS EET/OOMM0126 OMAE0226 SEL/CFJS CODE/8963E2 PER/D RMK/ADCN776 FIC220246 NRP HAR TCAS ADSB)	FF VABBAIDC 220536 OOMMAIDC 2.003575-3.VABB000017- 4.210322053600-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
6	FF VABBAIDC 220536 OOMMAIDC 2.003576- 3.VABB000018-4.210322053624- 5.CF71- (LAM)	FF OOMMAIDC 220536 VABBAIDC 2.000018- 4.210322053623-5.FDDA- (EST-IGO1757/A0652-VOCI- TOTOX/0621F380-OKBK)	FF OOMMAIDC 220536 VABBAIDC 2.000018-4.210322053623-5.FDDA- (EST-IGO1757/A0652-VOCI- TOTOX/0621F380-OKBK)	FF VABBAIDC 220536 OOMMAIDC 2.003576-3.VABB000018- 4.210322053624-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
7	FF VABBAIDC 220536 OOMMAIDC 2.003577- 3.VABB000018-4.210322053624- 5.OF26- (ACP-IGO1757-VOCI-OKBK)	FF OOMMAIDC 220536 VABBAIDC 2.000019- 3.OOMS003577-4.210322053626- 5.CF71- (LAM)	FF OOMMAIDC 220536 VABBAIDC 2.000019-3.OOMS003577- 4.210322053626-5.CF71- (LAM)	FF VABBAIDC 220536 OOMMAIDC 2.003577-3.VABB000018- 4.210322053624-5.OF26- (ACP- IGO1757-VOCI-OKBK)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
8	FF VABBAIDC 220537 OOMMAIDC 2.003578-4.210322053702-5.1A02-(ABI-TEST1/A4012-OMDB-RASKI/0604F350-VABB-8/IS-9/B738/M-10/S/C-15/N0481F350 VAXIM L301 RASKI L301 ANKOX-18/DOF/210322)	FF OOMMAIDC 220537 VABBAIDC 2.000020-3.OOMS003578-4.210322053703-5.BA86-(LRM-RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF OOMMAIDC 220537 VABBAIDC 2.000020-3.OOMS003578-4.210322053703-5.BA86- (LRM-RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF VABBAIDC 220537 OOMMAIDC 2.003578-4.210322053702-5.1A02-(ABI-TEST1/A4012-OMDB-RASKI/0604F350-VABB-8/IS-9/B738/M-10/S/C-15/N04 81F350 VAXIM L301 RASKI L301 ANKOX-18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
9	FF VABBAIDC 220537 OOMMAIDC 2.003579-3.VABB000021-4.210322053742-5.CF71-(LAM)	FF OOMMAIDC 220537 VABBAIDC 2.000021-4.210322053742-5.7DE9-(EST-FDX7-FAOR-KITAL/0623F400-OMDB)	FF OOMMAIDC 220537 VABBAIDC 2.000021-4.210322053742-5.7DE9-(EST-FDX7-FAOR-KITAL/0623F400-OMDB)	FF VABBAIDC 220537 OOMMAIDC 2.003579-3.VABB000021-4.210322053742-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
10	FF VABBAIDC 220537 OOMMAIDC 2.003580- 3.VABB000021-4.210322053742- 5.7C8D- (ACP-FDX7-FAOR-OMDB)	FF OOMMAIDC 220537 VABBAIDC 2.000022- 3.OOMS003580-4.210322053744- 5.CF71- (LAM)	FF OOMMAIDC 220537 VABBAIDC 2.000022-3.OOMS003580- 4.210322053744-5.CF71- (LAM)	FF VABBAIDC 220537 OOMMAIDC 2.003580-3.VABB000021- 4.210322053742-5.7C8D- (ACP-FDX7- FAOR-OMDB)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
11	FF VABBAIDC 220538 OOMMAIDC 2.003578- 4.210322053802-5.1A02- (ABI-TEST1/A4012-OMDB- RASKI/0604F350-VABB-8/IS- 9/B738/M-10/S/C-15/N0481F350 VAXIM L301 RASKI L301 ANKOX- 18/DOF/210322)	FF OOMMAIDC 220538 VABBAIDC 2.000023- 3.OOMS003578-4.210322053803- 5.BA86- (LRM-RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF OOMMAIDC 220538 VABBAIDC 2.000023-3.OOMS003578- 4.210322053803-5.BA86- (LRM- RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF VABBAIDC 220538 OOMMAIDC 2.003578-4.210322053802-5.1A02- (ABI-TEST1/A4012-OMDB- RASKI/0604F350-VABB-8/IS- 9/B738/M-10/S/C-15/N04 81F350 VAXIM L301 RASKI L301 ANKOX- 18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
12	FF VABBAIDC 220539 OOMMAIDC 2.003581- 3.VABB000024-4.210322053928- 5.C74A- (LRM-RMK/06/07/BOX621)	FF OOMMAIDC 220539 VABBAIDC 2.000024- 4.210322053925-5.97F3- (EST-BOX621/A0640-VOBL- PARAR/2343F300-EDDF)	FF OOMMAIDC 220539 VABBAIDC 2.000024-4.210322053925-5.97F3- (EST-BOX621/A0640-VOBL- PARAR/2343F300-EDDF)	FF VABBAIDC 220539 OOMMAIDC 2.003581-3.VABB000024- 4.210322053928-5.C74A- (LRM- RMK/06/07/BOX621)	Rejected Error Code 6/7

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
13	FF VABBAIDC 220541 OOMMAIDC 2.003582- 3.VABB000025-4.210322054101- 5.CF71- (LAM)	FF OOMMAIDC 220540 VABBAIDC 2.000025- 4.210322054058-5.3E66- (EST-UAE505/A0316-VABB- PARAR/0626F380-OMDB)	FF OOMMAIDC 220540 VABBAIDC 2.000025-4.210322054058-5.3E66- (EST-UAE505/A0316-VABB- PARAR/0626F380-OMDB)	FF VABBAIDC 220541 OOMMAIDC 2.003582-3.VABB000025- 4.210322054101-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

14	FF VABBAIDC 220541 OOMMAIDC 2.003583- 3.VABB000025-4.210322054101- 5.706E- (ACP-UAE505-VABB-OMDB)	FF OOMMAIDC 220541 VABBAIDC 2.000026- 3.OOMS003583-4.210322054104- 5.CF71- (LAM)	FF OOMMAIDC 220541 VABBAIDC 2.000026-3.OOMS003583- 4.210322054104-5.CF71- (LAM)	FF VABBAIDC 220541 OOMMAIDC 2.003583-3.VABB000025- 4.210322054101-5.706E- (ACP- UAE505-VABB-OMDB)	Processed
-----------	---	--	---	--	-----------

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
15	FF VABBAIDC 220541 OOMMAIDC 2.003584- 4.210322054134-5.D025- (ABI-TEST2/A4014-OMDB- RASKI/0608F350-VABB-8/IS- 9/B738/M-10/S/C-15/N0481F350 VAXIM L301 RASKI L301 ANKOX- 18/DOF/210322)	FF OOMMAIDC 220541 VABBAIDC 2.000027- 3.OOMS003584-4.210322054134- 5.BA86- (LRM-RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF OOMMAIDC 220541 VABBAIDC 2.000027-3.OOMS003584- 4.210322054134-5.BA86- (LRM- RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF VABBAIDC 220541 OOMMAIDC 2.003584-4.210322054134-5.D025- (ABI-TEST2/A4014-OMDB- RASKI/0608F350-VABB-8/IS- 9/B738/M-10/S/C-15/N04 81F350 VAXIM L301 RASKI L301 ANKOX- 18/DOF/210322)	Rejected Error Code 57

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
16	<p>FF VABBAIDC 220542 OOMMAIDC 2.003585-3.VABB000028- 4.210322054226-5.CF71- (LAM)</p>	<p>FF OOMMAIDC 220542 VABBAIDC 2.000028-4.210322054225- 5.EBCC- (ABI-QTR831/A0746-VTBS-RASKI/0632F360- OTHH -8/IS -9/B77W/H - 10/SDE1E3FGHIJ1J3J4J5LM1OP2RVWXY/LB1D1 -15/M083F360 ANKOX L301 RASKI/N0488F380 L301 VAXIM T -18/PBN/A1B1C1D1L1O1S1T1 DAT/1FANS2PDC SUR/RSP180 260B DOF/210322 REG/A7BEI EET/VYYF0019 VECF0112 VOMF0212 VABF0313 OOMM0456 OMAE0559 OBBO632 SEL/FKEQ CODE/06A1BF OPR/QTR PER/D RMK/TCAS PAX FLIGHT CASA RNP AMC RMK/RVR 125)</p>	<p>FF OOMMAIDC 220542 VABBAIDC 2.000028- 4.210322054225-5.EBCC- (ABI- QTR831/A0746-VTBS-RASKI/0632F360-OTHH - 8/IS -9/B77W/H - 10/SDE1E3FGHIJ1J3J4J5LM1OP2RVWXY/LB1D1 -15/M083F360 ANKOX L301 RASKI/N0488F380 L301 VAXIM T -18/PBN/A1B1C1D1L1O1S1T1 DAT/1FANS2PDC SUR/RSP180 260B DOF/210322 REG/A7BEI EET/VYYF0019 VECF0112 VOMF0212 VABF0313 OOMM0456 OMAE0559 OBBO632 SEL/FKEQ CODE/06A1BF OPR/QTR PER/D RMK/TCAS PAX FLIGHT CASA RNP AMC RMK/RVR 125)</p>	<p>FF VABBAIDC 220542 OOMMAIDC 2.003585- 3.VABB000028- 4.210322054226-5.CF71- (LAM)</p>	Processed

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
17	FF VABBAIDC 220542 OOMMAIDC 2.003584- 4.210322054234-5.D025- (ABI-TEST2/A4014-OMDB- RASKI/0608F350-VABB-8/IS- 9/B738/M-10/S/C-15/N0481F350 VAXIM L301 RASKI L301 ANKOX- 18/DOF/210322)	FF OOMMAIDC 220542 VABBAIDC 2.000029- 3.OOMS003584-4.210322054236- 5.BA86- (LRM-RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF OOMMAIDC 220542 VABBAIDC 2.000029-3.OOMS003584- 4.210322054236-5.BA86- (LRM- RMK/57/N04 81F350 VAXIM L301 RASKI L301 ANKOX)	FF VABBAIDC 220542 OOMMAIDC 2.003584-4.210322054234-5.D025- (ABI-TEST2/A4014-OMDB- RASKI/0608F350-VABB-8/IS- 9/B738/M-10/S/C-15/N04 81F350 VAXIM L301 RASKI L301 ANKOX- 18/DOF/210322)	Rejected Error Code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
18	FF VABBAIDC 220545 OOMMAIDC 2.003586- 4.210322054529-5.584D- (ABI-THY056/A7215-LTFM-PARAR/0556F390- WIII-8/IS-9/B789/H- 10/SWYDE1E2FGHIJ1J4J5M1XRZP1P2/B1D1L- 15/N0477F370 SETSI P307 PARAR N571 DOGET N571 BEKUT Q9 EPKOS B211 MMV L896 ADKIT N563 MDN A585 PLB G209 TKG TKG2F-18/PBN/A1B1D1C1L1S1S2O1 NAV/T1T2 RNP2 RNP4 RNAV1 DAT/1PDC SUR/RSP180 260B DOF/210322 REG/TCLLO EET/OOMM0324 SEL/ESBL CODE/4BB18F OPR/THY PER/D RALT/VOMM WMKP RMK/TCAS EQUIPPED IRAQ CO21W2651 KUWAIT 2344ATO UNITED ARAB EMIR RVR/75)	FF OOMMAIDC 220545 VABBAIDC 2.000030- 3.OOMS003586-4.210322054530- 5.DCE3- (LRM-RMK/57/THY056/A7215)	FF OOMMAIDC 220545 VABBAIDC 2.000030-3.OOMS003586- 4.210322054530-5.DCE3- (LRM- RMK/57/THY056/A7215)	FF VABBAIDC 220545 OOMMAIDC 2.003586-4.210322054529-5.584D- (ABI-THY056/A7215-LTFM- PARAR/0556F390-WIII-8/IS- 9/B789/H-10/SWYDE1E2F GHIJ1J4J5M1XRZP1P2/B1D1L- 15/N0477F370 SETSI P307 PARAR N571 DOGET N57 1 BEKUT Q9 EPKOS B211 MMV L896 ADKIT N563 MDN A585 PLB G209 TKG TKG2F - 18/PBN/A1B1D1C1L1S1S2O1 NAV/T1T2 RNP2 RNP4 RNAV1 DAT/1PDC SUR/RSP180 260B DOF/210322 REG/TCLLO EET/OOMM0324 SEL/ESBL CODE/4BB18F OPR/THY PER/D RALT/VOMM WMKP RMK/TCAS EQUIPPED IRAQ CO21W2651 KUWAIT 2344ATO UNITED ARAB EMIR RVR/75)	Rejected Error Code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
19	FF VABBAIDC 220546 OOMMAIDC 2.003587- 4.210322054611-5.C994- (EST-THY056/A7215-LTFM- PARAR/0556F390-WIII)	FF OOMMAIDC 220546 VABBAIDC 2.000031- 3.OOMS003587-4.210322054612- 5.CF71- (LAM)	FF OOMMAIDC 220546 VABBAIDC 2.000031-3.OOMS003587- 4.210322054612-5.CF71- (LAM)	FF VABBAIDC 220546 OOMMAIDC 2.003587-4.210322054611-5.C994- (EST-THY056/A7215-LTFM- PARAR/0556F390-WIII)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
20	FF VABBAIDC 220546 OOMMAIDC 2.003588- 3.VABB000032-4.210322054615- 5.0BEF- (LRM-RMK/07/07/THY056)	FF OOMMAIDC 220546 VABBAIDC 2.000032- 3.OOMS003587-4.210322054614- 5.3B9D- (ACP-THY056/A7215-LTFM-WIII)	FF OOMMAIDC 220546 VABBAIDC 2.000032-3.OOMS003587- 4.210322054614-5.3B9D- (ACP- THY056/A7215-LTFM-WIII)	FF VABBAIDC 220546 OOMMAIDC 2.003588-3.VABB000032- 4.210322054615-5.0BEF- (LRM- RMK/07/07/THY056)	Rejected Error Code 07

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
21	FF VABBAIDC 220547 OOMMAIDC 2.003589- 3.VABB000033-4.210322054727- 5.CF71- (LAM)	FF OOMMAIDC 220547 VABBAIDC 2.000033- 4.210322054725-5.7035- (EST-QTR831/A0746-VTBS- RASKI/0632F360-OTHH)	FF OOMMAIDC 220547 VABBAIDC 2.000033-4.210322054725-5.7035- (EST-QTR831/A0746-VTBS- RASKI/0632F360-OTHH)	FF VABBAIDC 220547 OOMMAIDC 2.003589-3.VABB000033- 4.210322054727-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
22	FF VABBAIDC 220547 OOMMAIDC 2.003590- 3.VABB000033-4.210322054727- 5.788B- (ACP-QTR831-VTBS-OTHH)	FF OOMMAIDC 220547 VABBAIDC 2.000034- 3.OOMS003590-4.210322054729- 5.CF71- (LAM)	FF OOMMAIDC 220547 VABBAIDC 2.000034-3.OOMS003590- 4.210322054729-5.CF71- (LAM)	FF VABBAIDC 220547 OOMMAIDC 2.003590-3.VABB000033- 4.210322054727-5.788B- (ACP- QTR831-VTBS-OTHH)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
23	FF VABBAIDC 220549 OOMMAIDC 2.003591-4.210322054907-5.84B1-(ABI-TEST3/A4016-OMDB-PARAR/0617F350-VABB-8/IS-9/B738/M-10/S/C-15/N0481F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	FF OOMMAIDC 220549 VABBAIDC 2.000035-3.OOMS003591-4.210322054908-5.1CE4-(LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF OOMMAIDC 220549 VABBAIDC 2.000035-3.OOMS003591-4.210322054908-5.1CE4- (LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220549 OOMMAIDC 2.003591-4.210322054907-5.84B1-(ABI-TEST3/A4016-OMDB-PARAR/0617F350-VABB-8/IS-9/B738/M-10/S/C-15/N04 81F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
24	FF VABBAIDC 220550 OOMMAIDC 2.003591-4.210322055007-5.84B1-(ABI-TEST3/A4016-OMDB-PARAR/0617F350-VABB-8/IS-9/B738/M-10/S/C-15/N0481F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	FF OOMMAIDC 220550 VABBAIDC 2.000036-3.OOMS003591-4.210322055009-5.1CE4-(LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF OOMMAIDC 220550 VABBAIDC 2.000036-3.OOMS003591-4.210322055009-5.1CE4- (LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220550 OOMMAIDC 2.003591-4.210322055007-5.84B1-(ABI-TEST3/A4016-OMDB-PARAR/0617F350-VABB-8/IS-9/B738/M-10/S/C-15/N04 81F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
25	FF VABBAIDC 220551 OOMMAIDC 2.003592-4.210322055107-5.8C36-(ABI-TEST3/A4016-OMDB-PARAR/0618F370-VABB-8/IS-9/B738/M-10/S/C-15/N0481F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	FF OOMMAIDC 220551 VABBAIDC 2.000037-3.OOMS003592-4.210322055110-5.1CE4-(LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF OOMMAIDC 220551 VABBAIDC 2.000037-3.OOMS003592-4.210322055110-5.1CE4- (LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220551 OOMMAIDC 2.003592-4.210322055107-5.8C36-(ABI-TEST3/A4016-OMDB-PARAR/0618F370-VABB-8/IS-9/B738/M-10/S/C-15/N04 81F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
26	FF VABBAIDC 220552 OOMMAIDC 2.003592-4.210322055208-5.8C36-(ABI-TEST3/A4016-OMDB-PARAR/0618F370-VABB-8/IS-9/B738/M-10/S/C-15/N0481F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	FF OOMMAIDC 220552 VABBAIDC 2.000038-3.OOMS003592-4.210322055208-5.1CE4-(LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF OOMMAIDC 220552 VABBAIDC 2.000038-3.OOMS003592-4.210322055208-5.1CE4- (LRM-RMK/57/N04 81F350 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220552 OOMMAIDC 2.003592-4.210322055208-5.8C36-(ABI-TEST3/A4016-OMDB-PARAR/0618F370-VABB-8/IS-9/B738/M-10/S/C-15/N04 81F350 SETSI P307 PARAR N571 DOGET-18/DOF/210322)	Rejected Error Code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
27	FF VABBAIDC 220553 OOMMAIDC 2.003593- 3.VABB000039-4.210322055300- 5.CF71- (LAM)	FF OOMMAIDC 220552 VABBAIDC 2.000039- 4.210322055257-5.43DE- (ABI-UAE531/A0660-VOCI- LOTAV/0642F380-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M084F380 KADOL M300 LOTAV/N0492F380 M300 GADMA T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6EGB EET/VABF0044 OOMM0222 OMAE0314 SEL/CSPQ CODE/89617A PER/D RALT/OOMS RMK/NRP HAR TCAS ADSB)	FF OOMMAIDC 220552 VABBAIDC 2.000039-4.210322055257-5.43DE- (ABI-UAE531/A0660-VOCI- LOTAV/0642F380-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M084F380 KADOL M300 LOTAV/N0492F380 M300 GADMA T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6EGB EET/VABF0044 OOMM0222 OMAE0314 SEL/CSPQ CODE/89617A PER/D RALT/OOMS RMK/NRP HAR TCAS ADSB)	FF VABBAIDC 220553 OOMMAIDC 2.003593-3.VABB000039- 4.210322055300-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
28	FF VABBAIDC 220554 OOMMAIDC 2.003594- 4.210322055408-5.814B- (ABI-OMS407/A4001-OOMS- RASKI/0624F290-VGEG-8/IS- 9/A20N/M-10/SWYDFGHIR/LB1- 15/N0467F290 SETSI/N0462F350 N881 RASKI/N0457F370 L301 ANKOX BPL A791 CEA B465 CTG DCT- 18/PBN/A1B1C1D1L1O1S2T1 DOF/210322 REG/A4OOVF SEL/CMFH OPR/SALAM AIR PER/C RMK/TCAS EQUIPPED)	FF OOMMAIDC 220554 VABBAIDC 2.000040- 3.OOMS003594-4.210322055411- 5.6750- (LRM-RMK/57/OMS407/A4001)	FF VABBAIDC 220554 OOMMAIDC 2.003594-4.210322055408-5.814B- (ABI-OMS407/A4001-OOMS- RASKI/0624F290-VGEG-8/IS- 9/A20N/M-10/SWYDFGHIR /LB1- 15/N0467F290 SETSI/N0462F350 N881 RASKI/N0457F370 L301 ANKOX BPL A791 CEA B465 CTG DCT- 18/PBN/A1B1C1D1L1O1S2T1 DOF/210322 REG/A4OOVF SEL/CMFH OPR/SALAM AIR PER/C RMK/TCAS EQUIPPED)	FF OOMMAIDC 220554 VABBAIDC 2.000040-3.OOMS003594- 4.210322055411-5.6750- (LRM- RMK/57/OMS407/A4001)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
29	FF VABBAIDC 220554 OOMMAIDC 2.003595- 4.210322055420-5.3C0D- (EST-TEST1/A4012-OMDB- RASKI/0604F350-VABB)	FF OOMMAIDC 220554 VABBAIDC 2.000041- 3.OOMS003595-4.210322055421- 5.0D83- (LRM-RMK/6/7/TEST1)	FF OOMMAIDC 220554 VABBAIDC 2.000041-3.OOMS003595- 4.210322055421-5.0D83- (LRM- RMK/6/7/TEST1)	FF VABBAIDC 220554 OOMMAIDC 2.003595-4.210322055420-5.3C0D- (EST-TEST1/A4012-OMDB- RASKI/0604F350-VABB)	Rejected Error Code 6 / 7

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

30	<p>FF VABBAIDC 220554 OOMMAIDC 2.003596- 4.210322055438-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)</p>	<p>FF OOMMAIDC 220554 VABBAIDC 2.000042- 3.OOMS003596-4.210322055439- 5.2069- (LRM-RMK/57/IGO066/A6230)</p>	<p>FF OOMMAIDC 220554 VABBAIDC 2.000042-3.OOMS003596- 4.210322055439-5.2069- (LRM- RMK/57/IGO066/A6230)</p>	<p>FF VABBAIDC 220554 OOMMAIDC 2.003596-4.210322055438-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF IN GO 0008 2020 GCAPIGO0122 REPAT)</p>	<p>Rejected Error Code 57</p>
----	---	---	--	---	---

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
31	FF VABBAIDC 220554 OOMMAIDC 2.003596- 4.210322055438-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)	FF OOMMAIDC 220554 VABBAIDC 2.000042- 3.OOMS003596-4.210322055439- 5.2069- (LRM-RMK/57/IGO066/A6230)	FF OOMMAIDC 220555 VABBAIDC 2.000043-3.OOMS003594- 4.210322055509-5.6750- (LRM- RMK/57/OMS407/A4001)	FF VABBAIDC 220555 OOMMAIDC 2.003594-4.210322055509-5.814B- (ABI-OMS407/A4001-OOMS- RASKI/0624F290-VGEG-8/IS- 9/A20N/M-10/SWYDFGHIR /LB1- 15/N0467F290 SETSI/N0462F350 N881 RASKI/N0457F370 L301 ANKOX BPL A791 CEA B465 CTG DCT- 18/PBN/A1B1C1D1L1O1S2T1 DOF/210322 REG/A4OOVF SEL/CMFH OPR/SALAM AIR PER/C RMK/TCAS EQUIPPED)	Rejected Error Code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
32	FF VABBAIDC 220555 OOMMAIDC 2.003594- 4.210322055509-5.814B- (ABI-OMS407/A4001-OOMS- RASKI/0624F290-VGEG-8/IS- 9/A20N/M-10/SWYDFGHIR/LB1- 15/N0467F290 SETSI/N0462F350 N881 RASKI/N0457F370 L301 ANKOX BPL A791 CEA B465 CTG DCT- 18/PBN/A1B1C1D1L1O1S2T1 DOF/210322 REG/A4OOVF SEL/CMFH OPR/SALAM AIR PER/C RMK/TCAS EQUIPPED)	FF OOMMAIDC 220555 VABBAIDC 2.000043- 3.OOMS003594-4.210322055509- 5.6750- (LRM-RMK/57/OMS407/A4001)	FF OOMMAIDC 220555 VABBAIDC 2.000044-3.OOMS003596- 4.210322055542-5.2069- (LRM- RMK/57/IGO066/A6230)	FF VABBAIDC 220555 OOMMAIDC 2.003596-4.210322055539-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZNSX RMK/OVRFLT PERMITS OMAN DAT OF IN GO 0008 2020 GCAPIGO0122 REPAT)	Rejected Error Code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
33	FF VABBAIDC 220555 OOMMAIDC 2.003596- 4.210322055539-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)	FF OOMMAIDC 220555 VABBAIDC 2.000044- 3.OOMS003596-4.210322055542- 5.2069- (LRM-RMK/57/IGO066/A6230)	FF OOMMAIDC 220557 VABBAIDC 2.000045-3.OOMS003597- 4.210322055740-5.2069- (LRM- RMK/57/IGO066/A6230)	FF VABBAIDC 220557 OOMMAIDC 2.003597-4.210322055739-5.7055- (ABI-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF IN GO 0008 2020 GCAPIGO0122 REPAT)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
34	FF VABBAIDC 220634 OOMMAIDC 2.003633- 3.VABB000089-4.210322063456- 5.BEFA- (ACP-UAE565-VOBL-OMDB)	FF OOMMAIDC 220634 VABBAIDC 2.000090- 3.OOMS003633-4.210322063459- 5.CF71- (LAM)	FF OOMMAIDC 220634 VABBAIDC 2.000090-3.OOMS003633- 4.210322063459-5.CF71- (LAM)	FF VABBAIDC 220634 OOMMAIDC 2.003633-3.VABB000089- 4.210322063456-5.BEFA- (ACP- UAE565-VOBL-OMDB)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
35	FF VABBAIDC 220557 OOMMAIDC 2.003598- 3.VABB000046-4.210322055750- 5.CF71- (LAM)	FF OOMMAIDC 220557 VABBAIDC 2.000046- 4.210322055747-5.271B- (EST-UAE531/A0660-VOCI- LOTAV/0642F380-OMDB)	FF OOMMAIDC 220557 VABBAIDC 2.000046-4.210322055747-5.271B- (EST-UAE531/A0660-VOCI- LOTAV/0642F380-OMDB)	FF VABBAIDC 220557 OOMMAIDC 2.003598-3.VABB000046- 4.210322055750-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
36	FF VABBAIDC 220557 OOMMAIDC 2.003599- 3.VABB000046-4.210322055750- 5.CD94- (ACP-UAE531-VOCI-OMDB)	FF OOMMAIDC 220557 VABBAIDC 2.000047- 3.OOMS003599-4.210322055752- 5.CF71- (LAM)	FF OOMMAIDC 220557 VABBAIDC 2.000047-3.OOMS003599- 4.210322055752-5.CF71- (LAM)	FF VABBAIDC 220557 OOMMAIDC 2.003599-3.VABB000046- 4.210322055750-5.CD94- (ACP- UAE531-VOCI-OMDB)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
37	FF VABBAIDC 220558 OOMMAIDC 2.003600- 4.210322055816-5.36D5- (EST-TEST2/A4014-OMDB- RASKI/0608F350-VABB)	FF OOMMAIDC 220558 VABBAIDC 2.000048- 3.OOMS003600-4.210322055816- 5.965F- (LRM-RMK/6/7/TEST2)	FF OOMMAIDC 220558 VABBAIDC 2.000048-3.OOMS003600- 4.210322055816-5.965F- (LRM- RMK/6/7/TEST2)	FF VABBAIDC 220558 OOMMAIDC 2.003600-4.210322055816-5.36D5- (EST-TEST2/A4014-OMDB- RASKI/0608F350-VABB)	Rejected Error Code 6/7

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
38	FF VABBAIDC 220558 OOMMAIDC 2.003597- 4.210322055840-5.7055- (ABI-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZNSX RMK/OVRFLT	FF OOMMAIDC 220558 VABBAIDC 2.000049- 3.OOMS003597-4.210322055840- 5.2069- (LRM-RMK/57/IGO066/A6230)	FF OOMMAIDC 220558 VABBAIDC 2.000049-3.OOMS003597- 4.210322055840-5.2069- (LRM- RMK/57/IGO066/A6230)	FF VABBAIDC 220558 OOMMAIDC 2.003597-4.210322055840-5.7055- (ABI-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZNSX RMK/OVRFLT PERMITS OMAN DAT OF	Rejected Error Code 57

	PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)			IN GO 0008 2020 GCAPIGO0122 REPAT)	
--	--	--	--	---------------------------------------	--

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

39	<p>FF VABBAIDC 220601 OOMMAIDC 2.003601-3.VABB000050-4.210322060136-5.CF71- (LAM)</p>	<p>FF OOMMAIDC 220601 VABBAIDC 2.000050-4.210322060136-5.A6DD-(ABI-UAE527/A0674-VOHS-RASKI/0652F360-OMDB -8/IS -9/B77W/H -</p> <p>10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/N0494F360 ANKOX L301 RASKI/N0498F360 L301 VAXIM T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6EBR EET/VABF0021 OOMM0203 OMAE0305 SEL/BMJL CODE/8960D9 PER/D RMK/ADCC533 FIC220166 NRP HAR TCAS ADS)</p>	<p>FF OOMMAIDC 220601 VABBAIDC 2.000050-4.210322060136-5.A6DD-(ABI-UAE527/A0674-VOHS-RASKI/0652F360-OMDB -8/IS -9/B77W/H -</p> <p>10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/N0494F360 ANKOX L301 RASKI/N0498F360 L301 VAXIM T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6EBR EET/VABF0021 OOMM0203 OMAE0305 SEL/BMJL CODE/8960D9 PER/D RMK/ADCC533 FIC220166 NRP HAR TCAS ADS)</p>	<p>FF VABBAIDC 220601 OOMMAIDC 2.003601-3.VABB000050-4.210322060136-5.CF71- (LAM)</p>	Processed
----	---	---	---	---	-----------

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

40	FF VABBAIDC 220601 OOMMAIDC 2.003602- 4.210322060153-5.D459- (ABI-TEST4/A4021-OMDB- PARAR/0624F370-VABB-8/IS- 9/B738/M-10/S/C-15/N0481F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	FF OOMMAIDC 220601 VABBAIDC 2.000052- 3.OOMS003602-4.210322060155- 5.1097- (LRM-RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET	FF OOMMAIDC 220601 VABBAIDC 2.000052-3.OOMS003602- 4.210322060155-5.1097- (LRM- RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220601 OOMMAIDC 2.003602-4.210322060153-5.D459- (ABI-TEST4/A4021-OMDB- PARAR/0624F370-VABB-8/IS- 9/B738/M-10/S/C-15/N04 81F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	Rejected Error Code 57
-----------	---	---	--	--	------------------------------

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

41	FF VABBAIDC 220601 OOMMAIDC 2.003603- 3.VABB000051-4.210322060155- 5.CF71- (LAM)	FF OOMMAIDC 220601 VABBAIDC 2.000051- 4.210322060153-5.6AAD- (ABI-UAE545/A0625-VOMM- PARAR/0651F360-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M083F360 DOGET/M083F380 N571 PARAR/N0488F380 N571 KIPOL T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6ECX EET/VABF0048 OOMM0234 OMAE0333 SEL/ARCJ CODE/89611F PER/D RMK/ADCC518 FIC220130 NRP HAR TCAS ADS)	FF OOMMAIDC 220601 VABBAIDC 2.000051-4.210322060153-5.6AAD- (ABI-UAE545/A0625-VOMM- PARAR/0651F360-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M083F360 DOGET/M083F380 N571 PARAR/N0488F380 N571 KIPOL T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6ECX EET/VABF0048 OOMM0234 OMAE0333 SEL/ARCJ CODE/89611F PER/D RMK/ADCC518 FIC220130 NRP HAR TCAS ADS)	FF VABBAIDC 220601 OOMMAIDC 2.003603-3.VABB000051- 4.210322060155-5.CF71- (LAM)	Processed
----	--	---	---	---	-----------

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

42	FF VABBAIDC 220602 OOMMAIDC 2.003602- 4.210322060253-5.D459- (ABI-TEST4/A4021-OMDB- PARAR/0624F370-VABB-8/IS- 9/B738/M-10/S/C-15/N0481F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	FF OOMMAIDC 220602 VABBAIDC 2.000053- 3.OOMS003602-4.210322060255- 5.1097- (LRM-RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET)	FF OOMMAIDC 220602 VABBAIDC 2.000053-3.OOMS003602- 4.210322060255-5.1097- (LRM- RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220602 OOMMAIDC 2.003602-4.210322060253-5.D459- (ABI-TEST4/A4021-OMDB- PARAR/0624F370-VABB-8/IS- 9/B738/M-10/S/C-15/N04 81F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	Rejected Error Code 57
----	---	--	--	--	------------------------------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
43	FF VABBAIDC 220602 OOMMAIDC 2.003604- 4.210322060258-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)	FF OOMMAIDC 220602 VABBAIDC 2.000054- 3.OOMS003604-4.210322060258- 5.2069- (LRM-RMK/57/IGO066/A6230)	FF OOMMAIDC 220602 VABBAIDC 2.000054-3.OOMS003604- 4.210322060258-5.2069- (LRM- RMK/57/IGO066/A6230)	FF VABBAIDC 220602 OOMMAIDC 2.003604-4.210322060258-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF IN GO 0008 2020 GCAPIGO0122 REPAT)	Rejected Error Code 57

Muscat System

Mumbai System

Status

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
44	FF VABBAIDC 220604 OOMMAIDC 2.003604- 4.210322060400-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXSX RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)	FF OOMMAIDC 220604 VABBAIDC 2.000055- 3.OOMS003604-4.210322060401- 5.2069- (LRM-RMK/57/IGO066/A6230)	FF OOMMAIDC 220604 VABBAIDC 2.000055-3.OOMS003604- 4.210322060401-5.2069- (LRM- RMK/57/IGO066/A6230)	FF VABBAIDC 220604 OOMMAIDC 2.003604-4.210322060400-5.4B9A- (ABI-IGO066/A6230-OMDB- TOTOX/0620F370-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXSX RMK/OVRFLT PERMITS OMAN DAT OF IN GO 0008 2020 GCAPIGO0122 REPAT)	Rejected Error Code 57

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
45	FF VABBAIDC 220605 OOMMAIDC 2.003605- 4.210322060500-5.7055- (ABI-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)	FF OOMMAIDC 220605 VABBAIDC 2.000056- 3.OOMS003605-4.210322060502- 5.2069- (LRM-RMK/57/IGO066/A6230)	FF OOMMAIDC 220605 VABBAIDC 2.000056-3.OOMS003605- 4.210322060502-5.2069- (LRM- RMK/57/IGO066/A6230)	FF VABBAIDC 220605 OOMMAIDC 2.003605-4.210322060500-5.7055- (ABI-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF IN GO 0008 2020 GCAPIGO0122 REPAT)	Rejected Error Code 57

Muscat System

Mumbai System

Status

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
46	FF VABBAIDC 220606 OOMMAIDC 2.003605- 4.210322060601-5.7055- (ABI-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM-8/IN- 9/A320/M-10/SWYDFGE1HIRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV- 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 REPAT)	FF OOMMAIDC 220606 VABBAIDC 2.000057- 3.OOMS003605-4.210322060601- 5.2069- (LRM-RMK/57/IGO066/A6230)	FF OOMMAIDC 220606 VABBAIDC 2.000057-3.OOMS003605- 4.210322060601-5.2069- (LRM- RMK/57/IGO066/A6230)	FF VABBAIDC 220606 OOMMAIDC 2.003605-4.210322060601-5.7055- (ABI-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM-8/IN- 9/A320/M-10/SWYDFGE1H IRZ/LB1- 15/N0453F370 LOXOP N629 TOTOX P574 BOLIS P574 MMV-18/PBN/A1B1 C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP DOF/210322 REG/VTIAQ EET/OOMM0010 SEL/QRAH CODE/800B12 ORGN/CYYZXNSX RMK/OVRFLT PERMITS OMAN DAT OF IN GO 0008 2020 GCAPIGO0122 REPAT)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
47	FF VABBAIDC 220606 OOMMAIDC 2.003606-3.VABB000058-4.210322060636-5.CF71- (LAM)	FF OOMMAIDC 220606 VABBAIDC 2.000058-4.210322060636-5.D7E1- (EST-UAE527/A0674-VOHS-RASKI/0652F360-OMDB)	FF OOMMAIDC 220606 VABBAIDC 2.000058-4.210322060636-5.D7E1- (EST-UAE527/A0674-VOHS-RASKI/0652F360-OMDB)	FF VABBAIDC 220606 OOMMAIDC 2.003606-3.VABB000058-4.210322060636-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
48	FF VABBAIDC 220606 OOMMAIDC 2.003607-3.VABB000058-4.210322060636-5.9153- (ACP-UAE527-VOHS-OMDB)	FF OOMMAIDC 220606 VABBAIDC 2.000059-3.OOMS003607-4.210322060638-5.CF71- (LAM)	FF OOMMAIDC 220606 VABBAIDC 2.000059-3.OOMS003607-4.210322060638-5.CF71- (LAM)	FF VABBAIDC 220606 OOMMAIDC 2.003607-3.VABB000058-4.210322060636-5.9153- (ACP-UAE527-VOHS-OMDB)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
49	FF VABBAIDC 220606 OOMMAIDC 2.003608- 3.VABB000060-4.210322060646- 5.CF71- (LAM)	FF OOMMAIDC 220606 VABBAIDC 2.000060- 4.210322060644-5.E6CE- (EST-UAE545/A0625-VOMM- PARAR/0651F360-OMDB)	FF OOMMAIDC 220606 VABBAIDC 2.000060-4.210322060644-5.E6CE- (EST-UAE545/A0625-VOMM- PARAR/0651F360-OMDB)	FF VABBAIDC 220606 OOMMAIDC 2.003608-3.VABB000060- 4.210322060646-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
50	FF VABBAIDC 220606 OOMMAIDC 2.003609- 3.VABB000060-4.210322060646- 5.559F- (ACP-UAE545-VOMM-OMDB)	FF OOMMAIDC 220606 VABBAIDC 2.000061- 3.OOMS003609-4.210322060649- 5.CF71- (LAM)	FF OOMMAIDC 220606 VABBAIDC 2.000061-3.OOMS003609- 4.210322060649-5.CF71- (LAM)	FF VABBAIDC 220606 OOMMAIDC 2.003609-3.VABB000060- 4.210322060646-5.559F- (ACP- UAE545-VOMM-OMDB)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
51	FF VABBAIDC 220608 OOMMAIDC 2.003610- 4.210322060807-5.FA57- (EST-TEST3/A4016-OMDB- PARAR/0618F370-VABB)	FF OOMMAIDC 220608 VABBAIDC 2.000062- 3.OOMS003610-4.210322060808- 5.E0EB- (LRM-RMK/6/7/TEST3)	FF OOMMAIDC 220608 VABBAIDC 2.000062-3.OOMS003610- 4.210322060808-5.E0EB- (LRM- RMK/6/7/TEST3)	FF VABBAIDC 220608 OOMMAIDC 2.003610-4.210322060807-5.FA57- (EST-TEST3/A4016-OMDB- PARAR/0618F370-VABB)	Rejected Error Code 6/7

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
52	FF VABBAIDC 220610 OOMMAIDC 2.003611- 4.210322061050-5.9247- (EST-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM)	FF OOMMAIDC 220610 VABBAIDC 2.000063- 3.OOMS003611-4.210322061053- 5.CF71- (LAM)	FF OOMMAIDC 220610 VABBAIDC 2.000063-3.OOMS003611- 4.210322061053-5.CF71- (LAM)	FF VABBAIDC 220610 OOMMAIDC 2.003611-4.210322061050-5.9247- (EST-IGO066/A6230-OMDB- TOTOX/0620F390-VOMM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
53	FF VABBAIDC 220610 OOMMAIDC 2.003612- 3.VABB000064-4.210322061056- 5.514D- (LRM-RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	FF OOMMAIDC 220610 VABBAIDC 2.000064- 3.OOMS003611-4.210322061055- 5.0F12- (ACP-IGO066/A6230-OMDB-VOMM)	FF OOMMAIDC 220610 VABBAIDC 2.000064-3.OOMS003611- 4.210322061055-5.0F12- (ACP- IGO066/A6230-OMDB-VOMM)	FF VABBAIDC 220610 OOMMAIDC 2.003612-3.VABB000064- 4.210322061056-5.514D- (LRM- RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	Rejected Error Code 65

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
54	FF VABBAIDC 220613 OOMMAIDC 2.003613- 4.210322061327-5.6651- (ABI-TEST5/A4023-OMDB- PARAR/0637F370-VABB-8/IS- 9/B738/M-10/S/C-15/N0481F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	FF OOMMAIDC 220613 VABBAIDC 2.000065- 3.OOMS003613-4.210322061329- 5.1097- (LRM-RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET)	FF OOMMAIDC 220613 VABBAIDC 2.000065-3.OOMS003613- 4.210322061329-5.1097- (LRM- RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220613 OOMMAIDC 2.003613-4.210322061327-5.6651- (ABI-TEST5/A4023-OMDB- PARAR/0637F370-VABB-8/IS- 9/B738/M-10/S/C-15/N04 81F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
55	FF VABBAIDC 220614 OOMMAIDC 2.003614- 4.210322061404-5.9AF8- (EST-TEST4/A4021-OMDB- PARAR/0624F370-VABB)	FF OOMMAIDC 220614 VABBAIDC 2.000066- 3.OOMS003614-4.210322061406- 5.B1C6- (LRM-RMK/6/7/TEST4)	FF OOMMAIDC 220614 VABBAIDC 2.000066-3.OOMS003614- 4.210322061406-5.B1C6- (LRM- RMK/6/7/TEST4)	FF VABBAIDC 220614 OOMMAIDC 2.003614-4.210322061404-5.9AF8- (EST-TEST4/A4021-OMDB- PARAR/0624F370-VABB)	Rejected Error Code 6/7

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
56	FF VABBAIDC 220614 OOMMAIDC 2.003613- 4.210322061428-5.6651- (ABI-TEST5/A4023-OMDB- PARAR/0637F370-VABB-8/IS- 9/B738/M-10/S/C-15/N0481F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	FF OOMMAIDC 220614 VABBAIDC 2.000067- 3.OOMS003613-4.210322061430- 5.1097- (LRM-RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET)	FF OOMMAIDC 220614 VABBAIDC 2.000067-3.OOMS003613- 4.210322061430-5.1097- (LRM- RMK/57/N04 81F370 SETSI P307 PARAR N571 DOGET)	FF VABBAIDC 220614 OOMMAIDC 2.003613-4.210322061428-5.6651- (ABI-TEST5/A4023-OMDB- PARAR/0637F370-VABB-8/IS- 9/B738/M-10/S/C-15/N04 81F370 SETSI P307 PARAR N571 DOGET- 18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
57	FF VABBAIDC 220614 OOMMAIDC 2.003615- 4.210322061440-5.B208- (ABI-TEST6/A4024-OMAA- KITAL/0635F370-VOCI-8/IS-9/B738/M- 10/S/C-15/N0481F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	FF OOMMAIDC 220614 VABBAIDC 2.000068- 3.OOMS003615-4.210322061442- 5.91FB- (LRM-RMK/57/N04 81F370 GOLNI P570 KITAL L894 BOLUR)	FF OOMMAIDC 220614 VABBAIDC 2.000068-3.OOMS003615- 4.210322061442-5.91FB- (LRM- RMK/57/N04 81F370 GOLNI P570 KITAL L894 BOLUR)	FF VABBAIDC 220614 OOMMAIDC 2.003615-4.210322061440-5.B208- (ABI-TEST6/A4024-OMAA- KITAL/0635F370-VOCI-8/IS-9/B738/M- 10/S/C-15/N04 81F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
58	FF VABBAIDC 220615 OOMMAIDC 2.003615- 4.210322061540-5.B208- (ABI-TEST6/A4024-OMAA- KITAL/0635F370-VOCI-8/IS-9/B738/M- 10/S/C-15/N0481F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	FF OOMMAIDC 220615 VABBAIDC 2.000069- 3.OOMS003615-4.210322061542- 5.91FB- (LRM-RMK/57/N04 81F370 GOLNI P570 KITAL L894 BOLUR)	FF OOMMAIDC 220615 VABBAIDC 2.000069-3.OOMS003615- 4.210322061542-5.91FB- (LRM- RMK/57/N04 81F370 GOLNI P570 KITAL L894 BOLUR)	FF VABBAIDC 220615 OOMMAIDC 2.003615-4.210322061540-5.B208- (ABI-TEST6/A4024-OMAA- KITAL/0635F370-VOCI-8/IS-9/B738/M- 10/S/C-15/N04 81F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

59	<p>FF VABBAIDC 220616 OOMMAIDC 2.003616- 3.VABB000070-4.210322061609- 5.CF71- (LAM)</p>	<p>FF OOMMAIDC 220616 VABBAIDC 2.000070- 4.210322061607-5.0334- (ABI-GEC8459/A0641-VOBL- REXOD/0706F300-EDDF -8/IS -9/B77L/H - 10/SDE2E3FGHIJ1J3J4J5M1P2RWXYZ/LB1D1 -15/M082F300 KATBI N563 REXOD T -18/PBN/A1B1C1D1L1O1S2 NAV/RNVD1E2A1 DAT/1FANSP SUR/RSP180 260B DOF/210322 REG/DALFE EET/VABF0043 OOMM0223 OMAE0315 OBBB0340 OEJD0403 HECC0602 LCCC0640 LGGG0703 LTBB0727 LGGG0733 LWSS0815 LYBA0825 LQSB0840 LDZO0855 LJLA0908 LOVV0912 EDUU0931 EDGG0948 SEL/MQAP CODE/3C70C5 OPR/GEC PER/D RMK/LUFTHANSA CARGO TCAS RMK/RVR 075)</p>	<p>FF OOMMAIDC 220616 VABBAIDC 2.000070-4.210322061607-5.0334- (ABI- GEC8459/A0641-VOBL-REXOD/0706F300- EDDF -8/IS -9/B77L/H - 10/SDE2E3FGHIJ1J3J4J5M1P2RWXYZ/LB1D1 -15/M082F300 KATBI N563 REXOD T - 18/PBN/A1B1C1D1L1O1S2 NAV/RNVD1E2A1 DAT/1FANSP SUR/RSP180 260B DOF/210322 REG/DALFE EET/VABF0043 OOMM0223 OMAE0315 OBBB0340 OEJD0403 HECC0602 LCCC0640 LGGG0703 LTBB0727 LGGG0733 LWSS0815 LYBA0825 LQSB0840 LDZO0855 LJLA0908 LOVV0912 EDUU0931 EDGG0948 SEL/MQAP CODE/3C70C5 OPR/GEC PER/D RMK/LUFTHANSA CARGO TCAS RMK/RVR 075)</p>	<p>FF VABBAIDC 220616 OOMMAIDC 2.003616- 3.VABB000070-4.210322061609- 5.CF71- (LAM)</p>	<p>Processed</p>
----	---	---	--	---	------------------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
60	FF VABBAIDC 220616 OOMMAIDC 2.003617- 4.210322061647-5.D0BB- (ABI-TEST7/A4025-OOMS- TOTOX/0646F370-VOCI-8/IS- 9/B738/M-10/S/C-15/N0481F370 LOSIM P574 TOTOX P574 BOLIS- 18/DOF/210322)	FF OOMMAIDC 220616 VABBAIDC 2.000071- 3.OOMS003617-4.210322061649- 5.35D1- (LRM-RMK/57/N04 81F370 LOSIM P574 TOTOX P574 BOLIS)	FF OOMMAIDC 220616 VABBAIDC 2.000071-3.OOMS003617- 4.210322061649-5.35D1- (LRM- RMK/57/N04 81F370 LOSIM P574 TOTOX P574 BOLIS)	FF VABBAIDC 220616 OOMMAIDC 2.003617-4.210322061647-5.D0BB- (ABI-TEST7/A4025-OOMS- TOTOX/0646F370-VOCI-8/IS- 9/B738/M-10/S/C-15/N04 81F370 LOSIM P574 TOTOX P574 BOLIS- 18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
61	FF VABBAIDC 220617 OOMMAIDC 2.003617- 4.210322061747-5.D0BB- (ABI-TEST7/A4025-OOMS- TOTOX/0646F370-VOCI-8/IS- 9/B738/M-10/S/C-15/N0481F370 LOSIM P574 TOTOX P574 BOLIS- 18/DOF/210322)	FF OOMMAIDC 220617 VABBAIDC 2.000072- 3.OOMS003617-4.210322061747- 5.35D1- (LRM-RMK/57/N04 81F370 LOSIM P574 TOTOX P574 BOLIS)	FF OOMMAIDC 220617 VABBAIDC 2.000072-3.OOMS003617- 4.210322061747-5.35D1- (LRM- RMK/57/N04 81F370 LOSIM P574 TOTOX P574 BOLIS)	FF VABBAIDC 220617 OOMMAIDC 2.003617-4.210322061747-5.D0BB- (ABI-TEST7/A4025-OOMS- TOTOX/0646F370-VOCI-8/IS- 9/B738/M-10/S/C-15/N04 81F370 LOSIM P574 TOTOX P574 BOLIS- 18/DOF/210322)	Rejected Error Code 57

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
62	FF VABBAIDC 220617 OOMMAIDC 2.003618- 3.VABB000073-4.210322061757- 5.CF71- (LAM)	FF OOMMAIDC 220617 VABBAIDC 2.000073- 4.210322061755-5.C878- (MAC-ATG9912-VHHH-OOMS)	FF OOMMAIDC 220617 VABBAIDC 2.000073-4.210322061755-5.C878- (MAC-ATG9912-VHHH-OOMS)	FF VABBAIDC 220617 OOMMAIDC 2.003618-3.VABB000073- 4.210322061757-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
63	FF VABBAIDC 220618 OOMMAIDC 2.003619- 3.VABB000074-4.210322061800- 5.CF71- (LAM)	FF OOMMAIDC 220618 VABBAIDC 2.000074- 4.210322061800-5.1516- (MAC-UBG343-VGHS-OMDB)	FF OOMMAIDC 220618 VABBAIDC 2.000074-4.210322061800-5.1516- (MAC-UBG343-VGHS-OMDB)	FF VABBAIDC 220618 OOMMAIDC 2.003619-3.VABB000074- 4.210322061800-5.CF71- (LAM)	Processed

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
64	FF VABBAIDC 220618 OOMMAIDC 2.003620- 3.VABB000075-4.210322061813- 5.CF71-(LAM)	FF OOMMAIDC 220618 VABBAIDC 2.000075- 4.210322061812-5.9C72- (MAC-N28ZD-VABB-OMDW)	FF OOMMAIDC 220618 VABBAIDC 2.000075-4.210322061812-5.9C72- (MAC-N28ZD-VABB-OMDW)	FF VABBAIDC 220618 OOMMAIDC 2.003620-3.VABB000075- 4.210322061813-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
65	FF VABBAIDC 220621 OOMMAIDC 2.003621- 3.VABB000076-4.210322062108- 5.CF71- (LAM)	FF OOMMAIDC 220621 VABBAIDC 2.000076- 4.210322062107-5.A9A8- (EST-GEC8459/A0641-VOBL- REXOD/0706F300-EDDF)	FF OOMMAIDC 220621 VABBAIDC 2.000076-4.210322062107-5.A9A8- (EST-GEC8459/A0641-VOBL- REXOD/0706F300-EDDF)	FF VABBAIDC 220621 OOMMAIDC 2.003621-3.VABB000076- 4.210322062108-5.CF71- (LAM)	Processed

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
66	FF VABBAIDC 220621 OOMMAIDC 2.003622- 3.VABB000076-4.210322062108- 5.327A- (ACP-GEC8459-VOBL-EDDF)	FF OOMMAIDC 220621 VABBAIDC 2.000077- 3.OOMS003622-4.210322062109- 5.CF71- (LAM)	FF OOMMAIDC 220621 VABBAIDC 2.000077-3.OOMS003622- 4.210322062109-5.CF71- (LAM)	FF VABBAIDC 220621 OOMMAIDC 2.003622-3.VABB000076- 4.210322062108-5.327A- (ACP- GEC8459-VOBL-EDDF)	Processed

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
67	FF VABBAIDC 220621 OOMMAIDC 2.003623- 4.210322062142-5.246A- (ABI-TEST8/A4027-OMAA- KITAL/0643F370-VOCI-8/IS-9/B738/M- 10/S/C-15/M078F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	FF OOMMAIDC 220621 VABBAIDC 2.000078- 3.OOMS003623-4.210322062145- 5.03E0- (LRM-RMK/57/M07 8F370 GOLNI P570 KITAL L894 BOLUR)	FF OOMMAIDC 220621 VABBAIDC 2.000078-3.OOMS003623- 4.210322062145-5.03E0- (LRM- RMK/57/M07 8F370 GOLNI P570 KITAL L894 BOLUR)	FF VABBAIDC 220621 OOMMAIDC 2.003623-4.210322062142-5.246A- (ABI-TEST8/A4027-OMAA- KITAL/0643F370-VOCI-8/IS-9/B738/M- 10/S/C-15/M07 8F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	Rejected Error Code 57

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
68	FF VABBAIDC 220622 OOMMAIDC 2.003623- 4.210322062243-5.246A- (ABI-TEST8/A4027-OMAA- KITAL/0643F370-VOCI-8/IS-9/B738/M- 10/S/C-15/M078F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	FF OOMMAIDC 220622 VABBAIDC 2.000079- 3.OOMS003623-4.210322062246- 5.03E0- (LRM-RMK/57/M07 8F370 GOLNI P570 KITAL L894 BOLUR)	FF OOMMAIDC 220622 VABBAIDC 2.000079-3.OOMS003623- 4.210322062246-5.03E0- (LRM- RMK/57/M07 8F370 GOLNI P570 KITAL L894 BOLUR)	FF VABBAIDC 220622 OOMMAIDC 2.003623-4.210322062243-5.246A- (ABI-TEST8/A4027-OMAA- KITAL/0643F370-VOCI-8/IS-9/B738/M- 10/S/C-15/M07 8F370 GOLNI P570 KITAL L894 BOLUR-18/DOF/210322)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
69	FF VABBAIDC 220625 OOMMAIDC 2.003624- 4.210322062556-5.FE8C- (EST-TEST6/A4024-OMAA- KITAL/0635F370-VOCI)	FF OOMMAIDC 220625 VABBAIDC 2.000080- 3.OOMS003624-4.210322062556- 5.5CAE- (LRM-RMK/6/7/TEST6)	FF OOMMAIDC 220625 VABBAIDC 2.000080-3.OOMS003624- 4.210322062556-5.5CAE- (LRM- RMK/6/7/TEST6)	FF VABBAIDC 220625 OOMMAIDC 2.003624-4.210322062556-5.FE8C- (EST-TEST6/A4024-OMAA- KITAL/0635F370-VOCI)	Rejected Error Code 6/7

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
70	FF VABBAIDC 220627 OOMMAIDC 2.003625- 4.210322062708-5.4667- (EST-TEST5/A4023-OMDB- PARAR/0637F370-VABB)	FF OOMMAIDC 220627 VABBAIDC 2.000081- 3.OOMS003625-4.210322062711- 5.C772- (LRM-RMK/6/7/TEST5)	FF OOMMAIDC 220627 VABBAIDC 2.000081-3.OOMS003625- 4.210322062711-5.C772- (LRM- RMK/6/7/TEST5)	FF VABBAIDC 220627 OOMMAIDC 2.003625-4.210322062708-5.4667- (EST-TEST5/A4023-OMDB- PARAR/0637F370-VABB)	Rejected Error Code 6/7

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
71	FF VABBAIDC 220628 OOMMAIDC 2.003626-4.210322062803- 5.DB71- (ABI-UAE9870/A6207-OMDB-RASKI/0657F390- ZGGG-8/IS-9/B77L/H- 10/SWYDE2E3GHIJ3J5M1P2RXZ/LB1D1- 15/N0479F390 VAXIM L301 RASKI L301 ANKOX L639 BPL A791 JJS Q19 CEA/M083F390 B465 CTG A599 CHILA/N0477F390 A599 LINSO/K0883S1190 A599 GYA-18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP180 260B DOF/210322 REG/A6EFK EET/OOMM0011 SEL/GJEK CODE/896171 PER/D RMK/NRP HAR TCAS ADSB)	FF OOMMAIDC 220628 VABBAIDC 2.000082-3.OOMS003626- 4.210322062805-5.25DE- (LRM- RMK/57/UAE9870/A6207)	FF OOMMAIDC 220628 VABBAIDC 2.000082-3.OOMS003626- 4.210322062805-5.25DE- (LRM- RMK/57/UAE9870/A6207)	FF VABBAIDC 220628 OOMMAIDC 2.003626-4.210322062803-5.DB71- (ABI- UAE9870/A6207-OMDB-RASKI/0657F390- ZGGG-8/IS-9/B77L/H-10/SWYDE2E3 GHIJ3J5M1P2RXZ/LB1D1-15/N0479F390 VAXIM L301 RASKI L301 ANKOX L639 BP L A791 JJS Q19 CEA/M083F390 B465 CTG A599 CHILA/N0477F390 A599 LINSO/ K0883S1190 A599 GYA- 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP 180 260B DOF/210322 REG/A6EFK EET/OOMM0011 SEL/GJEK CODE/896171 PER/D RMK/NRP HAR TCAS ADSB)	Rejected Error Code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
72	FF VABBAIDC 220628 OOMMAIDC 2.003627- 3.VABB000083-4.210322062835- 5.CF71- (LAM)	FF OOMMAIDC 220628 VABBAIDC 2.000083- 4.210322062833-5.E23D- (ABI-IGO9280/A0337-VABB- PARAR/0719F380-OEJN -8/IN -9/A20N/M -10/SDE1FGHIRWYZ/LB1 -15/N0454F380 DOGET N571 PARAR T -18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIZJ EET/OOMM0134 OMAE0243 OEJD0257 SEL/BSCG CODE/800D33 PER/C RMK/ADCM994 FIC220869 OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 BAHRAIN AT P 2012 ON 000780 REPATRIATION FLIGHT RT DESIGNATOR IFLY)	FF OOMMAIDC 220628 VABBAIDC 2.000083-4.210322062833-5.E23D- (ABI-IGO9280/A0337-VABB- PARAR/0719F380-OEJN -8/IN - 9/A20N/M -10/SDE1FGHIRWYZ/LB1 - 15/N0454F380 DOGET N571 PARAR T -18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIZJ EET/OOMM0134 OMAE0243 OEJD0257 SEL/BSCG CODE/800D33 PER/C RMK/ADCM994 FIC220869 OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 BAHRAIN AT P 2012 ON 000780 REPATRIATION FLIGHT RT DESIGNATOR IFLY)	FF VABBAIDC 220628 OOMMAIDC 2.003627-3.VABB000083- 4.210322062835-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
73	FF VABBAIDC 220629 OOMMAIDC 2.003626- 4.210322062903-5.DB71- (ABI-UAE9870/A6207-OMDB- RASKI/0657F390-ZGGG-8/IS-9/B77L/H- 10/SWYDE2E3GHIJ3J5M1P2RXZ/LB1D1- 15/N0479F390 VAXIM L301 RASKI L301 ANKOX L639 BPL A791 JJS Q19 CEA/M083F390 B465 CTG A599 CHILA/N0477F390 A599 LINSO/K0883S1190 A599 GYA- 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP180 260B DOF/210322 REG/A6EFK EET/OOMM0011 SEL/GJEK CODE/896171 PER/D RMK/NRP HAR TCAS ADSB)	FF OOMMAIDC 220629 VABBAIDC 2.000084- 3.OOMS003626-4.210322062905- 5.25DE- (LRM-RMK/57/UAE9870/A6207)	FF OOMMAIDC 220629 VABBAIDC 2.000084-3.OOMS003626- 4.210322062905-5.25DE- (LRM- RMK/57/UAE9870/A6207)	FF VABBAIDC 220629 OOMMAIDC 2.003626-4.210322062903-5.DB71- (ABI-UAE9870/A6207-OMDB- RASKI/0657F390-ZGGG-8/IS- 9/B77L/H-10/SWYDE2E3 GHIJ3J5M1P2RXZ/LB1D1- 15/N0479F390 VAXIM L301 RASKI L301 ANKOX L639 BP L A791 JJS Q19 CEA/M083F390 B465 CTG A599 CHILA/N0477F390 A599 LINSO/ K0883S1190 A599 GYA- 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP 180 260B DOF/210322 REG/A6EFK EET/OOMM0011 SEL/GJEK CODE/896171 PER/D RMK/NRP HAR TCAS ADSB)	Rejected Error Code 57

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
74	FF VABBAIDC 220629 OOMMAIDC 2.003628- 3.VABB000085-4.210322062944- 5.CF71- (LAM)	FF OOMMAIDC 220629 VABBAIDC 2.000085- 4.210322062944-5.2BE1- (ABI-UAE565/A0642-VOBL- TOTOX/0719F360-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6ECR EET/VABF0045 OOMM0219 OMAE0314 SEL/JSDP CODE/896119 PER/D RMK/ADCC539 FIC220167 NRP HAR TCAS ADSB)	FF OOMMAIDC 220629 VABBAIDC 2.000085-4.210322062944-5.2BE1- (ABI-UAE565/A0642-VOBL- TOTOX/0719F360-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6ECR EET/VABF0045 OOMM0219 OMAE0314 SEL/JSDP CODE/896119 PER/D RMK/ADCC539 FIC220167 NRP HAR TCAS ADSB)	FF VABBAIDC 220629 OOMMAIDC 2.003628-3.VABB000085- 4.210322062944-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
75	FF VABBAIDC 220631 OOMMAIDC 2.003629- 3.VABB000086-4.210322063111- 5.CF71- (LAM)	FF OOMMAIDC 220631 VABBAIDC 2.000086- 4.210322063110-5.4D64- (ABI-IGO9280/A0337-VABB- PARAR/0720F380-OEJN -8/IN -9/A20N/M -10/SDE1FGHIRWYZ/LB1 -15/N0454F380 DOGET N571 PARAR T -18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIZJ EET/OOMM0134 OMAE0243 OEJD0257 SEL/BSCG CODE/800D33 PER/C RMK/ADCM994 FIC220869 OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 BAHRAIN AT P 2012 ON 000780 REPATRIATION FLIGHT RT DESIGNATOR IFLY)	FF OOMMAIDC 220631 VABBAIDC 2.000086-4.210322063110-5.4D64- (ABI-IGO9280/A0337-VABB- PARAR/0720F380-OEJN -8/IN - 9/A20N/M -10/SDE1FGHIRWYZ/LB1 - 15/N0454F380 DOGET N571 PARAR T -18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIZJ EET/OOMM0134 OMAE0243 OEJD0257 SEL/BSCG CODE/800D33 PER/C RMK/ADCM994 FIC220869 OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 BAHRAIN AT P 2012 ON 000780 REPATRIATION FLIGHT RT DESIGNATOR IFLY)	FF VABBAIDC 220631 OOMMAIDC 2.003629-3.VABB000086- 4.210322063111-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
76	FF VABBAIDC 220633 OOMMAIDC 2.003630- 4.210322063310-5.0A56- (EST-TEST8/A4027-OMAA- KITAL/0643F370-VOCI)	FF OOMMAIDC 220633 VABBAIDC 2.000087- 3.OOMS003630-4.210322063312- 5.FEF4- (LRM-RMK/6/7/TEST8)	FF OOMMAIDC 220633 VABBAIDC 2.000087-3.OOMS003630- 4.210322063312-5.FEF4- (LRM- RMK/6/7/TEST8)	FF VABBAIDC 220633 OOMMAIDC 2.003630-4.210322063310-5.0A56- (EST-TEST8/A4027-OMAA- KITAL/0643F370-VOCI)	Rejected Error Code 6/7

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
77	FF VABBAIDC 220634 OOMMAIDC 2.003631- 3.VABB000088-4.210322063425- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220634 VABBAIDC 2.000088- 4.210322063423-5.8ED1- (ABI-TEST01/A0312-VABB- TOTOX/0724F340-OOMS -8/IS -9/A320/M -10/SDGIRW/C -15/M078F340 BOLIS P574 TOTOX T -18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220634 VABBAIDC 2.000088-4.210322063423-5.8ED1- (ABI-TEST01/A0312-VABB- TOTOX/0724F340-OOMS -8/IS - 9/A320/M -10/SDGIRW/C - 15/M078F340 BOLIS P574 TOTOX T - 18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220634 OOMMAIDC 2.003631-3.VABB000088- 4.210322063425-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
78	FF VABBAIDC 220634 OOMMAIDC 2.003632- 3.VABB000089-4.210322063456- 5.CF71- (LAM)	FF OOMMAIDC 220634 VABBAIDC 2.000089- 4.210322063455-5.DD83- (EST-UAE565/A0642-VOBL- TOTOX/0719F360-OMDB)	FF OOMMAIDC 220634 VABBAIDC 2.000089-4.210322063455-5.DD83- (EST-UAE565/A0642-VOBL- TOTOX/0719F360-OMDB)	FF VABBAIDC 220634 OOMMAIDC 2.003632-3.VABB000089- 4.210322063456-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
79	FF VABBAIDC 220635 OOMMAIDC 2.003634- 3.VABB000091-4.210322063536- 5.CF71- (LAM)	FF OOMMAIDC 220635 VABBAIDC 2.000091- 4.210322063535-5.COF1- (EST-IGO9280/A0337-VABB- PARAR/0720F380-OEJN)	FF OOMMAIDC 220635 VABBAIDC 2.000091-4.210322063535-5.COF1- (EST-IGO9280/A0337-VABB- PARAR/0720F380-OEJN)	FF VABBAIDC 220635 OOMMAIDC 2.003634-3.VABB000091- 4.210322063536-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
80	FF VABBAIDC 220635 OOMMAIDC 2.003635- 3.VABB000091-4.210322063536- 5.66FD- (ACP-IGO9280-VABB-OEJN)	FF OOMMAIDC 220635 VABBAIDC 2.000092- 3.OOMS003635-4.210322063538- 5.CF71- (LAM)	FF OOMMAIDC 220635 VABBAIDC 2.000092-3.OOMS003635- 4.210322063538-5.CF71- (LAM)	FF VABBAIDC 220635 OOMMAIDC 2.003635-3.VABB000091- 4.210322063536-5.66FD- (ACP- IGO9280-VABB-OEJN)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
81	FF VABBAIDC 220636 OOMMAIDC 2.003636- 4.210322063648-5.7E36- (EST-TEST7/A4025-OOMS- TOTOX/0646F370-VOCI)	FF OOMMAIDC 220636 VABBAIDC 2.000093- 3.OOMS003636-4.210322063651- 5.2A1A- (LRM-RMK/6/7/TEST7)	FF OOMMAIDC 220636 VABBAIDC 2.000093-3.OOMS003636- 4.210322063651-5.2A1A- (LRM- RMK/6/7/TEST7)	FF VABBAIDC 220636 OOMMAIDC 2.003636-4.210322063648-5.7E36- (EST-TEST7/A4025-OOMS- TOTOX/0646F370-VOCI)	Rejected Error Code 6/7

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
82	FF VABBAIDC 220639 OOMMAIDC 2.003637- 3.VABB000094-4.210322063925- 5.E133- (LRM-RMK/06/07/TEST01)	FF OOMMAIDC 220639 VABBAIDC 2.000094- 4.210322063923-5.95F7- (EST-TEST01/A0312-VABB- TOTOX/0724F340-OOMS)	FF OOMMAIDC 220639 VABBAIDC 2.000094-4.210322063923-5.95F7- (EST-TEST01/A0312-VABB- TOTOX/0724F340-OOMS)	FF VABBAIDC 220639 OOMMAIDC 2.003637-3.VABB000094- 4.210322063925-5.E133- (LRM- RMK/06/07/TEST01)	Rejected Error Code 6/7

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
83	FF VABBAIDC 220644 OOMMAIDC 2.003638- 3.VABB000095-4.210322064429- 5.CF71- (LAM)	FF OOMMAIDC 220644 VABBAIDC 2.000095- 4.210322064427-5.4482- (ABI-UAE657/A7441-VRMM- KITAL/0734F400-OMDB -8/IS -9/B77W/H -10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/N0485F380 BOLUR L894 KITAL T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B	FF OOMMAIDC 220644 VABBAIDC 2.000095-4.210322064427-5.4482- (ABI-UAE657/A7441-VRMM- KITAL/0734F400-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/N0485F380 BOLUR L894 KITAL T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 REG/A6ECK EET/VABF0035 OOMM0238 OMAE0330 SEL/HPDL CODE/896112	FF VABBAIDC 220644 OOMMAIDC 2.003638-3.VABB000095- 4.210322064429-5.CF71- (LAM)	Processed

DOF/210322 REG/A6ECK EET/VABF0035
 OOMM0238 OMAE0330 SEL/HPDL
 CODE/896112 PER/D RALT/VRMM OOSA
 RMK/NRP HAR TCAS ADSB)

PER/D RALT/VRMM OOSA RMK/NRP
 HAR TCAS ADSB)

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
84 FF VABBAIDC 220647 OOMMAIDC 2.003639- 4.210322064745-5.D240- (EST-UAE9870/A6207-OMDB- RASKI/0657F390-ZGGG)	FF OOMMAIDC 220647 VABBAIDC 2.000096- 3.OOMS003639-4.210322064746- 5.CF71- (LAM)	FF OOMMAIDC 220647 VABBAIDC 2.000096-3.OOMS003639- 4.210322064746-5.CF71- (LAM)	FF VABBAIDC 220647 OOMMAIDC 2.003639-4.210322064745-5.D240- (EST-UAE9870/A6207-OMDB- RASKI/0657F390-ZGGG)	Processed

Muscat System

Mumbai System

Status

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
85	FF VABBAIDC 220647 OOMMAIDC 2.003640- 3.VABB000097-4.210322064750- 5.514D- (LRM-RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	FF OOMMAIDC 220647 VABBAIDC 2.000097- 3.OOMS003639-4.210322064748- 5.B93F- (ACP-UAE9870/A6207-OMDB-ZGGG)	FF OOMMAIDC 220647 VABBAIDC 2.000097-3.OOMS003639- 4.210322064748-5.B93F- (ACP- UAE9870/A6207-OMDB-ZGGG)	FF VABBAIDC 220647 OOMMAIDC 2.003640-3.VABB000097- 4.210322064750-5.514D- (LRM- RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	Rejected Error Code 65

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
86	FF VABBAIDC 220649 OOMMAIDC 2.003641- 3.VABB000098-4.210322064927- 5.CF71- (LAM)	FF OOMMAIDC 220649 VABBAIDC 2.000098- 4.210322064927-5.87FA- (EST-UAE657/A7441-VRMM- KITAL/0734F400-OMDB)	FF OOMMAIDC 220649 VABBAIDC 2.000098-4.210322064927-5.87FA- (EST-UAE657/A7441-VRMM- KITAL/0734F400-OMDB)	FF VABBAIDC 220649 OOMMAIDC 2.003641-3.VABB000098- 4.210322064927-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
87	FF VABBAIDC 220649 OOMMAIDC 2.003642- 3.VABB000098-4.210322064927- 5.9678- (ACP-UAE657-VRMM-OMDB)	FF OOMMAIDC 220649 VABBAIDC 2.000099- 3.OOMS003642-4.210322064930- 5.CF71- (LAM)	FF OOMMAIDC 220649 VABBAIDC 2.000099-3.OOMS003642- 4.210322064930-5.CF71- (LAM)	FF VABBAIDC 220649 OOMMAIDC 2.003642-3.VABB000098- 4.210322064927-5.9678- (ACP- UAE657-VRMM-OMDB)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
88	FF VABBAIDC 220656 OOMMAIDC 2.003643- 3.VABB000100-4.210322065636- 5.CF71- (LAM)	FF OOMMAIDC 220656 VABBAIDC 2.000100- 4.210322065635-5.F97D- (MAC-QTR831-VTBS-OTHH)	FF OOMMAIDC 220656 VABBAIDC 2.000100-4.210322065635-5.F97D- (MAC-QTR831-VTBS-OTHH)	FF VABBAIDC 220656 OOMMAIDC 2.003643-3.VABB000100- 4.210322065636-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
89	FF VABBAIDC 220658 OOMMAIDC 2.003644- 4.210322065831-5.CC63- (ABI-FDB1569/A4035-OMDB- KITAL/0710F310-VRMM-8/IS-9/B738/M- 10/SWYDE1E2E3FGHILORVXZM3J1/B1H- 15/N0443F310 GOLNI P570 KITAL L894 BOLUR L894 LELEM- 18/PBN/A1B1C1D1L1O1S1T1 NAV/GPSRNAV DOF/210322 REG/A6FEH EET/OOMM0015 SEL/BSCR CODE/896379 ORGN/OMDBFDBO RALT/OOMS OPKC VRMM RMK/TCAS CALLSIGN SKYDUBAI)	FF OOMMAIDC 220658 VABBAIDC 2.000101- 3.OOMS003644-4.210322065833- 5.2849- (LRM-RMK/57/FDB1569/A4035)	FF OOMMAIDC 220658 VABBAIDC 2.000101-3.OOMS003644- 4.210322065833-5.2849- (LRM- RMK/57/FDB1569/A4035)	FF VABBAIDC 220658 OOMMAIDC 2.003644-4.210322065831-5.CC63- (ABI-FDB1569/A4035-OMDB- KITAL/0710F310-VRMM-8/IS-9/B738/M- 10/SWYDE1E2 E3FGHILORVXZM3J1/B1H- 15/N0443F310 GOLNI P570 KITAL L894 BOLUR L894 LE LEM- 18/PBN/A1B1C1D1L1O1S1T1 NAV/GPSRNAV DOF/210322 REG/A6FEH EET/OOMM 0015 SEL/BSCR CODE/896379 ORGN/OMDBFDBO RALT/OOMS OPKC VRMM RMK/TCAS CALLSIGN SKYDUBAI)	Rejected Error Code 57

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

90	FF VABBAIDC 220658 OOMMAIDC 2.003645- 4.210322065850-5.E995- (ABI-UAE660/A4036-OMDB- KITAL/0715F370-VRMM-8/IS-9/B77W/H- 10/SWYDE2E3GHIJ1J3J4J5M1P2RXZ/LB1D1- 15/N0485F370 GOLNI P570 KITAL L894 BOLUR L894 LELEM L3A- 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP180 260B DOF/210322 REG/A6EPC EET/OOMM0012 SEL/CJLQ CODE/8963D2 PER/D RALT/OOMS VRMM RMK/NRP HAR TCAS ADSB)	FF OOMMAIDC 220658 VABBAIDC 2.000102- 3.OOMS003645-4.210322065852- 5.C110- (LRM-RMK/57/UAE660/A4036)	FF OOMMAIDC 220658 VABBAIDC 2.000102-3.OOMS003645- 4.210322065852-5.C110- (LRM- RMK/57/UAE660/A4036)	FF VABBAIDC 220658 OOMMAIDC 2.003645-4.210322065850-5.E995- (ABI-UAE660/A4036-OMDB- KITAL/0715F370-VRMM-8/IS- 9/B77W/H-10/SWYDE2E3G HIJ1J3J4J5M1P2RXZ/LB1D1- 15/N0485F370 GOLNI P570 KITAL L894 BOLUR L894 LELEM L3A- 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP180 260B DOF/210322 REG/A6EPC EET/OOMM0012 SEL/CJLQ CODE/8963D2 PER/D RALT/OOM S VRMM RMK/NRP HAR TCAS ADSB)	Rejected Error Code 57
----	--	--	---	--	------------------------------

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

91	FF VABBAIDC 220659 OOMMAIDC 2.003646- 3.VABB000103-4.210322065916- 5.CF71- (LAM)	FF OOMMAIDC 220659 VABBAIDC 2.000103- 4.210322065915-5.3493- (ABI-IGO9631/A0357-VABB- PARAR/0749F360-OMDB -8/IN -9/A21N/M -10/SDE1FGHIRWYZ/LB1 -15/N0453F360 DOGET N571 KIPOL T -18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIUUV EET/OOMM0133 OMAE0246 SEL/KMGQ CODE/8013CF PER/C TALT/VAAH RMK/ADCM998 FIC220877 OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 RT DESIGNATOR IFLY)	FF OOMMAIDC 220659 VABBAIDC 2.000103-4.210322065915-5.3493- (ABI-IGO9631/A0357-VABB- PARAR/0749F360-OMDB -8/IN - 9/A21N/M -10/SDE1FGHIRWYZ/LB1 - 15/N0453F360 DOGET N571 KIPOL T - 18/PBN/A1B1C1D1O2S1S2 NAV/TCAS II EQUIPPED RNP2 CONTINENTAL DOF/210322 REG/VTIUUV EET/OOMM0133 OMAE0246 SEL/KMGQ CODE/8013CF PER/C TALT/VAAH RMK/ADCM998 FIC220877 OVRFLT PERMITS OMAN DAT OF INGO 0008 2020 GCAPIGO0122 RT DESIGNATOR IFLY)	FF VABBAIDC 220659 OOMMAIDC 2.003646-3.VABB000103- 4.210322065916-5.CF71- (LAM)	Processed
----	--	---	---	---	-----------

Muscat System		Mumbai System		Status
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected

92	<p>FF VABBAIDC 220659 OOMMAIDC 2.003644- 4.210322065932-5.CC63- (ABI-FDB1569/A4035-OMDB- KITAL/0710F310-VRMM-8/IS-9/B738/M- 10/SWYDE1E2E3FGHILORVXZM3J1/B1H- 15/N0443F310 GOLNI P570 KITAL L894 BOLUR L894 LELEM- 18/PBN/A1B1C1D1L1O1S1T1 NAV/GPSRNAV DOF/210322 REG/A6FEH EET/OOMM0015 SEL/BSCR CODE/896379 ORGN/OMDBFDBO RALT/OOMS OPKC VRMM RMK/TCAS CALLSIGN SKYDUBAI)</p>	<p>FF OOMMAIDC 220659 VABBAIDC 2.000104- 3.OOMS003644-4.210322065933- 5.2849- (LRM-RMK/57/FDB1569/A4035)</p>	<p>FF OOMMAIDC 220659 VABBAIDC 2.000104-3.OOMS003644- 4.210322065933-5.2849- (LRM- RMK/57/FDB1569/A4035)</p>	<p>FF VABBAIDC 220659 OOMMAIDC 2.003644-4.210322065932-5.CC63- (ABI-FDB1569/A4035-OMDB- KITAL/0710F310-VRMM-8/IS- 9/B738/M-10/SWYDE1E2 E3FGHILORVXZM3J1/B1H- 15/N0443F310 GOLNI P570 KITAL L894 BOLUR L894 LE LEM- 18/PBN/A1B1C1D1L1O1S1T1 NAV/GPSRNAV DOF/210322 REG/A6FEH EET/OOMM 0015 SEL/BSCR CODE/896379 ORGN/OMDBFDBO RALT/OOMS OPKC VRMM RMK/TCAS CALLSIGN SKYDUBAI)</p>	<p>Rejected Error Code 57</p>
----	---	--	---	--	---

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
93	FF VABBAIDC 220659 OOMMAIDC 2.003645- 4.210322065950-5.E995- (ABI-UAE660/A4036-OMDB- KITAL/0715F370-VRMM-8/IS-9/B77W/H- 10/SWYDE2E3GHIJ1J3J4J5M1P2RXZ/LB1D1- 15/N0485F370 GOLNI P570 KITAL L894 BOLUR L894 LELEM L3A- 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP180 260B DOF/210322 REG/A6EPC EET/OOMM0012 SEL/CJLQ CODE/8963D2 PER/D RALT/OOMS VRMM RMK/NRP HAR TCAS ADSB)	FF OOMMAIDC 220659 VABBAIDC 2.000105- 3.OOMS003645-4.210322065952- 5.C110- (LRM-RMK/57/UAE660/A4036)	FF OOMMAIDC 220659 VABBAIDC 2.000105-3.OOMS003645- 4.210322065952-5.C110- (LRM- RMK/57/UAE660/A4036)	FF VABBAIDC 220659 OOMMAIDC 2.003645-4.210322065950-5.E995- (ABI-UAE660/A4036-OMDB- KITAL/0715F370-VRMM-8/IS- 9/B77W/H-10/SWYDE2E3G HIJ1J3J4J5M1P2RXZ/LB1D1- 15/N0485F370 GOLNI P570 KITAL L894 BOLUR L894 LELEM L3A- 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FAN SUR/RSP180 260B DOF/210322 REG/A6EPC EET/OOMM0012 SEL/CJLQ CODE/8963D2 PER/D RALT/OOM S VRMM RMK/NRP HAR TCAS ADSB)	Rejected Error Code 57

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
94	FF VABBAIDC 220700 OOMMAIDC 2.003647- 4.210322070050-5.0DE4- (EST-FDB1569/A4035-OMDB- KITAL/0710F310-VRMM)	FF OOMMAIDC 220700 VABBAIDC 2.000106- 3.OOMS003647-4.210322070053- 5.CF71- (LAM)	FF OOMMAIDC 220700 VABBAIDC 2.000106-3.OOMS003647- 4.210322070053-5.CF71- (LAM)	FF VABBAIDC 220700 OOMMAIDC 2.003647-4.210322070050-5.0DE4- (EST-FDB1569/A4035-OMDB- KITAL/0710F310-VRMM)	Processed

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
95	FF VABBAIDC 220700 OOMMAIDC 2.003648- 3.VABB000107-4.210322070055- 5.514D- (LRM-RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	FF OOMMAIDC 220700 VABBAIDC 2.000107- 3.OOMS003647-4.210322070055- 5.6820- (ACP-FDB1569/A4035-OMDB-VRMM)	FF OOMMAIDC 220700 VABBAIDC 2.000107-3.OOMS003647- 4.210322070055-5.6820- (ACP- FDB1569/A4035-OMDB-VRMM)	FF VABBAIDC 220700 OOMMAIDC 2.003648-3.VABB000107- 4.210322070055-5.514D- (LRM- RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	Rejected Error Code 65

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
96	FF VABBAIDC 220702 OOMMAIDC 2.003649- 3.VABB000108-4.210322070208- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T	FF OOMMAIDC 220702 VABBAIDC 2.000108- 4.210322070206-5.1EA1- (ABI-TEST02/A0312-VABB- TOTOX/0749F340-OOMS -8/IS -9/A320/M -10/SDGIRW/C -15/M078F340 BOLIS P574 TOTOX T -18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220702 VABBAIDC 2.000108-4.210322070206-5.1EA1- (ABI-TEST02/A0312-VABB- TOTOX/0749F340-OOMS -8/IS - 9/A320/M -10/SDGIRW/C - 15/M078F340 BOLIS P574 TOTOX T - 18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220702 OOMMAIDC 2.003649-3.VABB000108- 4.210322070208-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
97	FF VABBAIDC 220704 OOMMAIDC 2.003650- 3.VABB000109-4.210322070417- 5.CF71- (LAM)	FF OOMMAIDC 220704 VABBAIDC 2.000109- 4.210322070414-5.3B05- (EST-IGO9631/A0357-VABB- PARAR/0749F360-OMDB)	FF OOMMAIDC 220704 VABBAIDC 2.000109-4.210322070414-5.3B05- (EST-IGO9631/A0357-VABB- PARAR/0749F360-OMDB)	FF VABBAIDC 220704 OOMMAIDC 2.003650-3.VABB000109- 4.210322070417-5.CF71- (LAM)	Processed

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
98	FF VABBAIDC 220704 OOMMAIDC 2.003651- 3.VABB000109-4.210322070417- 5.877D- (ACP-IGO9631-VABB-OMDB)	FF OOMMAIDC 220704 VABBAIDC 2.000110- 3.OOMS003651-4.210322070419- 5.CF71- (LAM)	FF OOMMAIDC 220704 VABBAIDC 2.000110-3.OOMS003651- 4.210322070419-5.CF71- (LAM)	FF VABBAIDC 220704 OOMMAIDC 2.003651-3.VABB000109- 4.210322070417-5.877D- (ACP- IGO9631-VABB-OMDB)	Processed

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
99	FF VABBAIDC 220704 OOMMAIDC 2.003652- 3.VABB000111-4.210322070429- 5.B460- (LRM-RMK/06/07/TEST02)	FF OOMMAIDC 220704 VABBAIDC 2.000111- 4.210322070426-5.330C- (EST-TEST02/A0312-VABB- TOTOX/0749F340-OOMS)	FF OOMMAIDC 220704 VABBAIDC 2.000111-4.210322070426-5.330C- (EST-TEST02/A0312-VABB- TOTOX/0749F340-OOMS)	FF VABBAIDC 220704 OOMMAIDC 2.003652-3.VABB000111- 4.210322070429-5.B460- (LRM- RMK/06/07/TEST02)	Rejected Error Code 6/7

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
100	FF VABBAIDC 220704 OOMMAIDC 2.003653- 3.VABB000112-4.210322070453- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220704 VABBAIDC 2.000112- 4.210322070451-5.4085- (ABI-TEST03/A0312-VABB- TOTOX/0755F360-OOMS -8/IS -9/A320/M -10/SDGIRW/C -15/M078F340 BOLIS P574 TOTOX T -18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220704 VABBAIDC 2.000112-4.210322070451-5.4085- (ABI-TEST03/A0312-VABB- TOTOX/0755F360-OOMS -8/IS - 9/A320/M -10/SDGIRW/C - 15/M078F340 BOLIS P574 TOTOX T - 18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220704 OOMMAIDC 2.003653-3.VABB000112- 4.210322070453-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

Muscat System	Mumbai System	Status
---------------	---------------	--------

	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
101	FF VABBAIDC 220705 OOMMAIDC 2.003654- 4.210322070522-5.965C- (EST-UAE660/A4036-OMDB- KITAL/0715F370-VRMM)	FF OOMMAIDC 220705 VABBAIDC 2.000113- 3.OOMS003654-4.210322070523- 5.CF71- (LAM)	FF OOMMAIDC 220705 VABBAIDC 2.000113-3.OOMS003654- 4.210322070523-5.CF71- (LAM)	FF VABBAIDC 220705 OOMMAIDC 2.003654-4.210322070522-5.965C- (EST-UAE660/A4036-OMDB- KITAL/0715F370-VRMM)	Processed

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
102	FF VABBAIDC 220705 OOMMAIDC 2.003655- 3.VABB000114-4.210322070526- 5.514D- (LRM-RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	FF OOMMAIDC 220705 VABBAIDC 2.000114- 3.OOMS003654-4.210322070525- 5.8452- (ACP-UAE660/A4036-OMDB-VRMM)	FF OOMMAIDC 220705 VABBAIDC 2.000114-3.OOMS003654- 4.210322070525-5.8452- (ACP- UAE660/A4036-OMDB-VRMM)	FF VABBAIDC 220705 OOMMAIDC 2.003655-3.VABB000114- 4.210322070526-5.514D- (LRM- RMK/65/MSG SEQUENCE ERROR : RECEIVED MSG ACP)	Rejected Error Code 65

Muscat System		Mumbai System		Status	
Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected	
103	FF VABBAIDC	FF OOMMAIDC 220712 VABBAIDC 2.000115- 4.210322071215-5.5A99-	FF OOMMAIDC 220712 VABBAIDC 2.000115-4.210322071215-5.5A99- (ABI-AXB1639/A0662-VOTR-	FF VABBAIDC 220712 OOMMAIDC 2.003656-3.VABB000115- 4.210322071218-5.CF71- (LAM)	Processed

	220712 OOMMAIDC 2.003656-3.VABB000115-4.210322071218-5.CF71-(LAM)	(ABI-AXB1639/A0662-VOTR-LOTAV/0802F360-OMAA -8/IS -9/B738/M -10/SDFGHIM1RWYZ/LB1 -15/N0462F360 KADOL M300 GADMA T -18/PBN/A1B1C1D1O2S2 NAV/RNP2 DOF/210322 REG/VTGHB EET/VABF0109 OOMM0256 OMAE0352 SEL/ARCF CODE/800B9A ORGN/VABBAICO BOMOBAL RALT/VOCI OOMS TALT/VOCI RMK/TCAS UNITED ARAB EMIRATES GCAPAXB0123 VBM REPATRIATION C95IN LANDING PERMIT ADACPERM203020 OMAN DATOFAXB00022021)	LOTAV/0802F360-OMAA -8/IS -9/B738/M -10/SDFGHIM1RWYZ/LB1 -15/N0462F360 KADOL M300 GADMA T -18/PBN/A1B1C1D1O2S2 NAV/RNP2 DOF/210322 REG/VTGHB EET/VABF0109 OOMM0256 OMAE0352 SEL/ARCF CODE/800B9A ORGN/VABBAICO BOMOBAL RALT/VOCI OOMS TALT/VOCI RMK/TCAS UNITED ARAB EMIRATES GCAPAXB0123 VBM REPATRIATION C95IN LANDING PERMIT ADACPERM203020 OMAN DATOFAXB00022021)		
--	---	---	---	--	--

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
104	FF VABBAIDC 220713 OOMMAIDC 2.003657-3.VABB000116-4.210322071327-5.1D5F-	FF OOMMAIDC 220713 VABBAIDC 2.000116-4.210322071325-5.737E-	FF OOMMAIDC 220713 VABBAIDC 2.000116-4.210322071325-5.737E-(ABI-TEST04/A0331-VABB-TOTOX/0803F380-OOMS -8/IS -	FF VABBAIDC 220713 OOMMAIDC 2.003657-3.VABB000116-4.210322071327-5.1D5F- (LRM-RMK/41/15/BOLIS P574 LOSIM T)	Rejected Error Code 41/15

	(LRM-RMK/41/15/BOLIS P574 LOSIM T)	(ABI-TEST04/A0331-VABB-TOTOX/0803F380-OOMS -8/IS -9/A320/M -10/SDGIRW/C -15/M078F340 BOLIS P574 LOSIM T -18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)	9/A320/M -10/SDGIRW/C -15/M078F340 BOLIS P574 LOSIM T -18/PBN/A1B1D1 RMK/THIS IS TEST FPL PLZ IGNORE)		
--	------------------------------------	---	---	--	--

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
105	FF VABBAIDC 220717 OOMMAIDC 2.003658-3.VABB000117-4.210322071716-5.CF71- (LAM)	FF OOMMAIDC 220717 VABBAIDC 2.000117-4.210322071713-5.6578- (EST-AXB1639/A0662-VOTR-LOTAV/0802F360-OMAA)	FF OOMMAIDC 220717 VABBAIDC 2.000117-4.210322071713-5.6578- (EST-AXB1639/A0662-VOTR-LOTAV/0802F360-OMAA)	FF VABBAIDC 220717 OOMMAIDC 2.003658-3.VABB000117-4.210322071716-5.CF71- (LAM)	Processed

Muscat System		Mumbai System		Status	
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
106	FF VABBAIDC 220717 OOMMAIDC 2.003659-3.VABB000117-4.210322071716-5.DFE3-	FF OOMMAIDC 220717 VABBAIDC 2.000118-3.OOMS003659-4.210322071717-5.CF71-	FF OOMMAIDC 220717 VABBAIDC 2.000118-3.OOMS003659-4.210322071717-5.CF71- (LAM)	FF VABBAIDC 220717 OOMMAIDC 2.003659-3.VABB000117-4.210322071716-5.DFE3- (ACP-AXB1639-VOTR-OMAA)	Processed

(ACP-AXB1639-VOTR-OMAA)

(LAM)

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
107	FF VABBAIDC 220718 OOMMAIDC 2.003660- 3.VABB000119-4.210322071816- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220718 VABBAIDC 2.000119- 4.210322071815-5.8B6C- (ABI-TEST05/A0350-VOBL- TOTOX/0804A100-OMDB -8/IS -9/B77W/H -10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220718 VABBAIDC 2.000119-4.210322071815-5.8B6C- (ABI-TEST05/A0350-VOBL- TOTOX/0804A100-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220718 OOMMAIDC 2.003660-3.VABB000119- 4.210322071816-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
108	FF VABBAIDC 220718 OOMMAIDC 2.003661- 3.VABB000120-4.210322071837- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220718 VABBAIDC 2.000120- 4.210322071836-5.15AE- (ABI-TEST05/A0350-VOBL- TOTOX/0807A100-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220718 VABBAIDC 2.000120-4.210322071836-5.15AE- (ABI-TEST05/A0350-VOBL- TOTOX/0807A100-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220718 OOMMAIDC 2.003661-3.VABB000120- 4.210322071837-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
109	FF VABBAIDC 220719 OOMMAIDC 2.003662- 3.VABB000121-4.210322071933- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220719 VABBAIDC 2.000121- 4.210322071932-5.A7BB- (ABI-TEST05/A0316-VOBL- TOTOX/0808A100-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220719 VABBAIDC 2.000121-4.210322071932-5.A7BB- (ABI-TEST05/A0316-VOBL- TOTOX/0808A100-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220719 OOMMAIDC 2.003662-3.VABB000121- 4.210322071933-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
110	FF VABBAIDC 220719 OOMMAIDC 2.003663- 3.VABB000122-4.210322071952- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220719 VABBAIDC 2.000122- 4.210322071951-5.AA1A- (ABI-TEST05/A0316-VOBL- TOTOX/0810A100-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220719 VABBAIDC 2.000122-4.210322071951-5.AA1A- (ABI-TEST05/A0316-VOBL- TOTOX/0810A100-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220719 OOMMAIDC 2.003663-3.VABB000122- 4.210322071952-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
111	FF VABBAIDC 220719 OOMMAIDC 2.003664- 3.VABB000123-4.210322071959- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220719 VABBAIDC 2.000123- 4.210322071958-5.6286- (ABI-TEST05/A0316-VOBL- TOTOX/0810F340-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220719 VABBAIDC 2.000123-4.210322071958-5.6286- (ABI-TEST05/A0316-VOBL- TOTOX/0810F340-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220719 OOMMAIDC 2.003664-3.VABB000123- 4.210322071959-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
112	FF VABBAIDC 220721 OOMMAIDC 2.003665- 3.VABB000124-4.210322072155- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220721 VABBAIDC 2.000124- 4.210322072153-5.D1E1- (ABI-TEST05/A0316-VOBL- TOTOX/0815F340-OMDB -8/IS -9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220721 VABBAIDC 2.000124-4.210322072153-5.D1E1- (ABI-TEST05/A0316-VOBL- TOTOX/0815F340-OMDB -8/IS - 9/B77W/H - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M085F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220721 OOMMAIDC 2.003665-3.VABB000124- 4.210322072155-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

	Muscat System		Mumbai System		Status
	Transmitted (TX)	Received (RX)	Transmitted (TX)	Received (RX)	Processed / Rejected
113	FF VABBAIDC 220722 OOMMAIDC 2.003666- 3.VABB000125-4.210322072226- 5.9C17- (LRM-RMK/41/15/BOLIS P574 TOTOX T)	FF OOMMAIDC 220722 VABBAIDC 2.000125- 4.210322072225-5.8A99- (ABI-TEST05/A0316-VOBL- TOTOX/0815F340-OMDB -8/IS -9/A320/M - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M078F340 BOLIS P574 TOTOX T -18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF OOMMAIDC 220722 VABBAIDC 2.000125-4.210322072225-5.8A99- (ABI-TEST05/A0316-VOBL- TOTOX/0815F340-OMDB -8/IS - 9/A320/M - 10/SDE2E3FGHIJ3J5M1P2RWXYZ/LB1D1 -15/M078F340 BOLIS P574 TOTOX T - 18/PBN/A1B1C1D1L1O1S2T1 NAV/RNP2 DAT/1FANSP CPDLCX SUR/RSP180 260B DOF/210322 EET/VABF0045 OOMM0219 OMAE0314 PER/D RMK/THIS IS TEST FPL PLZ IGNORE)	FF VABBAIDC 220722 OOMMAIDC 2.003666-3.VABB000125- 4.210322072226-5.9C17- (LRM- RMK/41/15/BOLIS P574 TOTOX T)	Rejected Error Code 41/15

-END-