

SUMMARY OF THE WEB TELECONFERENCE OF 9 OCTUBER 2012

FOLLOW-UP TO THE IMPLEMENTATION OF THE NEW FLIGHT PLAN FORMAT

States invited

Argentina	Ecuador	Uruguay
Bolivia	Panamá	Venezuela
Chile	Paraguay	
Colombia	Perú	

Users

AviancaTACA

List of participants

Argentina

Moirá Callegare	mcallegare@anac.gov.ar
Omar Gouarnalusse	ogouarnalusse@gmail.com
Pablo Collazo	pcollazo@anac.gov.ar

Chile

Marcial Vidal	mvidal@dgac.cl
---------------	----------------

Colombia

Oscar Arturo Alfonso Bravo	oscar.alfonso@aerocivil.gov.co
----------------------------	--------------------------------

Paraguay

David Torres	dr.torres33@gmail.com
--------------	-----------------------

Uruguay

Rosanna Barú	rbaru@dinacia.gub.uy
--------------	----------------------

Venezuela

Vicente Fiore	v.fiore@inac.gob.ve
Benjamin Urquilla	buquilla@gmail.com
Wilfredo Gil	w.gil@inac.gob.ve

Bolivia, Brazil and Panama did not participate in the teleconference, but submitted information on the progress made in the implementation of the NEW flight plan format.

OACI/ICAO

Onofrio Smarrelli, Oficial Regional CNS	osmarrelli@icao.int
Celso Figueiredo, Oficial Regional ATM	cfigueiredo@icao.int

Summary

The GoTo meeting web teleconference was carried out on 9 October 2012 from 09:00 to 10:30 am, by analyzing the following Agenda items:

1. Updating of the SAM list of focal points;
2. Updating of FITS;
3. Progress in the implementation of the new FPL national action plans;
4. Results of the scheduled trials;
5. Results of SAM/IG/10 meeting; and
6. Next activities.

1. Updating of the SAM list of focal points

1.1 Information was provided on the SAM list of focal points, updated during SAM/IG/10 meeting. In same, participants in the teleconference took note of the changes made regarding the focal points of Argentina, Suriname and Venezuela. **Appendix A** presents information on the updated list. Same has been sent to ICAO HQ in Montreal with the aim of updating the FITS page.

2. Updating of FITS

2.1 The teleconference noted that SAM/IG/10 meeting deemed it important that States inform soonest the date when they would be ready to operate with the NEW flight plan format, since to date very few States had done so.

2.2 In this respect, it was informed that Argentina is receiving the NEW flight plan format since 1 September 2012; Brazil since 1 July 2012; and Chile since 1 October 2012.

2.3 Also, during the teleconference information was provided that SAM/IG/10 meeting (Lima, Peru, 1-5 October 2012), with the aim of foreseeing the impact of the new flight plan format implementation at the stipulated date, and in view that:

- a) air traffic flow will increase due to the high season,
- b) the workload will increase in the services that use free text, preventing data validation, and thus generating safety risks,
- c) several States are in the process of installing and/or updating their AMHS and/or FDP systems necessary for the implementation,
- d) there are States that lack the human resources and/or equipment to face this increase in workload.
- e) the Contingency Plan procedure will be applied during extended periods of time until implementation is achieved with the required safety standard,

considered that, SAM States that have not done it yet, inform the ICAO South American Regional Office, by 17 October 2012, the date in which they will start accepting the NEW flight plan format, so that ICAO may update the FITS website (<http://www2.icao.int/en/FITS/Pages/home.aspx>) for display to all the global aeronautical community, formulating Conclusion SAM/IG/10-4.

2.4 The ICAO SAM Regional Office sent a letter in this regard to all States of the Region, with the exception of those States already having informed the aeronautical community on the date they would be ready to accept the NEW flight plan format, in follow-up to the afore mentioned Conclusion.

2.5 In the teleconference, the focal points of Paraguay, Peru, Uruguay and Venezuela informed they would start accepting the NEW flight plan format as of 1 November 2012.

3. **Progress in the implementation of the new FPL national action plans**

3.1 Hereunder is information on the progress made in the implementation activities for the NEW FPL in the SAM Region.

Argentina

3.2 The updating of national documentation related with the NEW FPL continues, as well as the respective works on safety assessment, and the contingency plan. They participated in the trials of 27 September 2012 with a group of States of the Region and TACA. Implementation of the national training plan on the NEW FPL continues.

Bolivia

3.3 The activities taken under consideration are being complied with, nevertheless, in some cases the tasks could not be conducted in the scheduled dates, but actions have been carried out. Work is being done on the updating of national documentation regarding the NEW FPL, as well as in the safety assessment and the contingency plan. Also, implementation of the training programme continues. With the aim of conducting regional tests, a router is being purchased, which would be implemented before 1 November 2012. The AMHS terminals at El Alto (La Paz international airport) already count with the NEW FPL template. The ACC will work manually.

Brasil

3.4 All information on the activities carried out by Brazil regarding Amendment 1 are available at the www.decea.gov.br/emenda1 website. Hereunder is a description of activities related with legislation, safety, automated systems and training.

Legislation

3.5 All Brazilian legislation is updated, in accordance with Amendment 1. AIC 14/11 was edited on 28 July 2011, it informs Brazilian airspace users on the planning for the implementation of Amendment 1 and its contents. In addition, the following standards were updated (available at):

- ICA 100-11 and ICA 100-34 – Flight plan;
- MCA 100-11 and MCA 100-17– Filling of the flight plan form; and
- ICA 100-15 and ICA 100-35 –ATS messages.

3.6 Finally, AIC 07/12 of 31 May 2012 establishes operational procedures for the implementation of Amendment 1 during the transition period. After 15, November, standards ICA 100-11, MCA 100-11 and ICA100-15 will be updated to incorporate standards ICA 100-34, MCA 100-17 and ICA 100-35, respectively.

Safety assessment

3.7 The Safety Assessment document was drafted on the basis of the evaluation made to the changes required with Amendment 1 and would make impact on air traffic control operations. This document was signed by various authorities from the Brazilian Air Traffic Control System, in guarantee that its impact will not affect safety.

Automated systems

3.8 The strategy used for the automated systems was the use of translators (TRA and TSX) capable of making the changes from the NEW to the CURRENT format, when necessary. Figure 1 hereunder describes the structure.

3.9 The TRA translator was installed in Brasilia and Manaus for communications with neighbouring countries. The TRA is capable of storing flight plans in accordance with DOF (Day of Flight) information, as well as update information in accordance with DLA, CHG y CNL messages. In addition, TRA is capable of translating the NEW to CURRENT message format for their remittance to non-adhering States.

3.10 The TSX translator was installed at the ACC FDPs for up to 120 h storage, updating of messages and interpretation of new information contained in the flight plan for presentation to the air traffic controller.

3.11 For the entry of flight plan data and updating messages, the terminals located in the AIS rooms were updated (more than 160). The changes made in these terminals will decrease errors in the filling of the flight plan.

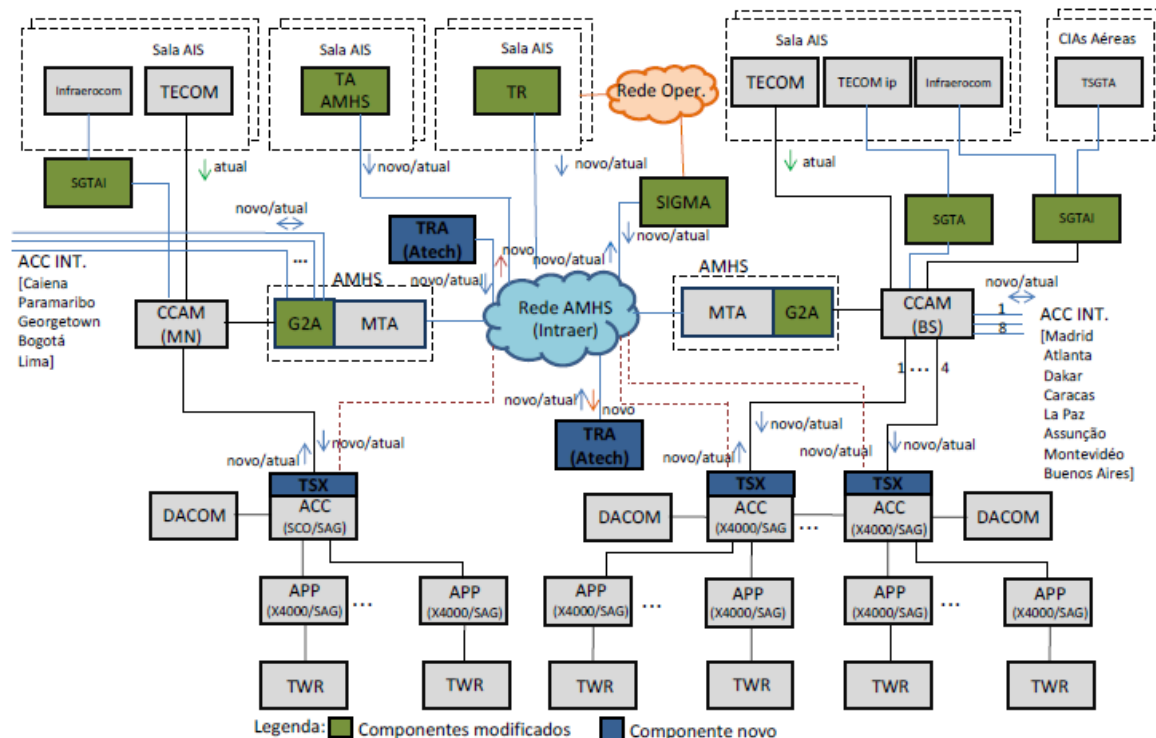


Fig. 1 – Implementation of Amendment 1 at the Brazilian automated systems

Training

3.12 The first part of the training, involving AIS, ATCO, pilots, flight dispatchers, etc. was concluded, reaching 80% of the total public. This phase permitted operators and technicians to become aware of Amendment 1 and its impact. The last training phase was completed in June 2012, guaranteeing operators and technicians to have knowledge of all modifications to Brazilian standards with respect to Amendment 1, modifications in the automated systems and contingency measures in the event of problems.

Chile

3.13 Training to AIS, ARO, ATS personnel and users was completed, and the contingency plan was drafted. The updating of documentation in reference to the NEW FPL will be completed before 15 November. The NEW format templates have been installed at the AMHS, the changes in the Santiago ACC FDP would be completed by March 2013.

Colombia

3.14 Updating of the documentation is in process. The updating of the letters of agreement with adjacent ACC States would be completed by May 2014. Changes in the Bogota ACC FDP systems and implementation of NEW FPL template at the AMHS are scheduled for 15 February 2013, meanwhile, a national converter for the NEW to CURRENT FPL will be implemented in Bogotá.

3.15 The contingency plan is completed and as to the training plan, 30% of the ATS personnel and 60% of the AIS staff have received it.

Panamá

3.16 Informs that the activities taken under consideration in the national action plan have been completed almost totally, only some modifications with regard to the extension in the conduct of the training programme for internal reinforcement as a service provider, and to the external such as dialogues with COPA, as major user in the emission of exit flight plans from Panama (the last training to this user would be on 30 October 2012).

3.17 They are already accepting the NEW FPL (AIC A007/12), but under manual processing. The date for the automation of the systems (AMHS and FDP) as per Amendment 1 will not become effective until the end of August 2013.

3.18 Trials using 15 real flight plans were conducted with COPA on 20 September 2012; all these flight plans were processed manually by Tocumen airport ARO/AIS personnel, who are all trained for the manual processing of this task.

3.19 The whole operation was conducted on the basis of Amendment 1 guidelines (Attachment on new to current data conversion – Conversion tables). In the last tests carried out on 26 September with Colombia (adjacent FIR), each exchanged 5 flight plans. Colombia indicated that the five messages entered its system normally, but that at the end of the message a question mark appeared. The exit messages were reviewed, and corrections were made. Panamá processed only two of the five flight plan messages sent by Colombia, because three of them were sent out of the Panama FIR scope (dis not overfly the airspace). They were processed in the AMHS for internal practical purposes, but did not reflect the incidence to that end. In this respect, information was received that Colombia and Panama were prepared to face the implementation of the NEW flight format.

3.20 Next activities: a second training will be carried out with COPA on 30 October 2012, and in the beginning of November real trials will be conducted with COPA for a whole day to all COPA destinations and using manual processing.

Paraguay

3.21 The national documentation related with the NEW FPL is being updated, and a NOTAM will be issued informing that of 1 November 2012 the NEW FPL will be accepted. The safety assessment has been completed, and a contingency plan has been drafted. The AMHS have the NEW flight plan format template installed; the Asuncion ACC FDP accepts alphanumeric characters in the NEW FPL Box 10, but with a defined number of characters, and all changes in box 18. If more than 10 characters are introduced in box 10, the FDP rejects them; there are no problems with box 18. An additional controller per shift has been scheduled at the Asuncion ACC, to support in the reinsertion of the rejected FPL into the FDP. The training plan has been completed, pending only one seminar for the users.

Uruguay

3.22 Informs it is working to amend its national documentation. It will issue a NOTAM informing readiness to receive the NEW FPL as of 1 November 2012. Work continues to complete the safety assessment and draft the contingency plan. The new FDP (INDRA AIRCON 2100) arrived in Uruguay and its installation will start soon. The AFTN terminals do not have the NEW format template installed, therefore, the flight plan will be drafted under a free text mode. The training plan for AIS, ATS staff and users is still to be completed.

Venezuela

3.23 Work is being carried out for the updating of national documentation related with the FPL, and will be issuing a NOTAM informing they will be receiving the NEW FPL as of 1 November 2012. They have drafted a contingency plan to meet the flight plans rejected by the Maiquetia ACC, since it foresees that changes in the FDP might occur after 15 November. They have started consultations with ATECH for the implementation of a converter at Maiquetia. The AMHS terminals already have the NEW FPL template. The training plan is pending completion.

Summary on the current regional situation on the implementation of the NEW FPL

3.24 **Appendix C** shows the current situation regarding the implementation of the NEW FPL in the SAM Region.

4. Results of the scheduled trials

4.1 Under this item, the teleconference noted the results of the tests conducted on 27 September 2012 among Argentina, Brazil, Chile, Colombia, Peru, Paraguay and Uruguay. **Appendix D** shows a copy of messages used during the trials. In these tests, participating States could verify operations with the NEW FPL. States could also make tests with the user (TACA AVIANCA). In this respect, participating States thanked the support provided by TACA.

5. Results of SAM/IG/10 meeting

5.1 The teleconference took note of the aspects analysed during SAM/IG/10 meeting. Some of these have been already mentioned in the topics dealt with above.

5.2 Information was provided that SAM/IG/10 meeting, with the aim of continuing with trials among States of the Region and other Regions, as well as users, had coordinated a series of tests among Colombia, Paraguay, Peru, Uruguay, Venezuela and TACA AVIANCA. It was recommended that in addition to FPL trial messages, standardized ATS messages associated to the same FPL be tested, such as DEP, ARR, CHG, CPL, CNL, DLA, RQP and RQS.

5.3 In addition, it was informed that SAM/IG/10 meeting evaluated the need of issuing a NOTAM informing on the starting date for the transmission and reception of the NEW FPL format and the standardized ATS messages, proposing the following text:

Reference: AIC XXX, effective 15 November 2012 for the implementation of the New ICAO Flight Plan and Amendment XXX to AIP XXX for updating the information Part ENR 1.10 on Flight Plan and RPL System Management.

6. Next activities

6.1 Under this item, it was deemed convenient that the next teleconferences be tentatkve held on 2, 14 and 16 November 2012.

- - - - -


APPENDIX A / APENDICE A

PUNTOS FOCALES PARA LA COORDINACIÓN DEL FORMATO DE PLAN DE VUELO / FOCAL POINTS FOR THE COORDINATION OF THE FLIGHT PLAN FORMAT

Estado/State Organization	Autoridad / Authority		E-mail	T / F
	Area	Nombre y título / Name and Title		
1	2	3	5	6
Argentina	CNS	Moirá Lidia Callegare Departamento CNS, ANAC	mcallegare@anac.gov.ar	T: + 5411 5941 3000, Ext. 69716
	AIM	Pablo Collazo Dirección Nacional de los Servicios de Navegación Aérea y Aeródromos, ANAC	pcollazo@anac.gov.ar	T: +5411 5941 3000/10, Ext 69741
Bolivia	ATM	Miguel Castillo Ochoa Jefe Unidad ATM/SAR, DGAC	mcastillo@dgac.gob.bo	T: +591 2 2444450/2114465 C: + 591 72046745 F: +591 2 2114465
Brasil	CNS	Alessander de Andrade Santoro Oficial CNS Departamento de Control del Espacio Aéreo, DECEA	ddte7@decea.gov.br	T: +5521 2101 6209
Chile	ATM	Marcial Vidal Arriagada Controlador de Tránsito Aéreo, DGAC	mvidal@dgac.cl	T: +56 2 290 4709
Colombia	AIM	Oscar Arturo Alfonso Bravo Secretaria de Sistemas Operacionales, UAEAC	oscar.alfonso@aerocivil.gov.co	T: +571 2963065
Ecuador	AIM	Carlos Delgado Toledo, DGAC	carlos_delgado@dgac.gob.ec karlyn_1966@yahoo.com	T: +5932 223 1008
French Guiana		Jean Jacques Deschamps Head, Technical Department for the ANSP in French Antilles and Guyana, DIRAC	jean- jacques.deschamps@aviation- civile.gouv.fr	T: +33696961107
Guyana	ATM	Chaitrani Heeralall Director Air Navigation Services, CAD	dans@gcaa-gy.org	T: +592 261 2217 F: +592 261 2293
	ATM	Rickford Samaroo Manager ATS Operations, CAD	satcori@hotmail.com	T: +592 261 2564 F: +592 261 2279
Panamá	AIM	Hector Gonzalez Chief of Aeronautical Telecommunication, AAC	hgonzalez@aeronautica.gob.pa	T: +507 501 9825/501 9826 F: +507 501 9848
Paraguay	ATM	Liz Rocío Portillo Castellanos Sección Normas y Reglamentos, DINAC	atm-gna@dinac.gov.py lizroportillo@gmail.com	T: +595 21 205 365
	CNS	David Ricardo Torres Sección Terminales AMHS/GTE, DINAC	dr.torres33@gmail.com	T: +595 217585208/9 F: +595 21 7585292
Perú	AIM	Victor Martinez Serna Gerente de Operaciones Aeronáuticas, CORPAC	amartinez@corpac.gob.pe	T: +511 630-1150/630-1151

Estado/State Organization	Autoridad / Authority		E-mail	T / F
	Area	Nombre y título / Name and Title		
1	2	3	5	6
Suriname	AIM	Lunette Rinelda Edam AIS/Maps and Charts and Communication, CAD	ais@cadsur.sr; edamlunette@hotmail.com	T: +597 498-898 F: +597 498-901
	AIM	Sharitadevi A. Radjie AIS/Maps and Charts and Communication, CAD	ais@cadsur.sr; sha12rad@live.com	T: +597 498-898 F: +597 498-901
Uruguay	ATM	Rosanna Barú Banchieri Encargada Departamento de Servicios Aeronáuticos, DINACIA	rbaru@dinacia.gub.uy rocbb17@gmail.com	T: +5982 604 0408, Ext. 4461
Venezuela	ATM	Wilfredo Gil Sánchez Jefe ACC Maiquetía	w.gil@inac.gob.ve	T: +58 426 517 1599 F: +58 212 355 2216
	CNS	Vicente Fiore Jefe de MMTTO RadarMaiquetía, INAC	v.fiore@inac.gob.ve	T: +58 4166235643
	AIM	Benjamín Uquillas Jefe Subcentro Comunicaciones Maiquetía, INAC	buquillas@gmail.com	T: +58 412 721 5068

APPENDIX B / APENDICE B

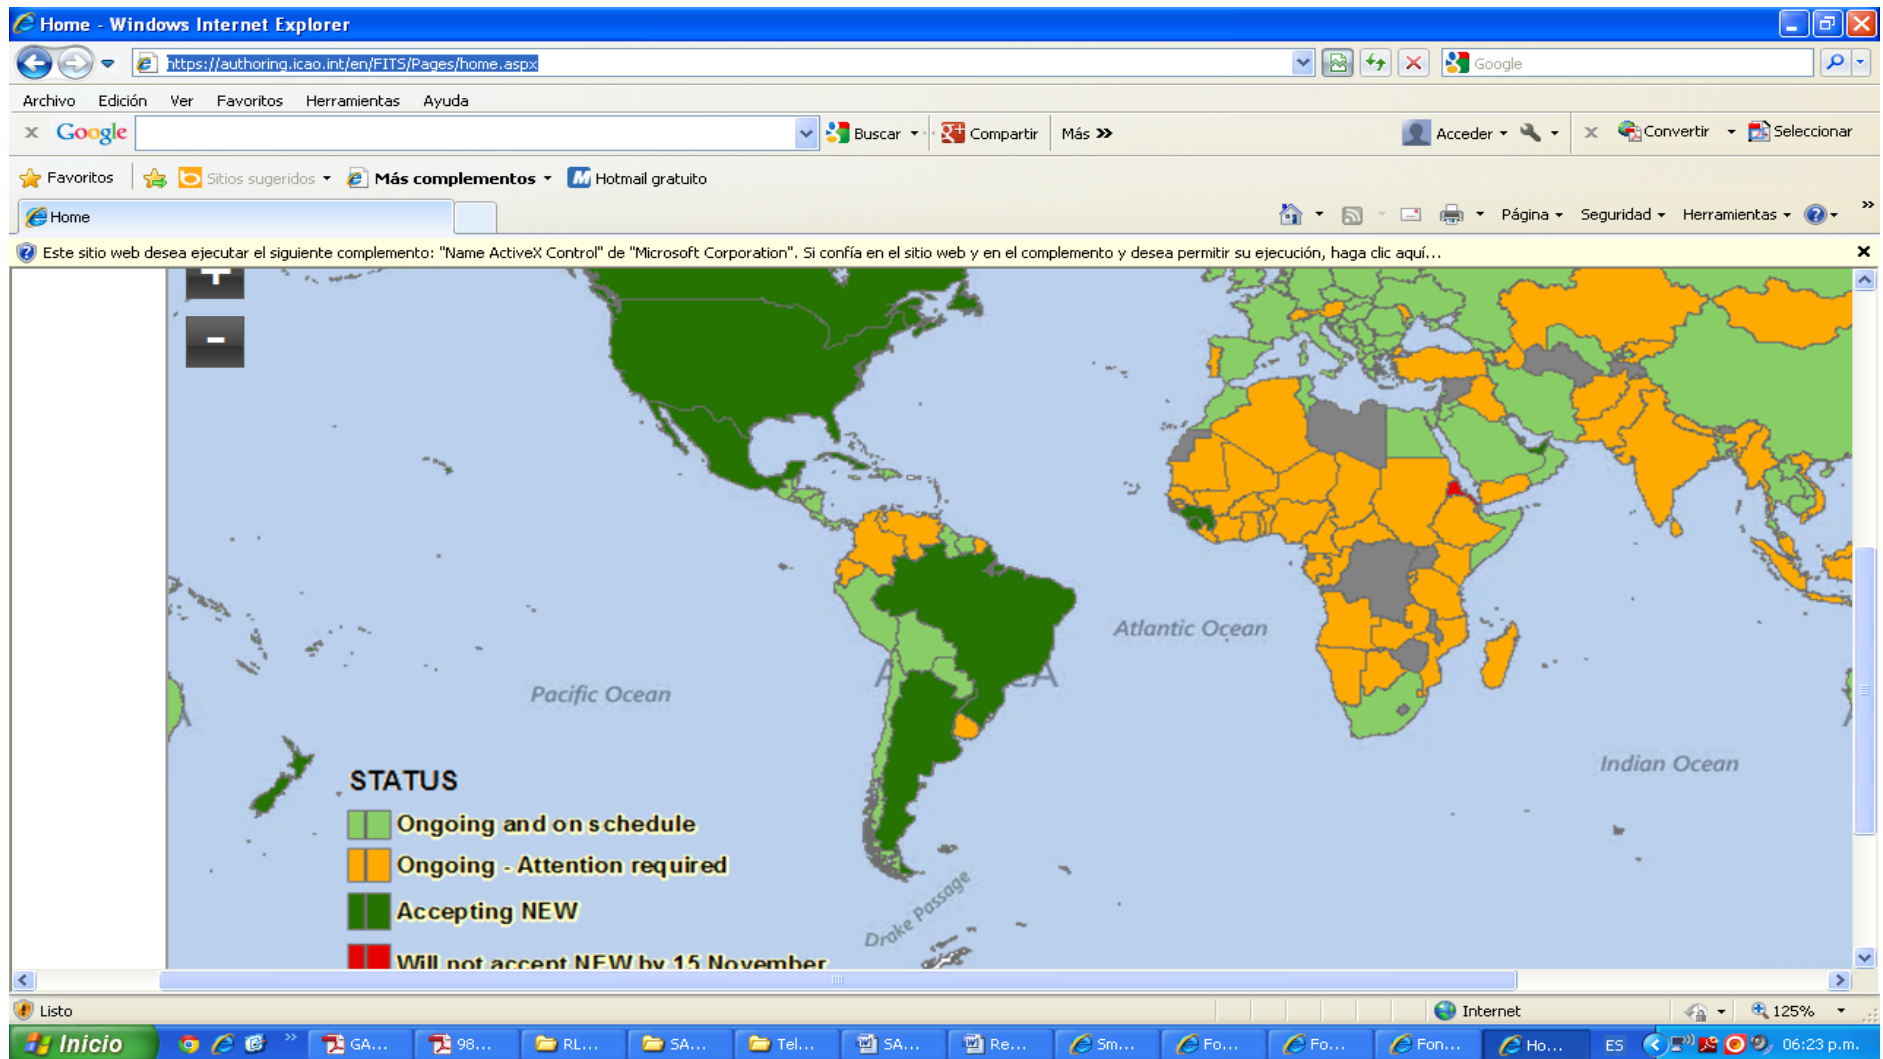

APPENDIX C

STATUS OF IMPLEMENTATION OF THE NEW FLIGHT PLAN FORMAT IN THE SAM REGION

State	ACC	Flight Plan Transmission (Use of the NEW format at AFTN/AMHS terminals)	Processing of the NEW Flight Plan Format (FDP)	Acceptance Date of the NEW Flight Plan Format	National, Regional and Interregional Tests (Trial programming for the implementation of the NEW flight plan format in the SAM Region (SAM/IG/9, Item 8, Appendix E))	Updating of ATS LOAs between Adjacent ACCs
Argentina	Comodoro Rivadavia	Implemented (AMHS terminal)	Manual	1 September 2012 NOTAM mentioning AIC issued on 19 April 2012	Carried out	Pending
	Cordoba	Implemented (AMHS terminal)	Automated FDP updating			
	Ezeiza	Implemented (AMHS terminal)	Automated FDP updating			
	Mendoza	Implemented (AMHS terminal)	Manual			
	Resistencia	Implemented (AMHS terminal)	Manual			
Bolivia	La Paz	Implemented (AMHS terminal)	Manual	Undefined	Partially carried out	Pending
Brazil	Amazonico	Implemented (AMHS terminal)	Automated (Use of converter)	30 June 2012	Carried out	Pending
	Atlántico	Implemented (AMHS terminal)	Automated (Use of converter)			
	Brasilia	Implemented (AMHS terminal)	Automated (Use of converter)			
	Curitiba	Implemented (AMHS terminal)	Automated (Use of converter)			
	Recife	Implemented (AMHS terminal)	Automated (Use of converter)			

Green indicates that have issued their readiness to accept the NEW flight plan format and that they will be accepting the NEW and CURRENT flight plan format until 15 November 2012.

State	ACC	Flight Plan Transmission (Use of the NEW format at AFTN/AMHS terminals)	Processing of the NEW Flight Plan Format (FDP)	Acceptance Date of the NEW Flight Plan Format	National, Regional and Interregional Tests (Trial programming for the implementation of the NEW flight plan format in the SAM Region (SAM/IG/9, Item 8, Appendix E))	Updating of ATS LOAs between Adjacent ACCs
Chile	Antofagasta	Implemented (AMHS terminal)	Manual	From 1 October to 15 December 2012	Partially carried out	Pending
	Punta Arena	Implemented (AMHS terminal)	Manual			
	Puerto Montt	Implemented (AMHS terminal)	Manual			
	Santiago	Implemented (AMHS terminal)	Manual or automated (converter to be defined)			
Colombia	Barranquilla	Not implemented (AMHS terminal)	Manual or automated (converter to be defined)	Undefined	Carried out	Pending
	Bogotá	Not implemented (AMHS terminal)	Manual or automated (converter to be defined)			
Ecuador	Guayaquil	Implemented (AMHS terminal)	Automated Use of converter	Undefined	Partially carried out	Pending
Guyana Francesa	Rochambeau	Implantada terminal AFTN	Automated FDP updating	Undefined	Partially carried out	Pending
Guyana	Timehri	Implemented (AMHS terminal)	Automated FDP updating	Undefined	Partially carried out	Pending
Panama	Panama	Not implemented	Manual	Undefined	Carried out	Pending
Paraguay	Asunción	Implemented (AMHS terminal)	Manual or updated FDP (undefined)	Undefined	Carried out	Pending
Peru	Lima	Implemented (AMHS terminal)	Automated FDP updating	Undefined	Carried out	Pending
Surinam	Paramaribo	Implemented (AMHS terminal)	Automated FDP updating	Undefined	Carried out	Pending
Uruguay	Montevideo	Not implemented	FDP updating in process	Undefined	Partially carried out	Pending

State	ACC	Flight Plan Transmission (Use of the NEW format at AFTN/AMHS terminals)	Processing of the NEW Flight Plan Format (FDP)	Acceptance Date of the NEW Flight Plan Format	National, Regional and Interregional Tests (Trial programming for the implementation of the NEW flight plan format in the SAM Region (SAM/IG/9, Item 8, Appendix E))	Updating of ATS LOAs between Adjacent ACCs
Venezuela	Maiquetia	Implemented (AMHS terminal)	Manual	Undefined	Carried out	Pending

APPENDIX D / APENDICE D

TRANSMITIDO A SACONFPL DESDE BRASIL (SBEGZXAM)

13:16:32 -----

BEI480 27131628

FF SACONFPL

271316 SBEGZXAM

(FPL-TESTE01-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

13:28:41 -----

BEI504 27132835

FF SACONFPL

271328 SBEGZXAM

(FPL-TESTE02-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

13:43:30 -----

BEI535 27134327

FF SACONFPL

271343 SBEGZXAM

(FPL-TESTE03-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:01:38 -----

BEI600 27140136

FF SACONFPL

271401 SBEGZXAM

(FPL-TESTE04-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

-----BEI664 27142122

FF SACONFPL
271421 SBEGZXAM
(FPL-TESTE05-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

14:41:27 -----

BEI691 27144124
FF SACONFPL
271441 SBEGZXAM
(FPL-TESTE06-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

-----BEI778 27150224

FF SACONFPL
271502 SBEGZXAM

TRANSMITIDO A SACONFPL DESDE BRASIL (SBMNZXAM)

13:14:02 -----

BEI478 27131400
FF SACONFPL SCSCZPZX
271300 SBMNZXAM
(FPL-TESTE01-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

-----BEI491 27132317

FF SACONFPL SCSCZPZX

271320 SBMNZXAM

(FPL-TESTE02-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

13:42:08 -----

BEI530 27134158

FF SACONFPL SCSCZPZX

271340 SBMNZXAM

(FPL-TESTE03-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:00:02 -----

BEI584 27135958

FF SACONFPL SCSCZPZX

271400 SBMNZXAM

(FPL-TESTE04-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:20:41 -----

BEI661 27142037

FF SACONFPL SCSCZPZX

271420 SBMNZXAM

(FPL-TESTE05-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:41:15 -----

BEI689 27144112

FF SACONFPL SCSCZPZX

271440 SBMNZXAM

(FPL-TESTE06-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

15:01:26 -----

BEI767 27150122

FF SACONFPL SCSCZPZX

271500 SBMNZXAM

(FPL-TESTE07-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

-----BEI838 27151950

FF SACONFPL SCSCZPZX

271520 SBMNZXAM

(FPL-TESTE08-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

15:42:38 -----

BEI896 27154234

FF SACONFPL SCSCZPZX

271540 SBMNZXAM

(FPL-TESTE09-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

16:02:05 -----

BEI957 27160104

FF SACONFPL SCSCZPZX

271600 SBMNZXAM

(FPL-TESTE10-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

TRANSMITIDO A SACONFPL DESDE CHILE

-----SBA0397 271305

FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX

SAEZNFL SCONFPL

271302 SCELZPZX

(FPL-LAN0001-IS

-A318/M-DE1E2FGHILOVWYZ/S

-SCEL1400

-N0442F370 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT

3109S06413W DCT

-SACO0106 SAME

-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV EET/SAMV0012 SACU0041

SEL/CDEF RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE FOUR TEST NUEVO FPL)

13:07:26 -----

SBA0399 271307

FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX

SAEZNFL SCONFPL

271306 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWY/S

-SCEL1400

-N0438F350 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT

3109S06413W DCT

-SACO0107 SAME

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR

DOF/120927 REG/CCBAA EET/SAMV0012 SACU0041 SEL/QWER CODE/0A PER/A

RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:09:12 -----

SBA0401 271309

FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX

SAEZNFL SCONFPL

271308 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWY/S

-SCEL1655

-N0433F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400

SIKOB/N0441F370 UM400 IMBEK IMBEK1
-SBGR0316 SBKP
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCBAL
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0309 SBCW0313 SEL/GMLQ
TALT/SCEL
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE TEST NUEVO FPL)

13:11:03 -----
SBA0404 271310
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271309 SCELZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FHILM1OVRWXYZ/S
-SCEL1400
-N0454F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0132 SAME
-PBN/A1B3B4B5D3D4 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCDM
EET/SAMV0012 SAEU0044 SEL/AMHL
RMK/CALLSIGN LAN CHILE STAGE THREE TEST NUEVO FPL)

13:12:51 -----
SBA0406 271312
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271311 SCELZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FGHILM1OVRWXYZ/S
-SCEL1400
-N0459F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0131 SUMU
-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCBDD
EET/SAMV0012 SAEU0044 SEL/DQLP
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE TEST NUEVO FPL)

13:14:54 -----
SBA0407 271314
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271313 SCELZPZX
(FPL-LAN0001-IS
-A319/M-DE1E2FGHILOVRWYZ/S
-SCEL1400
-N0386F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR
DOF/120927 REG/CCBCE EET/SAMV0013 SEL/GPKQ
RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:18:07 -----

SBA0409 271318
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271315 SCELZPZX
(FPL-LAN0001-IS
-A318/M-DE1E2FGHILOVWY/S
-SCEL1400
-N0388F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUR/TESTSUR DOF/120927
REG/CCCVA EET/SAMV0013 SEL/CJBE CODE/003A PER/A
RMK/TCAS EQUIPPED RMK/STAGE FOUR TEST NUEVO FPL)

13:19:21 -----

SBA0410 271319
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271318 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWYZ/S
-SCEL1400
-N0396F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T2 NAV/PBN B1D1 DOF/120927 REG/CCCOM EET/SAMV0013
SEL/JSCR RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE
RMK/TESTATC2012

-----SBA0414 271321

FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271320 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWYZ/S
-SCEL1305
-N0434F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400
PULEN/N0441F370 UM400 IMBEK IMBEK1
-SBGR0315 SBGL
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCOF
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0308 SBCW0312 SEL/JRMS
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE
RMK/TEST NUEVO FPL)

13:22:47 -----

SBA0415 271322
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271322 SCELZPZX
(FPL-LAN0001-IS
-A343/H-DE1E2FGHIJ5LM1OVRWXYZ/D1S
-SCEL1400
-N0468F410 ALBAL1 ALBAL UM424 ASADA ASADA6

-SAEZ0140 SACO
-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCQC
EET/SAMV0014 SAEU0055 SEL/KRDH OPR/LAN AIRLINE
RMK/TCAS EQUIPPED STAGE THREE RMK/TEST NUEVO FPL)

15:59:37 -----

SBA0533 271559
GG SAEZNFPL SACONFPL SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL
SULSNFPL SUMUZPZX
271551 SCSCYFAX
SVC CON RESPECTO A LAS PRUEBAS REALIZADAS DIA HOY NFPL, AGRADECERE
SUS COMENTARIOS SOBRE LOS NFPL EMITIDOS POR SCELZPZX COMO LAN0001
Y RMK/TEST NUEVO FPL.
DIRECCIONAR MENSAJE A SCSCYFAX. GRACIAS.

TRANSMITIDO A SACONFPL DESDE PARAGUAY

13:48:33 -----

ABA045 27134829
FF SACONFPL SAEZNFPL SUMUNFPL SUMUZPZX SCSCZPZX SULSNFPL
271336 SGASYFYX
(FPL-TESTE02-IS
-1B733/M-ABCDE1FGHIJ56J7LORTUVWXYZ/PSB1V2D1
-SMJP1500
-N0463F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

ABA047 27140712
FF SACONFPL SAEZNFPL SUMUNFPL SUMUZPZX SCSCZPZX SULSNFPL
271336 SGASYFYX
(FPL-TPU030T-IS
-1A320/M-SDE2E3FGHIRW/S
-SPIM1520
-N0443F380 TIMOR3 ATOGO UM674 TBG UL465 GMC UG448 TADPO
G448 MTH DVALL1
-KMIA0522 KPBI
-PBN/NAV/A1B1 DOF/120930 REG/N680TA
EET/SEGU0116 SKED0154 MPZL0229 MKJK0341 MUFH0422 KZMA0454 SEL/AFDS RALT/SPIM
SPST SKCL MPTO MWCR KMIA
RMK/TESTE01 TACA NFPL)

14:36:53 -----

ABA049 27143606
GG SAEZNFPL SACONFPL SACOZRXX SAEZXLXL SCSCZPZX SCELZPZX
271430 SGASYFYX
BUEN DIA COLEGAS, DAMOS ACUSE RECIBO DE LOS PLANES DE VUELO DE PRUEBA
PARA EL NUEVO FORMATO DE FPL - RX 5/5
ESPERAMOS RECIBIR SUS RESPECTIVOS REPORTES DE COMO RECIBEN NUESTRO
TRAFICO TKS.

TRANSMITIDO A SAEZNFPL SAEZNFPL DESDE URUGUAY

13:01:52 -----

MBB135 271304

FF SAEZNFPL SAEZNFPL

271306 SUMUNFPL

(FPL-TESTE02-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)

13:23:05 -----

MBB142 271325

FF SAEZNFPL SAEZNFPL

271328 SUMUZPZX

(FPL-TESTE02-IS

-B733/M-ABCDE1FGHIJ6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEI DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)TXJB

13:23:11 -----

MBB143 271325

FF SAEZNFPL SAEZNFPL

271329 SUMUZPZX

(FPL-TESTE02-IS

-B733/M-ABCDE1FGHIJ6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)TXJB

TRANSMITIDO A SAEZNFPL DESDE TACA

13:13:34 -----

BEI477 27131329
FF SAEZNFPL SAEZNFPL
271311 EDDFTAIX
(FPL-TPU030T-IS
-A320/M-SDE2E3FGHIRW/S
-SPIM1520
-N0443F380 TIMOR3 ATOGO UM674 TBG UL465 GCM UG448 TADPO G448 MTH
DVALL1
-KMIA0522 KPBI KFL
-PBN/A1B1 DOF/120927 REG/N680TA EET/SEGU0116 SKED0154 MPZL0229
MKJK0341 MUFH0422 KZMA0454 SEL/AFDS RALT/SPIM SPST SKCL MPTO MWCR
KMIA RMK/TEST01 TACA NFPL)

13:23:13 -----

BEI490 27132309
FF SAEZNFPL SAEZNFPL
271319 EDDFTAIX
(FPL-LRC624T-IS
-A321/M-SDE2E3FGHIRW/S
-SCEL1435
-N0465F340 ESLAR5 VTN UW200 TOY/M079F340 UL302 ILMAR/N0464F340 DCT
SCO PISCO3B
-SPIM0330 SPQU SPSO
-PBN/A1B1C1D1 DOF/120927 REG/N568TA EET/SCFZ0053 SPIM0223 SEL/BMCK
RALT/SCEL SCFA SPSO SPIM RMK/TEST02 LACSA NFPL)

13:44:42 -----

BEI540 27134413
FF SAEZNFPL SAEZNFPL
271342 EDDFTAIX
(FPL-TPU028T-IS
-A320/M-SDE2E3FGHIRW/S
-SPIM1515
-N0458F350 CEDRO1 CEDRO UA304 VIR UM415 SIDAK UZ22 PIR
-SBGR0412 SBGL SBKP
-PBN/A1B1 DOF/120927 REG/N493TA EET/SLLF0113 SBCW0237 SBBS0334
SBCW0408 SEL/MPBR RALT/SPIM SPSO SCAR SLVR SBCG SBGR RMK/TEST03
TACA NFPL)

13:56:41 -----

BEI564 27135638
FF SAEZNFPL SAEZNFPL
271352 EDDFTAIX
(FPL-TPU025T-IS
-A321/M-SDE2E3FGHIRW/S
-SPIM1535
-N0462F350 PISCO1 SCO UL550 SAREG/N0455F370 UL550 ROS UA558 MULTA
UW24 SNT SNT6A
-SAEZ0337 SAAR

-PBN/A1B1 DOF/120927 REG/N568TA EET/SCFZ0103 SACF0155 SAEF0301
SEL/BMCK RALT/SPIM SCAR SCDA SCFA SACO SAAR SAEZ RMK/TEST04 TACA
NFPL)

14:01:45 -----

BEI602 27140142
FF SAEZNFPL SACONFPL
271359 EDDFTAIX
(FPL-TPU132T-IS
-A320/M-SDE2E3FGHIRW/S
-SPIM1605
-N0448F390 LIMA4 AMVEX UL305 GIR W17 ABL ABL1B
-SKBO0228 SKRG
-PBN/A1B1 DOF/120927 REG/N682TA EET/SEGU0125 SPIM0139 SEGU0139
SKED0141 SEL/ALDP RALT/SPIM SPCL SPST SPQT SKBO RMK/TEST05 TACA
NFPL)

14:13:40 -----

BEI639 27141336
FF SAEZNFPL SACONFPL
271412 EDDFTAIX
(FPL-TPU031T-IS
-A320/M-SDE2E3FGHIRW/S
-KMIA2005
-N0459F350 DCT DHP DCT MTH G448 TADPO UG448 GCM UL465 TBG UM674
ATOGO ATOGO1
-SPIM0516 SPSO
-PBN/A1B1 DOF/120927 REG/N495TA EET/KZMA0003 MUFH0023 MKJK0055
MPZL0134 SKED0246 SEGU0323 SPIM0400 SEL/FJGQ RALT/KMIA MUHA MWCR
MPTO SKCL SPQT SPCL SPIM RMK/TEST06 TACA NFPL)

14:50:57 -----

BEI716 27145053
FF SAEZNFPL SACONFPL
271446 EDDFTAIX
(FPL-TPU083T-IS
-A319/M-SDE2E3FGHIR/S
-MUHA2017
-N0462F270 ZARAGO6 UCL UG448 GCM UL465 TBG UM674 ATOGO ATOGO1
-SPIM0452 SPSO
-STS/NONRVSM PBN/A1B1 DOF/120927 REG/N478TA EET/MKJK0030 MPZL0109
SKED0221 SEGU0257 SPIM0335 SEL/QSBL RALT/MUHA MWCR MROC SEMT SEGU
SPIM RMK/TEST08 TACA NFPL)

-----BEI773 27150139

FF SAEZNFPL SACONFPL
271459 EDDFTAIX
(FPL-LRC625T-IS
-A321/M-SDE2E3FGHIRW/S
-SPIM2000
-M079F350 ILMAR1 ILMAR UL302 TOY UG551 TBN ANDES3
-SCEL0258 SCIE

-PBN/A1B1C1D1 DOF/120927 REG/N568TA EET/SCFZ0054 SCEZ0214 SEL/BMCK
RALT/SPIM SPSO SCFA SCEL RMK/TEST09 LACSA NFPL)

BEI820 27151607
FF SAEZNFPL SAEZNFPL
271514 EDDFTAIX
(FPL-TAI055T-IS
-E190/M-SDE2E3FGHIRW/S
-SPIM2000
-N0457F350 PISCO1 SCO UL550 ITAKI UL300 ALDER/N0452F370 UL300 TOY
UW208 TBN ANDES3
-SCEL0313 SCIE
-PBN/B1 DOF/120927 REG/N937TA
EET/SCFZ0102 SCEZ0226 SEL/APLS
RALT/SPIM SPSO SCAR SCFA SCEL RMK/TEST10 TACA NFPL NONRNP10)

BEI849 27152335
FF SAEZNFPL SAEZNFPL
271522 EDDFTAIX
(FPL-TPU029T-IS
-A320/M-SDE2E3FGHIRW/S
-SBGR2050
-N0463F340 DCT BCO DCT PIER DCT CGO DCT SCB UM415 PRR/N0460F350
UM415 ESPIN/N0457F360 UM415 MEXUR MEXUR3B
-SPIM0446 SPSO
-PBN/A1B1 DOF/120927 REG/N493TA
EET/SLLF0146 SPIM0322 SEL/MPBR
RALT/SBGR SBCG SLVR SCAR SPSO SPIM RMK/TEST11 TACA NFPL)

15:50:21 -----
BEI908 27155018
FF SAEZNFPL SAEZNFPL
271548 EDDFTAIX
(FPL-TPU024T-IS
-A321/M-SDE2E3FGHIRW/S
-SAEZ2115
-N0458F340 ATOVO2A ATOVO UW5 ROS UL550 SCO PISCO3B
-SPIM0429 SPSO
-PBN/A1B1 DOF/120927 REG/N568TA EET/SACF0044 SCFZ0207 SPIM0314
SEL/BMCK RALT/SAEZ SAAR SACO SCFA SCDA SCAR SPIM RMK/TEST12 TACA
NFPL)

-----BEI960 27160129
FF SAEZNFPL SAEZNFPL
271557 EDDFTAIX
(FPL-TPU049T-IS
-A321/M-SDE2E3FGHIRW/S
-SVMI2155
-N0466F340 MARES1 MARES A315 ATONO UG427 EZA UM414 AMVEX AMVEX2
-SPIM0335 SPSO
-PBN/A1B1 DOF/120927 REG/N567TA EET/SKED0051 SPIM0204 SEL/KLPQ
RALT/SVMI SKRG SKCL SPQT SPST SPCL SPIM RMK/TEST13 TACA NFPL)

16:09:06 -----

BEI997 27160902
FF SAEZNFPL SAEZNFPL
271605 EDDFTAIX
(FPL-TPU133T-IS
-A320/M-SDE2E3FGHIR/S
-SKBO2240
-N0467F280 KAMIS5A KAMIS W16 GIR UL305 AMVEX AMVEX2
-SPIM0227 SPSO
-STS/NONRVSM PBN/A1B1 DOF/120927 REG/N682TA EET/SKED0007 SEGU0043
SPIM0044 SEGU0045 SPIM0059 SEL/ALDP RALT/SKBO SKCL SPQT SPST SPCL
SPIM RMK/TEST14 TACA NFPL)

TRANSMITIDO A SAEZNFPL DESDE BRAZIL

13:17:17 -----

BEI482 27131713
FF SAEZNFPL
271317 SBBRAMHS
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/120629 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP
RMK/TEST FLIGHTPLAN)

13:21:25 -----

BEI487 27132121
FF SAEZNFPL
271321 SBBRAMHS
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP
RMK/TEST FLIGHTPLAN)

13:48:47 -----

BEI546 27134841
FF SAEZNFPL
271348 SBBRNFPL
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ;APSB1V2D1
-SMPJ1500
-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/120629 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

TRANSMITIDO A SAEZNFPL DESDE CHILE

-----SBA0397 271305
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271302 SCELZPZX
(FPL-LAN0001-IS
-A318/M-DE1E2FGHILOVWYZ/S
-SCEL1400
-N0442F370 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0106 SAME
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV EET/SAMV0012 SACU0041
SEL/CDEF RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE FOUR TEST NUEVO FPL)

13:07:26 -----
SBA0399 271307
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271306 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S
-SCEL1400
-N0438F350 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0107 SAME
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR
DOF/120927 REG/CCBAA EET/SAMV0012 SACU0041 SEL/QWER CODE/0A PER/A
RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:09:12 -----
SBA0401 271309
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271308 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S
-SCEL1655
-N0433F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400
SIKOB/N0441F370 UM400 IMBEK IMBEK1
-SBGR0316 SBKP
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCBAL
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0309 SBCW0313 SEL/GMLQ
TALT/SCFL
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE TEST NUEVO FPL)

13:11:03 -----

SBA0404 271310
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271309 SCELZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FHILM1OVRWXYZ/S
-SCEL1400
-N0454F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0132 SAME
-PBN/A1B3B4B5D3D4 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCDM
EET/SAMV0012 SAEU0044 SEL/AMHL
RMK/CALLSIGN LAN CHILE STAGE THREE TEST NUEVO FPL)

13:12:51 -----

SBA0406 271312
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271311 SCELZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FGHILM1OVRWXYZ/S
-SCEL1400
-N0459F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0131 SUMU
-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCBDD
EET/SAMV0012 SAEU0044 SEL/DQLP
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE TEST NUEVO FPL)

13:14:54 -----

SBA0407 271314
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271313 SCELZPZX
(FPL-LAN0001-IS
-A319/M-DE1E2FGHILOVRWYZ/S
-SCEL1400
-N0386F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR
DOF/120927 REG/CCBCE EET/SAMV0013 SEL/GPKQ
RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:18:07 -----

SBA0409 271318
FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX
SAEZNFL SCONFPL
271315 SCELZPZX
(FPL-LAN0001-IS
-A318/M-DE1E2FGHILOVWY/S
-SCEL1400
-N0388F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUR/TESTSUR DOF/120927
REG/CCCVA EET/SAMV0013 SEL/CJBE CODE/003A PER/A
RMK/TCAS EQUIPPED RMK/STAGE FOUR TEST NUEVO FPL)

13:19:21 -----

SBA0410 271319

FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX

SAEZNFL SCONFPL

271318 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1400

-N0396F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T2 NAV/PBN B1D1 DOF/120927 REG/CCCOM EET/SAMV0013

SEL/JSCR RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE

RMK/TESTATC2012

-----SBA0414 271321

FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX

SAEZNFL SCONFPL

271320 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1305

-N0434F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400

PULEN/N0441F370 UM400 IMBEK IMBEK1

-SBGR0315 SBGL

-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCOF

EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0308 SBCW0312 SEL/JRMS

RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE

RMK/TEST NUEVO FPL)

13:22:47 -----

SBA0415 271322

FF SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL SULSNFPL SUMUZPZX

SAEZNFL SCONFPL

271322 SCELZPZX

(FPL-LAN0001-IS

-A343/H-DE1E2FGHIJ5LM1OVRWXYZ/D1S

-SCEL1400

-N0468F410 ALBAL1 ALBAL UM424 ASADA ASADA6

-SAEZ0140 SACO

-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCQC

EET/SAMV0014 SAEU0055 SEL/KRDH OPR/LAN AIRLINE

RMK/TCAS EQUIPPED STAGE THREE RMK/TEST NUEVO FPL)

15:59:37 -----

SBA0533 271559

GG SAEZNFPL SACONFPL SBEGNFPL SBBRNFPL SGASNFPL SGESNFPL SUMUNFPL
SULSNFPL SUMUZPZX

271551 SCSCYFAX

SVC CON RESPECTO A LAS PRUEBAS REALIZADAS DIA HOY NFPL, AGRADECERE
SUS COMENTARIOS SOBRE LOS NFPL EMITIDOS POR SCELZPZX COMO LAN0001
Y RMK/TEST NUEVO FPL.

DIRECCIONAR MENSAJE A SCSCYFAX. GRACIAS.

TRANSMITIDO A SACONFPL DESDE PARAGUAY

13:48:33 -----

ABA045 27134829

FF SACONFPL SAEZNFPL SUMUNFPL SUMUZPZX SCSCZPZX SULSNFPL
271336 SGASYFYX

(FPL-TESTE02-IS

-1B733/M-ABCDE1FGHIJ56J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0463F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

ABA047 27140712

FF SACONFPL SAEZNFPL SUMUNFPL SUMUZPZX SCSCZPZX SULSNFPL
271336 SGASYFYX

(FPL-TPU030T-IS

-1A320/M-SDE2E3FGHIRW/S

-SPIM1520

-N0443F380 TIMOR3 ATOGO UM674 TBG UL465 GMC UG448 TADPO

G448 MTH DVALL1

-KMIA0522 KPBI

-PBN/NAV/A1B1 DOF/120930 REG/N680TA

EET/SEGU0116 SKED0154 MPZL0229 MKJK0341 MUFH0422 KZMA0454 SEL/AFDS RALT/SPIM

SPST SKCL MPTO MWCR KMIA

RMK/TESTE01 TACA NFPL)

14:36:53 -----

ABA049 27143606

GG SAEZNFPL SACONFPL SACOZRXX SAEZXLXL SCSCZPZX SCELZPZX
271430 SGASYFYX

BUEN DIA COLEGAS, DAMOS ACUSE RECIBO DE LOS PLANES DE VUELO DE PRUEBA
PARA EL NUEVO FORMATO DE FPL - RX 5/5

ESPERAMOS RECIBIR SUS RESPECTIVOS REPORTES DE COMO RECIBEN NUESTRO
TRAFICO TKS.

TRANSMITIDO A SAEZNFPL DESDE URUGUAY

13:01:52 -----
MBB135 271304

FF SAEZNFPL SAEZNFPL

271306 SUMUNFPL

(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)

13:23:05 -----
MBB142 271325

FF SAEZNFPL SAEZNFPL

271328 SUMUZPZX

(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEI DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)TXJB

13:23:11 -----
MBB143 271325

FF SAEZNFPL SAEZNFPL

271329 SUMUZPZX

(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)TXJB

TRANSMITIDO A SAEZNFPL DESDE TACA

13:13:34 -----

BEI477 27131329
FF SAEZNFPL SAEZNFPL
271311 EDDFTAIX
(FPL-TPU030T-IS
-A320/M-SDE2E3FGHIRW/S
-SPIM1520
-N0443F380 TIMOR3 ATOGO UM674 TBG UL465 GCM UG448 TADPO G448 MTH
DVALL1
-KMIA0522 KPBI KFL
-PBN/A1B1 DOF/120927 REG/N680TA EET/SEGU0116 SKED0154 MPZL0229
MKJK0341 MUFH0422 KZMA0454 SEL/AFDS RALT/SPIM SPST SKCL MPTO MWCR
KMIA RMK/TEST01 TACA NFPL)

13:23:13 -----

BEI490 27132309
FF SAEZNFPL SAEZNFPL
271319 EDDFTAIX
(FPL-LRC624T-IS
-A321/M-SDE2E3FGHIRW/S
-SCEL1435
-N0465F340 ESLAR5 VTN UW200 TOY/M079F340 UL302 ILMAR/N0464F340 DCT
SCO PISCO3B
-SPIM0330 SPQU SPSO
-PBN/A1B1C1D1 DOF/120927 REG/N568TA EET/SCFZ0053 SPIM0223 SEL/BMCK
RALT/SCEL SCFA SPSO SPIM RMK/TEST02 LACSA NFPL)

13:44:42 -----

BEI540 27134413
FF SAEZNFPL SAEZNFPL
271342 EDDFTAIX
(FPL-TPU028T-IS
-A320/M-SDE2E3FGHIRW/S
-SPIM1515
-N0458F350 CEDRO1 CEDRO UA304 VIR UM415 SIDAK UZ22 PIR
-SBGR0412 SBGL SBKP
-PBN/A1B1 DOF/120927 REG/N493TA EET/SLLF0113 SBCW0237 SBBS0334
SBCW0408 SEL/MPBR RALT/SPIM SPSO SCAR SLVR SBCG SBGR RMK/TEST03
TACA NFPL)

13:56:41 -----

BEI564 27135638
FF SAEZNFPL SAEZNFPL
271352 EDDFTAIX
(FPL-TPU025T-IS
-A321/M-SDE2E3FGHIRW/S
-SPIM1535
-N0462F350 PISCO1 SCO UL550 SAREG/N0455F370 UL550 ROS UA558 MULTA
UW24 SNT SNT6A
-SAEZ0337 SAAR

-PBN/A1B1 DOF/120927 REG/N568TA EET/SCFZ0103 SACF0155 SAEF0301
SEL/BMCK RALT/SPIM SCAR SCDA SCFA SACO SAAR SAEZ RMK/TEST04 TACA
NFPL)

14:01:45 -----

BEI602 27140142
FF SAEZNFPL SCONFPL
271359 EDDFTAIX
(FPL-TPU132T-IS
-A320/M-SDE2E3FGHIRW/S
-SPIM1605
-N0448F390 LIMA4 AMVEX UL305 GIR W17 ABL ABL1B
-SKBO0228 SKRG
-PBN/A1B1 DOF/120927 REG/N682TA EET/SEGU0125 SPIM0139 SEGU0139
SKED0141 SEL/ALDP RALT/SPIM SPCL SPST SPQT SKBO RMK/TEST05 TACA
NFPL)

14:13:40 -----

BEI639 27141336
FF SAEZNFPL SCONFPL
271412 EDDFTAIX
(FPL-TPU031T-IS
-A320/M-SDE2E3FGHIRW/S
-KMIA2005
-N0459F350 DCT DHP DCT MTH G448 TADPO UG448 GCM UL465 TBG UM674
ATOGO ATOGO1
-SPIM0516 SPSO
-PBN/A1B1 DOF/120927 REG/N495TA EET/KZMA0003 MUFH0023 MKJK0055
MPZL0134 SKED0246 SEGU0323 SPIM0400 SEL/FJGQ RALT/KMIA MUHA MWCR
MPTO SKCL SPQT SPCL SPIM RMK/TEST06 TACA NFPL)

14:50:57 -----

BEI716 27145053
FF SAEZNFPL SCONFPL
271446 EDDFTAIX
(FPL-TPU083T-IS
-A319/M-SDE2E3FGHIR/S
-MUHA2017
-N0462F270 ZARAGO6 UCL UG448 GCM UL465 TBG UM674 ATOGO ATOGO1
-SPIM0452 SPSO
-STS/NONRVSM PBN/A1B1 DOF/120927 REG/N478TA EET/MKJK0030 MPZL0109
SKED0221 SEGU0257 SPIM0335 SEL/QSBL RALT/MUHA MWCR MROC SEMT SEGU
SPIM RMK/TEST08 TACA NFPL)

-----BEI773 27150139

FF SAEZNFPL SCONFPL
271459 EDDFTAIX
(FPL-LRC625T-IS
-A321/M-SDE2E3FGHIRW/S
-SPIM2000
-M079F350 ILMAR1 ILMAR UL302 TOY UG551 TBN ANDES3
-SCEL0258 SCIE

-PBN/A1B1C1D1 DOF/120927 REG/N568TA EET/SCFZ0054 SCEZ0214 SEL/BMCK
RALT/SPIM SPSO SCFA SCEL RMK/TEST09 LACSA NFPL)

BEI820 27151607
FF SAEZNFPL SAEZNFPL
271514 EDDFTAIX
(FPL-TAI055T-IS
-E190/M-SDE2E3FGHIRW/S
-SPIM2000
-N0457F350 PISCO1 SCO UL550 ITAKI UL300 ALDER/N0452F370 UL300 TOY
UW208 TBN ANDES3
-SCEL0313 SCIE
-PBN/B1 DOF/120927 REG/N937TA
EET/SCFZ0102 SCEZ0226 SEL/APLS
RALT/SPIM SPSO SCAR SCFA SCEL RMK/TEST10 TACA NFPL NONRNP10)

BEI849 27152335
FF SAEZNFPL SAEZNFPL
271522 EDDFTAIX
(FPL-TPU029T-IS
-A320/M-SDE2E3FGHIRW/S
-SBGR2050
-N0463F340 DCT BCO DCT PIER DCT CGO DCT SCB UM415 PRR/N0460F350
UM415 ESPIN/N0457F360 UM415 MEXUR MEXUR3B
-SPIM0446 SPSO
-PBN/A1B1 DOF/120927 REG/N493TA
EET/SLLF0146 SPIM0322 SEL/MPBR
RALT/SBGR SBCG SLVR SCAR SPSO SPIM RMK/TEST11 TACA NFPL)

15:50:21 -----
BEI908 27155018
FF SAEZNFPL SAEZNFPL
271548 EDDFTAIX
(FPL-TPU024T-IS
-A321/M-SDE2E3FGHIRW/S
-SAEZ2115
-N0458F340 ATOVO2A ATOVO UW5 ROS UL550 SCO PISCO3B
-SPIM0429 SPSO
-PBN/A1B1 DOF/120927 REG/N568TA EET/SACF0044 SCFZ0207 SPIM0314
SEL/BMCK RALT/SAEZ SAAR SACO SCFA SCDA SCAR SPIM RMK/TEST12 TACA
NFPL)

-----BEI960 27160129
FF SAEZNFPL SAEZNFPL
271557 EDDFTAIX
(FPL-TPU049T-IS
-A321/M-SDE2E3FGHIRW/S
-SVMI2155
-N0466F340 MARES1 MARES A315 ATONO UG427 EZA UM414 AMVEX AMVEX2
-SPIM0335 SPSO
-PBN/A1B1 DOF/120927 REG/N567TA EET/SKED0051 SPIM0204 SEL/KLPQ
RALT/SVMI SKRG SKCL SPQT SPST SPCL SPIM RMK/TEST13 TACA NFPL)

16:09:06 -----

BEI997 27160902
FF SAEZNFPL SAEZNFPL
271605 EDDFTAIX
(FPL-TPU133T-IS
-A320/M-SDE2E3FGHIR/S
-SKBO2240
-N0467F280 KAMIS5A KAMIS W16 GIR UL305 AMVEX AMVEX2
-SPIM0227 SPSO
-STS/NONRVSM PBN/A1B1 DOF/120927 REG/N682TA EET/SKED0007 SEGU0043
SPIM0044 SEGU0045 SPIM0059 SEL/ALDP RALT/SKBO SKCL SPQT SPST SPCL
SPIM RMK/TEST14 TACA NFPL)

TRANSMITIDO DESDE CHILE A BRASIL (SBBRNFPL)

13:08:50 -----

EBI528
FF SBBRNFPL SBEGNFPL
271306 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S
-SCEL1400
-N0438F350 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0107 SAME
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR
DOF/120927 REG/CCBAA EET/SAMV0012 SACU0041 SEL/QWER CODE/0A PER/A
RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:08:55 -----

EBI529
FF SBBRNFPL SBEGNFPL
271302 SCELZPZX
(FPL-LAN0001-IS
-A318/M-DE1E2FGHILOVWYZ/S
-SCEL1400
-N0442F370 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0106 SAME
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV EET/SAMV0012 SACU0041
SEL/CDEF
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE FOUR TEST NUEVO FPL)

13:10:18 -----

EBI534
FF SBBRNFPL SBEGNFPL
271308 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S
-SCEL1655
-N0433F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400

SIKOB/N0441F370 UM400 IMBEK IMBEK1
-SBGR0316 SBKP
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCBAL
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0309 SBCW0313 SEL/GMLQ
TALT/SCEL RMK/TCAS EQUIPPED CALLSIGN LAN CHILE TEST NUEVO FPL)

13:11:45 -----

EBI537
FF SBBRNFPL SBEGNFPL
271309 SCENZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FHILM1OVRWXYZ/S
-SCEN1400
-N0454F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0132 SAME
-PBN/A1B3B4B5D3D4 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCDM
EET/SAMV0012 SAEU0044 SEL/AMHL RMK/CALLSIGN LAN CHILE
STAGE THREE TEST NUEVO FPL)

13:11:47 -----

EBI538
GG SBEGNFPL SBBRNFPL
271310 SCSCZPZX
SVC AGRADECERE INCLUIR EN LOS MSG DE PRUEBAS NFPLLA DIRECCION SCENZPZ
X
GRACIAS Y SALUDOS

13:14:18 -----

EBI540
FF SBBRNFPL SBEGNFPL
271311 SCENZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FGHILM1OVRWXYZ/S
-SCEN1400
-N0459F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0131 SUMU
-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCBDD
EET/SAMV0012 SAEU0044 SEL/DQLP
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE
STAGE THREE
TEST NUEVO FPL)

13:15:27 -----

EBI543
FF SBBRNFPL SBEGNFPL
271313 SCENZPZX
(FPL-LAN0001-IS
-A319/M-DE1E2FGHILOVRWYZ/S
-SCEN1400
-N0386F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR

DOF/120927 REG/CCBCE EET/SAMV0013 SEL/GPKQ
RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:18:46 -----

EBI545

FF SBBRNFPL SBEGNFPL

271315 SCELZPZX

(FPL-LAN0001-IS

-A318/M-DE1E2FGHILOVWY/S

-SCEL1400

-N0388F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUR/TESTSUR DOF/120927
REG/CCCVA EET/SAMV0013 SEL/CJBE CODE/003A PER/A
RMK/TCAS EQUIPPED RMK/STAGE FOUR
TEST NUEVO FPL)

13:21:01 -----

EBI546

FF SBBRNFPL SBEGNFPL

271318 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1400

-N0396F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T2 NAV/PBN B1D1 DOF/120927 REG/CCCOM EET/SAMV0013
SEL/JSCR RMK/TCAS EQUIPPED CALLSIGN LAN CHILE
STAGE THREE)
RMK/TESTATC2012

13:22:11 -----

EBI548

FF SBBRNFPL SBEGNFPL

271320 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1305

-N0434F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400

PULEN/N0441F370 UM400 IMBEK IMBEK1

-SBGR0315 SBGL

-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCOF
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0308 SBCW0312 SEL/JRMS
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE
RMK/TEST NUEVO FPL)

13:23:20 -----

EBI550

FF SBBRNFPL SBEGNFPL

271322 SCELZPZX

(FPL-LAN0001-IS

-A343/H-DE1E2FGHIJ5LM1OVRWXYZ/D1S

-SCEL1400
-N0468F410 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0140 SACO
-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCQC
EET/SAMV0014 SAEU0055 SEL/KRDH OPR/LAN AIRLINE
RMK/TCAS EQUIPPED STAGE THREE RMK/TEST NUEVO FPL)

13:26:59 -----

EBI551
FF SBEGNFPL
271315 SAEZXLXL
(FPL-LAP721-IS
-A320/M-SDGHIRWYZ/S
-SAEZ1250
-N0453F350 PTA6A KUKEN UM654 SIDUL/N0453F370 UM654 VUPIT
UM400 GEDEL DCT PNG UM548 RONUT RONUT2
-SBGR0236 SBGL SBKP
-PBN/B1O1 NAV/B1O1 REG/PRMAR EET/SAEU0015 SUEO0019 SBCW0053
SBBS0226 SBCW0230 SEL/SGHR OPR/TAM MERCOSUR PER/038622 RMK/TCAS II
EQPD
RMK/FPL DE PRUEBA CFME RX)

13:46:52 -----

EBI556
FF SBEGNFPL SBBRNFPL
271330 SACOZRXX
(FPL-TESTE02-IG
-1B733/M-CDEFGHIOTUVWXYZ/APS
-SMJP1500
-N0436F360 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ SMJP
-NAV/RNAV10 RNAV5 GNSS RNAV2 DME DME IRU RNAV1 RNP AR APCH NAV/LPV
GBAS DOF/121002 REG/PZTCN EET/0013 SEL/HKMR PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN. DAT/S FMC WPR ACARS)

16:01:47 -----

EBI680
GG SBBRNFPL SBEGNFPL
271551 SCSCYFAX
SVC CON RESPECTO A LAS PRUEBAS REALIZADAS DIA HOY NFPL, AGRADECERE
SUS COMENTARIOS SOBRE LOS NFPL EMITIDOS POR SCELZPZX COMO LAN0001
Y RMK/TEST NUEVO FPL.
DIRECCIONAR MENSAJE A SCSCYFAX. GRACIAS.

TRANSMITIDO DESDE CHILE A BRASIL (SBEGNFPL)

13:08:50 -----

EBI528
FF SBBRNFPL SBEGNFPL
271306 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S

-SCEL1400
-N0438F350 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0107 SAME
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR
DOF/120927 REG/CCBAA EET/SAMV0012 SACU0041 SEL/QWER CODE/0A PER/A
RMK/TCAS EQUIPPED
TEST NUEVO FPL)

13:08:55 -----

EBI529
FF SBBRNFPL SBEGNFPL
271302 SCELZPZX
(FPL-LAN0001-IS
-A318/M-DE1E2FGHILOVWYZ/S
-SCEL1400
-N0442F370 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0106 SAME
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV EET/SAMV0012 SACU0041
SEL/CDEF
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE FOUR
TEST NUEVO FPL)

13:10:18 -----

EBI534
FF SBBRNFPL SBEGNFPL
271308 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S
-SCEL1655
-N0433F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400
SIKOB/N0441F370 UM400 IMBEK IMBEK1
-SBGR0316 SBKP
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCBAL
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0309 SBCW0313 SEL/GMLQ
TALT/SCSEL RMK/TCAS EQUIPPED CALLSIGN LAN CHILE
TEST NUEVO FPL)

13:11:45 -----

EBI537
FF SBBRNFPL SBEGNFPL
271309 SCELZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FHILM1OVRWXYZ/S
-SCEL1400
-N0454F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0132 SAME
-PBN/A1B3B4B5D3D4 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCDM
EET/SAMV0012 SAEU0044 SEL/AMHL RMK/CALLSIGN LAN CHILE
STAGE THREE TEST NUEVO FPL)

13:11:47 -----

EBI538

GG SBEGNFPL SBBRNFPL

271310 SCSCZPZX

SVC AGRADECERE INCLUIR EN LOS MSG DE PRUEBAS NFPLLA DIRECCION SCELZPZ
X

GRACIAS Y SALUDOS

13:14:18 -----

EBI540

FF SBBRNFPL SBEGNFPL

271311 SCELZPZX

(FPL-LAN0001-IS

-B763/H-DE1E2FGHILM1OVRWXYZ/S

-SCEL1400

-N0459F390 ALBAL1 ALBAL UM424 ASADA ASADA6

-SAEZ0131 SUMU

-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCBDD

EET/SAMV0012 SAEU0044 SEL/DQLP

RMK/TCAS EQUIPPED CALLSIGN LAN CHILE

STAGE THREE

TEST NUEVO FPL)

13:15:27 -----

EBI543

FF SBBRNFPL SBEGNFPL

271313 SCELZPZX

(FPL-LAN0001-IS

-A319/M-DE1E2FGHILOVRWYZ/S

-SCEL1400

-N0386F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR

DOF/120927 REG/CCBCE EET/SAMV0013 SEL/GPKQ

RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:18:46 -----

EBI545

FF SBBRNFPL SBEGNFPL

271315 SCELZPZX

(FPL-LAN0001-IS

-A318/M-DE1E2FGHILOVWY/S

-SCEL1400

-N0388F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUR/TESTSUR DOF/120927

REG/CCCVA EET/SAMV0013 SEL/CJBE CODE/003A PER/A

RMK/TCAS EQUIPPED RMK/STAGE FOUR

TEST NUEVO FPL)

13:21:01 -----

EBI546

FF SBBRNFPL SBEGNFPL

271318 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1400

-N0396F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T2 NAV/PBN B1D1 DOF/120927 REG/CCCOM EET/SAMV0013

SEL/JSCR RMK/TCAS EQUIPPED CALLSIGN LAN CHILE

STAGE THREE)

RMK/TESTATC2012

13:22:11 -----

EBI548

FF SBBRNFPL SBEGNFPL

271320 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1305

-N0434F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400

PULEN/N0441F370 UM400 IMBEK IMBEK1

-SBGR0315 SBGL

-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCOF

EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0308 SBCW0312 SEL/JRMS

RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE

RMK/TEST NUEVO FPL)

13:23:20 -----

EBI550

FF SBBRNFPL SBEGNFPL

271322 SCELZPZX

(FPL-LAN0001-IS

-A343/H-DE1E2FGHIJ5LM1OVRWXYZ/D1S

-SCEL1400

-N0468F410 ALBAL1 ALBAL UM424 ASADA ASADA6

-SAEZ0140 SACO

-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCQC

EET/SAMV0014 SAEU0055 SEL/KRDH OPR/LAN AIRLINE

RMK/TCAS EQUIPPED STAGE THREE RMK/TEST NUEVO FPL)

13:26:59 -----

EBI551

FF SBEGNFPL

271315 SAEZXLXL

(FPL-LAP721-IS

-A320/M-SDGHIRWYZ/S

-SAEZ1250

-N0453F350 PTA6A KUKEN UM654 SIDUL/N0453F370 UM654 VUPIT

UM400 GEDEL DCT PNG UM548 RONUT RONUT2

-SBGR0236 SBGL SBKP

-PBN/B1O1 NAV/B1O1 REG/PRMAR EET/SAEU0015 SUEO0019 SBCW0053
SBBS0226 SBCW0230 SEL/SGHR OPR/TAM MERCOSUR PER/038622 RMK/TCAS II
EQPD RMK/FPL DE PRUEBA CFME RX)

13:46:52 -----

EBI556

FF SBEGNFPL SBBRNFPL

271330 SACOZRXX

(FPL-TESTE02-IG

-1B733/M-CDEFGHIOTUVWXYZ/APS

-SMJP1500

-N0436F360 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ SMJP

-NAV/RNAV10 RNAV5 GNSS RNAV2 DME DME IRU RNAV1 RNP AR APCH NAV/LPV
GBAS DOF/121002 REG/PZTCN EET/0013 SEL/HKMR PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN. DAT/S FMC WPR ACARS)

16:01:47 -----

EBI680

GG SBBRNFPL SBEGNFPL

271551 SCSCYFAX

SVC CON RESPECTO A LAS PRUEBAS REALIZADAS DIA HOY NFPL, AGRADECERE
SUS COMENTARIOS SOBRE LOS NFPL EMITIDOS POR SCCLZPZX COMO LAN0001
Y RMK/TEST NUEVO FPL.

DIRECCIONAR MENSAJE A SCSCYFAX. GRACIAS.

TRANSMITIDO A CHILE (SCCLZPZX)

13:18:06 -----

BSA1802

FF SCCLZPZX SCSCNFPL

271322 SUMUNFPL

(FPL-TESTE02-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS
DOF/121002 REG/PZTCN EET/SOOO0013 DORLI0025

SBAZ0036 SEL/HKMR

ORGN/SMJPYFYX PER/M074 TALT/SMJP

RMK/TEST FLIGHTPLAN)

13:44:09 -----

BSA1815

FF SCCLZPZX

271342 SBBRNFPL

SVC WE RECEIVED CORRECTLY YOUR MESSAGE. TKS.

13:47:27 -----

BSA1819

FF SCSCZPZX SCELZPZX

271330 SACOZRXX

(FPL-TESTE02-IG

-1B733/M-CDEFGHIOTUVWXYJZ/APS

-SMJP1500

-N0436F360 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ SMJP

-NAV/RNAV10 RNAV5 GNSS RNAV2 DME DME IRU RNAV1 RNP AR APCH NAV/LPV

GBAS DOF/121002 REG/PZTCN EET/0013 SEL/HKMR PER/M074 TALT/SMJP

RMK/TEST FLIGHTPLAN. DAT/S FMC WPR ACARS)

14:38:15 -----

BSA1948

GG SCSCZPZX SCELZPZX

271430 SGASYFYX

BUEN DIA COLEGAS, DAMOS ACUSE RECIBO DE LOS PLANES DE VUELO DE PRUEBA
PARA EL NUEVO FORMATO DE FPL - RX 5/5

ESPERAMOS RECIBIR SUS RESPECTIVOS REPORTES DE COMO RECIBEN NUESTRO
TRAFICO TKS.

-----14:56:54 -----

BSA1961

FF SCZPZX

271455 SGESZPZX

----- Mensaje Original -----

? De: ?SCZPZX?? Para: ?SGESNFPL + 1??Enviado:

2012.09.27 13:08:59 (Jueves)?Asunto:

?(FPL-LAN0001-IS-A318/M-DE1E2FGHILOVWYZ/S-SCZ1400-N0442F370 NEBEG1

YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT 3109S06413W

DCT-SACO0106 SAME-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV

EET/SAMV0012 SACU0041 SEL/CDEF RMK/TCAS EQUIPPED CALLSIGN LAN CHILE

STAGE FOUR TEST NUEVO FPL) OK..RECIBIDO

TRANSMITIDO A CHILE (SCSCNFPL)

13:17:01 -----

BSA1800

FF SCSCZPZX SCSCNFPL

271319 SUMUNFPL

(FPL-TESTE02-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS

DOF/121002 REG/PZTCN EET/SOOO0013 DORLI0025

SBAZ0036 SEL/HKMR

ORGN/SMJPYFYX PER/M074 TALT/SMJP

RMK/TEST FLIGHTPLAN)

13:18:06 -----
BSA1802
FF SCENZPZX SCSCNFPL
271322 SUMUNFPL
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS
DOF/121002 REG/PZTCN EET/SOOO0013 DORLI0025
SBAZ0036 SEL/HKMR
ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)

TRANSMITIDO A CHILE (SCSCZPZX)

13:13:33 -----
BSA1797
FF SCSCZPZX
271300 SAEZXLXL
(FPL-LPE2429-IS
-B763/H-SXDHIRWZY/S
-SAEZ1230
-N0430F320 TORUL1 URINO UA30 UMKAL NAVAR5
-SCEL0149 SCFA
-PBN/B1 D1 NAV/RNAV5 RNP10 DAT/HV DOF/120927 REG/CCBCA EET/SAMV0049
SCEZ0132 SEL/CMEF RMK/TCAS EQPD RMK/FLP DE PRUEBA)

13:15:48 -----
BSA1799
FF SCSCZPZX
271300 SBMNZXAM
(FPL-TESTE01-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

13:17:01 -----
BSA1800
FF SCSCZPZX SCSCNFPL
271319 SUMUNFPL
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS
DOF/121002 REG/PZTCN EET/SOOO0013 DORLI0025
SBAZ0036 SEL/HKMR
ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)

13:18:05 -----

BSA1801
FF SCSCZPZX
271316 SBEGZXAM
(FPL-TESTE01-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

13:18:06 -----

BSA1802
FF SCELZPZX SCSCNFPL
271322 SUMUNFPL
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS
DOF/121002 REG/PZTCN EET/SOOO0013 DORLI0025
SBAZ0036 SEL/HKMR
ORGN/SMJPYFYX PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN)

13:26:01 -----

BSA1806
FF SCSCZPZX
271324 SBEGAMHS
(FPL-TESTE01-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

13:26:02 -----

BSA1807
FF SCSCZPZX
271315 SAEZXLXL
(FPL-LAP721-IS

-A320/M-SDGHIRWYZ/S
-SAEZ1250
-N0453F350 PTA6A KUKEN UM654 SIDUL/N0453F370 UM654 VUPIT
UM400 GEDEL DCT PNG UM548 RONUT RONUT2
-SBGR0236 SBGL SBKP
-PBN/B1O1 NAV/B1O1 REG/PRMAR EET/SAEU0015 SUEO0019 SBCW0053
SBBS0226 SBCW0230 SEL/SGHR OPR/TAM MERCOSUR PER/038622 RMK/TCAS II
EQPD
RMK/FPL DE PRUEBA CFME RX)

13:28:21 -----
BSA1809
FF SCSCZPZX
271326 SBEGAMHS
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

13:29:31 -----
BSA1810
FF SCSCZPZX
271328 SBEGZXAM
(FPL-TESTE02-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

13:42:59 -----
BSA1814
FF SCSCZPZX
271340 SBMNZXAM
(FPL-TESTE03-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

13:44:10 -----

BSA1816

FF SCSCZPZX

271343 SBEGZXAM

(FPL-TESTE03-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

13:46:22 -----

BSA1818

FF SCSCZPZX

271344 SBEGAMHS

(FPL-TESTE03-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

13:47:27 -----

BSA1819

FF SCSCZPZX SCELZPZX

271330 SACOZRXX

(FPL-TESTE02-IG

-1B733/M-CDEFGHIOTUVWXYZ/AP

-SMJP1500

-N0436F360 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ SMJP

-NAV/RNAV10 RNAV5 GNSS RNAV2 DME DME IRU RNAV1 RNP AR APCH NAV/LPV

GBAS DOF/121002 REG/PZTCN EET/0013 SEL/HKMR PER/M074 TALT/SMJP

RMK/TEST FLIGHTPLAN. DAT/S FMC WPR ACARS)

13:49:56 -----

BSA1820

FF SCSCZPZX

271336 SGASYFYX

(FPL-TESTE02-IS

-1B733/M-ABCDE1FGHIJ56J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0463F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

13:51:12 -----

BSA1823

FF SCSCZPZX

271336 SGESZTZX

RECIBIDO 5/5

(FPL-TESTE02-IS

-1B733/M-ABCDE1FGHIJ56J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0463F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:00:59 -----

BSA1840

FF SCSCZPZX

271400 SBMNZXAM

(FPL-TESTE04-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:02:24 -----

BSA1844

FF SCSCZPZX

271400 SBEGAMHS

(FPL-TESTE04-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:02:28 -----

BSA1845

FF SCSCZPZX

271401 SBEGZXAM

(FPL-TESTE04-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:09:11 -----

BSA1866
FF SCSCZPZX
271336 SGASYFYX
(FPL-TPU030T-IS
-1A320/M-SDE2E3FGHIRW/S
-SPIM1520
-N0443F380 TIMOR3 ATOGO UM674 TBG UL465 GMC UG448 TADPO
G448 MTH DVALL1
-KMIA0522 KPBI
-PBN/NAV/A1B1 DOF/120930 REG/N680TA EET/SEGU0116 SKED0154 MPZL0229
MKJK0341 MUFH0422 KZMA0454 SEL/AFDS RALT/SPIM SPST SKCL MPTO MWCR
KMIA RMK/TESTE01 TACA NFPL)

14:22:30 -----

BSA1889
FF SCSCZPZX
271420 SBMNZXAM
(FPL-TESTE05-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

14:25:42 -----

BSA1928
FF SCSCZPZX
271421 SBEGZXAM
(FPL-TESTE05-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

14:25:46 -----

BSA1929
FF SCSCZPZX
271421 SBEGAMHS
(FPL-TESTE05-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:38:15 -----

BSA1948

GG SCSCZPZX SCELZPZX

271430 SGASYFYX

BUEN DIA COLEGAS, DAMOS ACUSE RECIBO DE LOS PLANES DE VUELO DE PRUEBA
PARA EL NUEVO FORMATO DE FPL - RX 5/5
ESPERAMOS RECIBIR SUS RESPECTIVOS REPORTES DE COMO RECIBEN NUESTRO
TRAFICO TKS.

14:42:58 -----

BSA1952

FF SCSCZPZX

271440 SBMNZXAM

(FPL-TESTE06-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:43:02 -----

BSA1953

FF SCSCZPZX

271441 SBEGZXAM

(FPL-TESTE06-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

14:46:27 -----

BSA1954

FF SCSCZPZX

271444 SBEGAMHS

(FPL-TESTE06-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

-----14:56:54 -----

BSA1961
FF SCELZPZX
271455 SGESZPZX

----- Mensaje Original -----

? De: ?SCELZPZX?? Para: ?SGESNFPL + 1??Enviado:
2012.09.27 13:08:59 (Jueves)?Asunto:
??(FPL-LAN0001-IS-A318/M-DE1E2FGHILOVWYZ/S-SCEL1400-N0442F370 NEBEG1
YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT 3109S06413W
DCT-SACO0106 SAME-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV
EET/SAMV0012 SACU0041 SEL/CDEF RMK/TCAS EQUIPPED CALLSIGN LAN CHILE
STAGE FOUR TEST NUEVO FPL) OK..RECIBIDO

15:03:11 -----

BSA1971
FF SCSCZPZX
271500 SBEGAMHS
(FPL-TESTE07-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

15:03:15 -----

BSA1972
FF SCSCZPZX
271500 SBMNZXAM
(FPL-TESTE07-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

15:05:03 -----

BSA1980
FF SCSCZPZX
271502 SBEGZXAM
(FPL-TESTE07-IS
-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0436F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

15:27:46 -----

BSA2034

FF SCSCZPZX

271520 SBMNZXAM

(FPL-TESTE08-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

15:27:50 -----

BSA2035

FF SCSCZPZX

271524 SBEGZXAM

(FPL-TESTE08-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

15:44:01 -----

BSA2113

FF SCSCZPZX

271542 SBEGZXAM

(FPL-TESTE09-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

15:44:03 -----

BSA2114

FF SCSCZPZX

271540 SBMNZXAM

(FPL-TESTE09-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

16:03:16 -----

BSA2148

FF SCSCZPZX

271600 SBMNZXAM

(FPL-TESTE10-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

16:04:54 -----

BSA2155

FF SCSCZPZX

271602 SBEGZXAM

(FPL-TESTE10-IS

-B733/M-ABCDE1FGHIJ5J6J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0436F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

TRANSMITIDO A PARAGUAY

13:07:55 -----

BAA182

FF SGESNFPL SGASNFPL

271306 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWY/S

-SCEL1400

-N0438F350 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT

-SACO0107 SAME

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR

DOF/120927 REG/CCBAA EET/SAMV0012 SACU0041 SEL/QWER CODE/0A PER/A

RMK/TCAS EQUIPPED

TEST NUEVO FPL)

13:07:57 -----

BAA183

FF SGESNFPL SGASNFPL

271302 SCELZPZX

(FPL-LAN0001-IS

-A318/M-DE1E2FGHILOVWYZ/S

-SCEL1400

-N0442F370 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0106 SAME
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV EET/SAMV0012 SACU0041
SEL/CDEF
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE FOUR
TEST NUEVO FPL)

13:10:32 -----

BAA186
FF SGESNFPL SGASNFPL
271308 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S
-SCEL1655
-N0433F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400
SIKOB/N0441F370 UM400 IMBEK IMBEK1
-SBGR0316 SBKP
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCBAL
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0309 SBCW0313 SEL/GMLQ
TALT/SCAL RMK/TCAS EQUIPPED CALLSIGN LAN CHILE
TEST NUEVO FPL)

13:11:58 -----

BAA188
FF SGESNFPL SGASNFPL
271309 SCELZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FHILM1OVRWXYZ/S
-SCEL1400
-N0454F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0132 SAME
-PBN/A1B3B4B5D3D4 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCDM
EET/SAMV0012 SAEU0044 SEL/AMHL RMK/CALLSIGN LAN CHILE
STAGE THREE TEST NUEVO FPL)

13:13:49 -----

BAA189
FF SGESNFPL SGASNFPL
271311 SCELZPZX
(FPL-LAN0001-IS
-B763/H-DE1E2FGHILM1OVRWXYZ/S
-SCEL1400
-N0459F390 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0131 SUMU
-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCBDD
EET/SAMV0012 SAEU0044 SEL/DQLP
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE
STAGE THREE
TEST NUEVO FPL)

13:15:37 -----

BAA190

FF SGESNFPL SGASNFPL

271313 SCELZPZX

(FPL-LAN0001-IS

-A319/M-DE1E2FGHILOVRWYZ/S

-SCEL1400

-N0386F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR

DOF/120927 REG/CCBCE EET/SAMV0013 SEL/GPKQ

RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:18:52 -----

BAA191

FF SGESNFPL SGASNFPL

271315 SCELZPZX

(FPL-LAN0001-IS

-A318/M-DE1E2FGHILOVWY/S

-SCEL1400

-N0388F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUR/TESTSUR DOF/120927

REG/CCCVA EET/SAMV0013 SEL/CJBE CODE/003A PER/A

RMK/TCAS EQUIPPED RMK/STAGE FOUR

TEST NUEVO FPL)

13:20:05 -----

BAA192

FF SGESNFPL SGASNFPL

271318 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1400

-N0396F270 NEBEG1 YESOS UA307 DOZ DCT

-SAME0034 SACO

-PBN/A1B1D1S1S2T2 NAV/PBN B1D1 DOF/120927 REG/CCCOM EET/SAMV0013

SEL/JSCR RMK/TCAS EQUIPPED CALLSIGN LAN CHILE

STAGE THREE)

RMK/TESTATC2012

13:22:23 -----

BAA193

FF SGESNFPL SGASNFPL

271320 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWYZ/S

-SCEL1305
-N0434F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400
PULEN/N0441F370 UM400 IMBEK IMBEK1
-SBGR0315 SBGL
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCOF
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0308 SBCW0312 SEL/JRMS
RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE
RMK/TEST NUEVO FPL)

13:23:31 -----
BAA194
FF SGESNFPL SGASNFPL
271322 SCELZPZX
(FPL-LAN0001-IS
-A343/H-DE1E2FGHIJ5LM1OVRWXYZ/D1S
-SCEL1400
-N0468F410 ALBAL1 ALBAL UM424 ASADA ASADA6
-SAEZ0140 SACO
-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCQC
EET/SAMV0014 SAEU0055 SEL/KRDH OPR/LAN AIRLINE
RMK/TCAS EQUIPPED STAGE THREE RMK/TEST NUEVO FPL)

TRANSMITIDO A URUGUAY

13:08:07 -----
BMB406
FF SUMUNFPL SUMUZPZX SULSNFPL
271306 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWY/S
-SCEL1400
-N0438F350 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0107 SAME
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR
DOF/120927 REG/CCBAA EET/SAMV0012 SACU0041 SEL/QWER CODE/0A PER/A
RMK/TCAS EQUIPPED
TEST NUEVO FPL)

13:08:09 -----
BMB407
FF SUMUNFPL SUMUZPZX SULSNFPL
271302 SCELZPZX
(FPL-LAN0001-IS
-A318/M-DE1E2FGHILOVWYZ/S
-SCEL1400
-N0442F370 NEBEG1 YESOS UA307 ESITO UT650 CBA DCT 3109S06409W DCT
3109S06413W DCT
-SACO0106 SAME
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCVV EET/SAMV0012 SACU0041
SEL/CDEF

RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE FOUR
TEST NUEVO FPL)

13:10:38 -----

BMB412

FF SUMUNFPL SUMUZPZX SULSNFPL

271308 SCELZPZX

(FPL-LAN0001-IS

-A320/M-DE1E2FGHILOVRWY/S

-SCEL1655

-N0433F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400

SIKOB/N0441F370 UM400 IMBEK IMBEK1

-SBGR0316 SBKP

-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCBAL

EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0309 SBCW0313 SEL/GMLQ

TALT/SCel RMK/TCAS EQUIPPED CALLSIGN LAN CHILE

TEST NUEVO FPL)

13:12:03 -----

BMB414

FF SUMUNFPL SUMUZPZX SULSNFPL

271309 SCELZPZX

(FPL-LAN0001-IS

-B763/H-DE1E2FHILM1OVRWXYZ/S

-SCEL1400

-N0454F390 ALBAL1 ALBAL UM424 ASADA ASADA6

-SAEZ0132 SAME

-PBN/A1B3B4B5D3D4 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCDM

EET/SAMV0012 SAEU0044 SEL/AMHL RMK/CALLSIGN LAN CHILE

STAGE THREE TEST NUEVO FPL)

13:13:51 -----

BMB416

FF SUMUNFPL SUMUZPZX SULSNFPL

271311 SCELZPZX

(FPL-LAN0001-IS

-B763/H-DE1E2FGHILM1OVRWXYZ/S

-SCEL1400

-N0459F390 ALBAL1 ALBAL UM424 ASADA ASADA6

-SAEZ0131 SUMU

-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCBDD

EET/SAMV0012 SAEU0044 SEL/DQLP

RMK/TCAS EQUIPPED CALLSIGN LAN CHILE

STAGE THREE

TEST NUEVO FPL)

13:15:44 -----

BMB417

FF SUMUNFPL SUMUZPZX SULSNFPL

271313 SCELZPZX

(FPL-LAN0001-IS
-A319/M-DE1E2FGHILOVRWYZ/S
-SCEL1400
-N0386F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUT/TESTSUR
DOF/120927 REG/CCBCE EET/SAMV0013 SEL/GPKQ
RMK/TCAS EQUIPPED TEST NUEVO FPL)

13:18:50 -----
BMB419
FF SUMUNFPL SUMUZPZX SULSNFPL
271315 SCELZPZX
(FPL-LAN0001-IS
-A318/M-DE1E2FGHILOVWY/S
-SCEL1400
-N0388F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T1T2 COM/TESTCOM DAT/TESTDAT SUR/TESTSUR DOF/120927
REG/CCCVA EET/SAMV0013 SEL/CJBE CODE/003A PER/A
RMK/TCAS EQUIPPED RMK/STAGE FOUR
TEST NUEVO FPL)

13:20:02 -----
BMB420
FF SUMUNFPL SUMUZPZX SULSNFPL
271318 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWYZ/S
-SCEL1400
-N0396F270 NEBEG1 YESOS UA307 DOZ DCT
-SAME0034 SACO
-PBN/A1B1D1S1S2T2 NAV/PBN B1D1 DOF/120927 REG/CCCOM EET/SAMV0013
SEL/JSCR RMK/TCAS EQUIPPED CALLSIGN LAN CHILE
STAGE THREE)
RMK/TESTATC2012

13:22:21 -----
BMB423
FF SUMUNFPL SUMUZPZX SULSNFPL
271320 SCELZPZX
(FPL-LAN0001-IS
-A320/M-DE1E2FGHILOVRWYZ/S
-SCEL1305
-N0434F330 NEBEG1 YESOS UA307 ESITO/N0439F350 UT650 CBA UM400
PULEN/N0441F370 UM400 IMBEK IMBEK1
-SBGR0315 SBGL
-PBN/A1B1D1S1S2T1T2 DOF/120927 REG/CCCOF
EET/SAMV0012 SACU0041 SARU0124 SBCW0152 SBBS0308 SBCW0312 SEL/JRMS

RMK/TCAS EQUIPPED CALLSIGN LAN CHILE STAGE THREE
RMK/TEST NUEVO FPL)

13:23:29 -----

BMB424

FF SUMUNFPL SUMUZPZX SULSNFPL

271322 SCELZPZX

(FPL-LAN0001-IS

-A343/H-DE1E2FGHIJ5LM1OVRWXYZ/D1S

-SCEL1400

-N0468F410 ALBAL1 ALBAL UM424 ASADA ASADA6

-SAEZ0140 SACO

-PBN/A1B1D1O1 NAV/RNP10 RNAV5 RNAV1 DOF/120927 REG/CCCQC

EET/SAMV0014 SAEU0055 SEL/KRDH OPR/LAN AIRLINE

RMK/TCAS EQUIPPED STAGE THREE RMK/TEST NUEVO FPL)

13:26:21 -----

BMB425

FF SULSNFPL SUMUNFPL SUMUZPZX

271315 SAEZXLXL

(FPL-LAP721-IS

-A320/M-SDGHIRWYZ/S

-SAEZ1250

-N0453F350 PTA6A KUKEN UM654 SIDUL/N0453F370 UM654 VUPIT

UM400 GEDEL DCT PNG UM548 RONUT RONUT2

-SBGR0236 SBGL SBKP

-PBN/B1O1 NAV/B1O1 REG/PRMAR EET/SAEU0015 SUEO0019 SBCW0053

SBBS0226 SBCW0230 SEL/SGHR OPR/TAM MERCOSUR PER/038622 RMK/TCAS II

EQPD

RMK/FPL DE PRUEBA CFME RX)

13:27:38 -----

BMB426

GG SULSNFPL SUMUNFPL SUMUZPZX

271326 SKBOFPLA

(FPL-AVA087-IS

-A332/H-SABCDE2GHIJ3KM2RTUWXYZ/SLG1

-SKBO0310

-N0466F390 QUEZA1A QUEZA VVC SJE UA301 LET RBC UL417 ERE UA558 MULTA

UW24 SNT SNT6A

-SAEZ0546 SAAR SACO

-PBN/A1B1C1D1L1O1S1T1 NAV/GBAS SBAS DOF/120930 REG/N973AV

EET/MPZL0041 EET/SPIM0106 SKED0113 SBAZ0121 SLLF0215 SACF0348

SAEF0458 RMK/TEST01 NUEVO FORMATO FPL SKBO)

13:45:38 -----

BMB431

GG SULSNFPL SUMUNFPL SUMUZPZX

271344 SKBOFPLA

(FPL-LAN573-IS
-B763/H-SABCDE2GHIJ3KM2RTUWXYZ/SLG1
-SKBO0456
-N0466F330 KAMIS2B GIR UA550 BOKAN GYV/M079F350 UL780 TRU/N0464F350
UG436 LIM/M079F350 UL302 ASEPU/M076F310 UL302 ATEDA/M070F250 UL302
TOY/N0427F250 UW208 EMBAL ANDES3
-SCEL0539 SAME SACO
-PBN/A1B1C1D1L1O1S1T1 NAV/GBAS SBAS DOF/120930 REG/N973AV
EET/SEGU0043 SPIM0128 SCFZ0322 SCEZ0447 RMK/TEST02 NUEVO FORMATO FPL
SKBO)

13:46:12 -----
BMB432
GG SULSNFPL SUMUNFPL SUMUZPZX
271345 SKBOFPLA
(FPL-TAM8017-IS
-A320/M-SABCDE2GHIJ7KM2RTUWXYZ/PB2V2
-SKBO0011
-N0456F370 QUEZA1A QUEZA VVC UA317 MTU UL201 ABIDE EGLER UL201 PIR
PIRA7
-SBGR0519 SBGL SBKP
-PBN/A1B1C1D1L1O1S1T1 NAV/GBAS SBAS DOF/120930 REG/N952AV
EET/SBAZ0051 SBBS0315 SBCW0513 RALT/SKBO SPQT SBEG SBBR SBGR
RIF/ARPAR UM402 MNS DCT SBEG RMK/TEST03 NUEVO FORMATO FPL SKBO)

13:46:46 -----
BMB433
FF SUMUNFPL SUMUZPZX SULSNFPL
271330 SACOZRXX
(FPL-TESTE02-IG
-1B733/M-CDEFGHIOTUVWXYZ/APS
-SMJP1500
-N0436F360 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ SMJP
-NAV/RNAV10 RNAV5 GNSS RNAV2 DME DME IRU RNAV1 RNP AR APCH NAV/LPV
GBAS DOF/121002 REG/PZTCN EET/0013 SEL/HKMR PER/M074 TALT/SMJP
RMK/TEST FLIGHTPLAN. DAT/S FMC WPR ACARS)

13:49:14 -----
BMB434
FF SUMUNFPL SUMUZPZX SULSNFPL
271336 SGASYFYX
(FPL-TESTE02-IS
-1B733/M-ABCDE1FGHIJ56J7LORTUVWXYZ/APSB1V2D1
-SMJP1500
-N0463F370 DCT VILAS UG449 BEL DCT
-SBBE0132 SBMQ
-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN
EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074
TALT/SMJP RMK/TEST FLIGHTPLAN)

13:50:46 -----

BMB435

FF SUMUZPZX SULSNFPL SUMUNFPL

271336 SGESZTZX

RECIBIDO 5/5

(FPL-TESTE02-IS

-1B733/M-ABCDE1FGHIJ56J7LORTUVWXYZ/APSB1V2D1

-SMJP1500

-N0463F370 DCT VILAS UG449 BEL DCT

-SBBE0132 SBMQ

-STS/FLTCK PBN/A1B2C4D1T2 NAV/GBAS SBAS DOF/121002 REG/PZTCN

EET/SOOO0013 DORLI0025 SBAZ0036 SEL/HKMR ORGN/SMJPYFYX PER/M074

TALT/SMJP RMK/TEST FLIGHTPLAN)

13:51:28 -----

BMB436

GG SULSNFPL SUMUNFPL SUMUZPZX

271350 SKBOFPLA

(FPL-TPA831-IN

-B762/H-SABCDE3GHIJ6KM3RTUWXYZ/XB2U2

-SKBO2017

-N0475F350 QUEZQ1A QUEZA B689 VVC UB689 PABON UL417 RBC UA321 DCT

-SGAS0435 SGES SBCT

-PBN/A1B1C1D1L1O1S1T1 NAV/GBAS SBAS DOF/120930 REG/N771QT EET/SBA0115

SLLF0212 SGFA0335 SEL/EQCS RMK/TEST04 NUEVO FORMATO FPL SKBO)

13:54:43 -----

BMB440

GG SULSNFPL SUMUNFPL SUMUZPZX

271353 SKBOFPLA

(FPL-TPA800-IN

-B762/H-SABCE3GHIJ7KM3RTVWXYZ/SLB2U2V2

-SKBO0044

-N0475F360 MECHI3A ABL W36 DAKMO UA317 TBG V4 TUM

-MPTO0115 SKBQ SKRG

-STS/STATE PBN/A1B1C1D1L1O1S1T1 NAV/GBAS SBAS DOF/120929 REG/N767QT

EET/MPZL0045 RMK/TEST05 NUEVO FORMATO FPL SKBO)

14:08:01 -----

BMB452

FF SUMUNFPL SUMUZPZX SULSNFPL

271336 SGASYFYX

(FPL-TPU030T-IS

-1A320/M-SDE2E3FGHIRW/S

-SPIM1520

-N0443F380 TIMOR3 ATOGO UM674 TBG UL465 GMC UG448 TADPO

G448 MTH DVALL1

-KMIA0522 KPBI

-PBN/NAV/A1B1 DOF/120930 REG/N680TA EET/SEGU0116 SKED0154 MPZL0229
MKJK0341 MUFH0422 KZMA0454 SEL/AFDS RALT/SPIM SPST SKCL MPTO MWCR
KMIA RMK/TESTE01 TACA NFPL)

14:34:05 -----

BMB469

FF SULSNFPL SUMUNFPL SUMUZPZX

271427 SPIMFDPI

(FPL-TESTPER-IS

-A319/M-GJ1E2WHKM1/B1AEV2

-SPIM1500

-N0350F310 SPIM SLS UL305 TERAS UL305 DCT BOG

-SKBO0330 SKCL

-PBN/A1B1B2 DAT/V DOF/120927 REG/TEST SEL/SDFG RMK/TEST PERU

EET/SKED0230 NAV/RNAV5

14:40:12 -----

BMB474

FF SULSNFPL SUMUFPLX SUMUZPZX

271433 SPIMFDPI

(FPL-TESTPER-IS

-B763/H-SWRGJ1E1I/HB2G1

-SPIM1740

-N0472F320 SPIM EVRID UL344 AMERO UL344 ARTOM/N0469F340 UL344 ACA UJ3

KEDMA/N0459F360 UJ3 MZT UJ7 PPE J93 AXASA/N0454F240 J93 JLI VISTA2

-KLAX0812 KONT

-PBN/A1B1B3 NAV/B1 DAT/HV DOF/120927 REG/CCCXG EET/SEGU0128 MHCC0213

MMID0400 MMEX0407 MMZT0524 KZLA0739 SEL/SWED RMK/TEST PERU

14:55:26 -----

BMB483

FF SULSNFPL SUMUNFPL SUMUZPZX

271454 SPIMYFYB

FPL-TESTPER-IS

-A319/M-GJ1E2WHKM1/B1AEV2

-SPIM1500

-N0350F310 SPIM SLS UL305 TERAS UL305 DCT BOG

-SKBO0330 SKCL

-PBN/A1B1B2 DAT/V DOF/120927 REG/TEST SEL/SDFG RMK/TEST PERU

EET/SKED0230 NAV/RNAV5

14:57:27 -----

BMB486

FF SULSNFPL SUMUNFPL SUMUZPZX

271441 SPIMYUYX

ATTN PERSONAL RESPONSABLE DE LAS PRUEBAS NFPL:

PARA EL ENVIO DE LOS MENSAJES FPL DE PRUEBA CON EL NUEVO
FORMATO, SIRVANSE CONSIDERAR LA DIRECCION SPIMFDPI, PARA

EL ENVIO DE DICHOS MENSAJES DE PRUEBA A NUESTRO CENTRO.

ALFREDO HARVEY PALOMINO

JUAN PABLO PORTILLA

RAUL ANASTACIO GRANDA

15:02:23 -----

BMB493

FF SULSNFPL SUMUNFPL SUMUZPZX

271500 SPIMYFYB

FPL-TESTPER-IS

-B763/H-SWRGJD1E1I/HB2G1

-SPIM1740

-N0472F320 SPIM EVRID UL344 AMERO UL344 ARTOM/N0469F340 UL344 ACA UJ3

KEDMA/N0459F360 UJ3 MZT UJ7 PPE J93 AXASA/N0454F240 J93 JLI VISTA2

-KLAX0812 KONT

-PBN/A1B1B3 NAV/B1 DAT/HV DOF/120927 REG/CCCXG EET/SEGU0128 MHCC0213

MMID0400 MMEX0407 MMZT0524 KZLA0739 SEL/SWED RMK/TESTPERU

15:27:14 -----

BMB515

GG SULSNFPL SUMUNFPL SUMUZPZX

271521 SKBOFPLA

SVC FINALIZAMOS LAS PRUEBAS.

GRACIAS POR SU COOP

15:48:55 -----

BMB528

FF SUEOZQZX SUMUZPZX SUMUZTZX

271546 SGASZPZX

(FPL-LAP706-IS

-A320/M-VOLDHIWYZ/S

-SGAS1600

-N0460F370 DCT KAMIL DCT TELIX UM548 RONUT RONUT3

-SACO0118 SARE SUMU

-NAV/RNP1 01 NAV/RNAV5 01 REG/PRMAG EET/SARE0020 SEL/ZZZZ

OPR/TAM)MSG PRUEBA

16:01:32 -----

BMB543

GG SUMUNFPL SUMUZPZX SULSNFPL

271551 SCSCYFAX

SVC CON RESPECTO A LAS PRUEBAS REALIZADAS DIA HOY NFPL, AGRADECERE

SUS COMENTARIOS SOBRE LOS NFPL EMITIDOS POR SCELZPZX COMO LAN0001

Y RMK/TEST NUEVO FPL.

DIRECCIONAR MENSAJE A SCSCYFAX. GRACIAS.

- - - - -